



00278393

Colorado  
well File

## DOUBLE "D" ENTERPRISES

RECEIVED

B.O.P. Test Report

JUN 23 1986

COLORADO OIL &amp; GAS COMMISSION

B.O.P. TEST PERFORMED ON (DATE) June 17, 1986

OIL CO.: Amoco

WELL NAME &amp; NUMBER Cold Springs #1

SECTION 24

TOWNSHIP 11N

RANGE 102W

COUNTY Moffat

DRILLING CONTRACTOR Parker #173

INVOICES BILLED FROM: DOUBLE "D" ENTERPRISES, INC.  
213 Pine Street - Box 560  
Shoshoni, Wyoming 82649  
Phone: (307) 876-2308 or (307) 876-2234

TESTED BY: DOUBLE "D" ENTERPRISES, INC.  
Box 2097  
Evanston, Wyoming 82930  
Phone: (307) 789-9213 or (307) 789-9214

OIL CO. SITE REPRESENTATIVE Jim

RIG TOOL PUSHER

TESTED OUT OF Evanston, Wyoming

NOTIFIED PRIOR TO TEST: B.L.M./R.O. Randles witnessed test

COPIES OF THIS TEST REPORT SENT COPIES TO: Site Representative

Colorado State

B.L.M.

ORIGINAL CHART &amp; TEST REPORT ON FILE AT Evanston

OFFICE



# DOUBLE "D" ENTERPRISES, INC.

P.O. Box 560  
Shoshoni, Wyoming 82649  
307-876-2308

DELIVERY TICKET

Nº 4160

Date 6-17-86

Operator Ameco

Contractor Parker

Rig No. 173

Ordered By Jim

Lease Cold Springs

Well No. #1

County Moffat

Section 24

Township 11N

Range 102W

## Items Tested:

	Low Test	Time Held	High Test	Time Held	Comments
Top Pipe Rams			10.000	15 mins	
Bottom Pipe Rams			10.000	15 mins	
Blind Rams			10.000	15 mins	
Annular B.O.P.			5.000	15 mins	
Choke Manifold			10.000	15 mins	
Choke Line			10.000	15 mins	
Kill Line			10.000	15 mins	
Super Choke			10.000	15 mins	
Upper Kelly			10.000	15 mins	
Lower Kelly			10.000	15 mins	
Floor Valve					
Dart Valve			10.000	15 mins	

Closing Unit Psi 3000

Closing Time of Rams 35 sec

Closing Time of Hydril 10 sec

Closed Casing Head Valve yes

Set Wear Sleeve yes

Comments R.O. Randles BLM witness

changed out Hydril rubber







Amoco Coldsprings

6-17-86


1. 3:10-3:25 test 3 inside manuals on manifold
2. 3:30-3:45 test super choke  
3:50 to 4:35 rig out of the hole pulled wearing filled hole ram  
test plug + makeup tools
3. 4:45 Leak on lower pipe ram door on drillers side
4. 5:00-5:15 test lower pipes, TIW valve
5. 5:19-5:34 test Upper pipes TIW. HCR valve on choke line  
manual on Kill line
6. 5:38 Leak on TIW Key hole seal  
pulled joint to repair TIW valve
7. 6:00-6:15 test Blind rams, outside 3 manuals on manifold  
check valve on Kill line
8. 6:25-6:40 test top pipes, manual on choke line, manual  
on Kill line, dart valve
9. worked Hydriil no test  
Increased Annular psi. worked several times  
no test  
toe apart TIW body is cracked, put back together
10. no test on TIW valve stem still leaking
11. 10:40-10:55 test Lower Kelly
12. 11:00-11:25 test Upper Kelly
13. 11:30-11:50 test manual choke on manifold  
wait on new Hydriil rubber, change out bladders  
run plug to retest
14. 12:50-10:15 test Hydriil - vertical riser to 5000



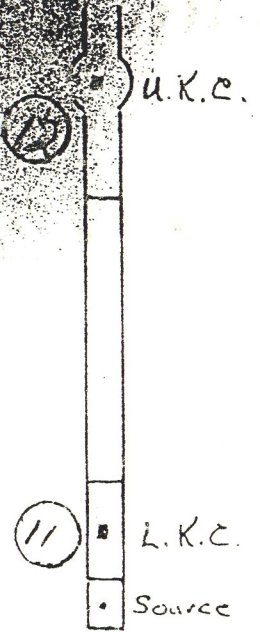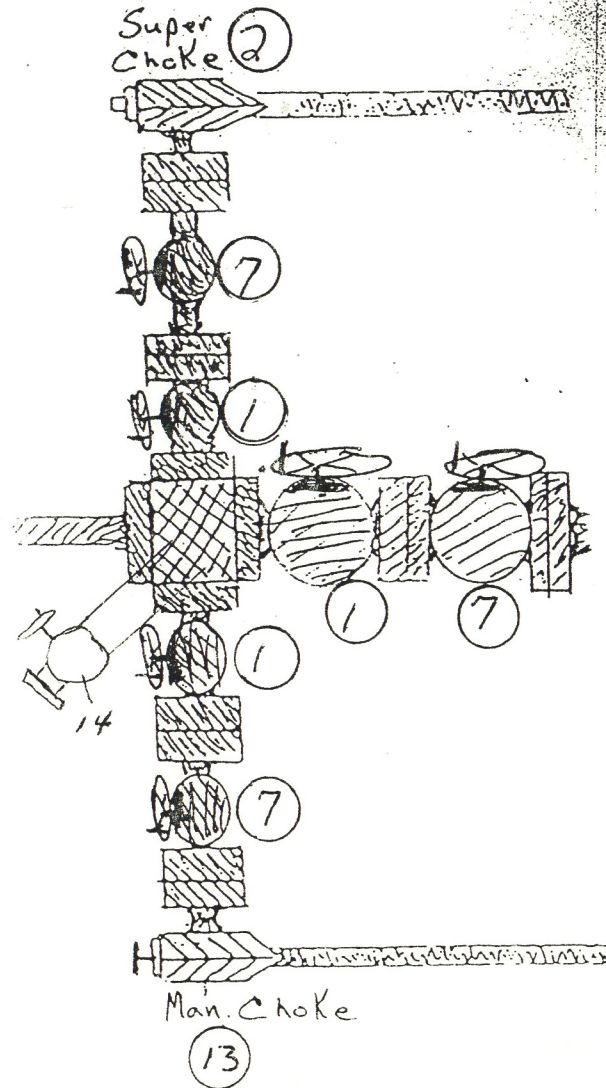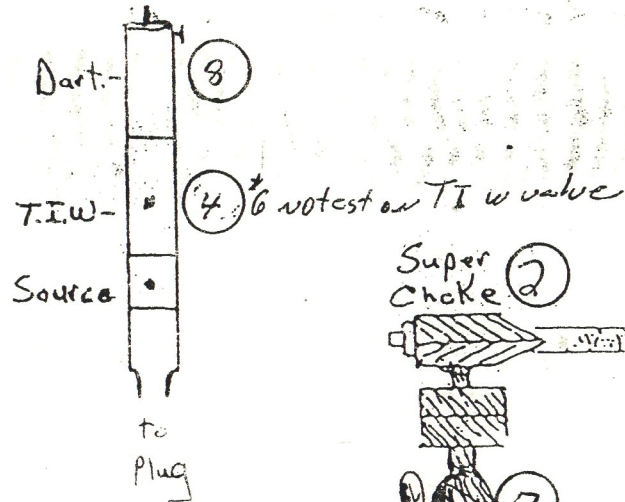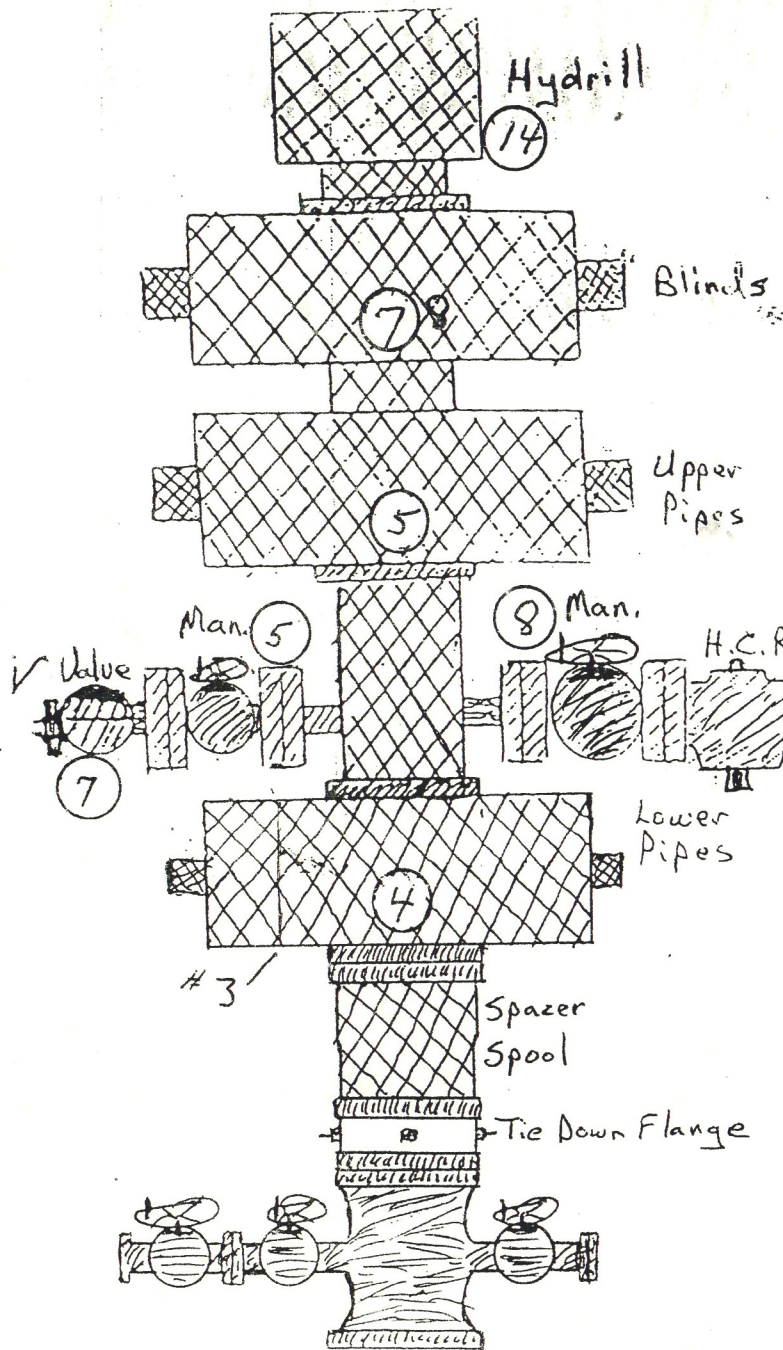

10" Cameron  
4 1/2" I.F.



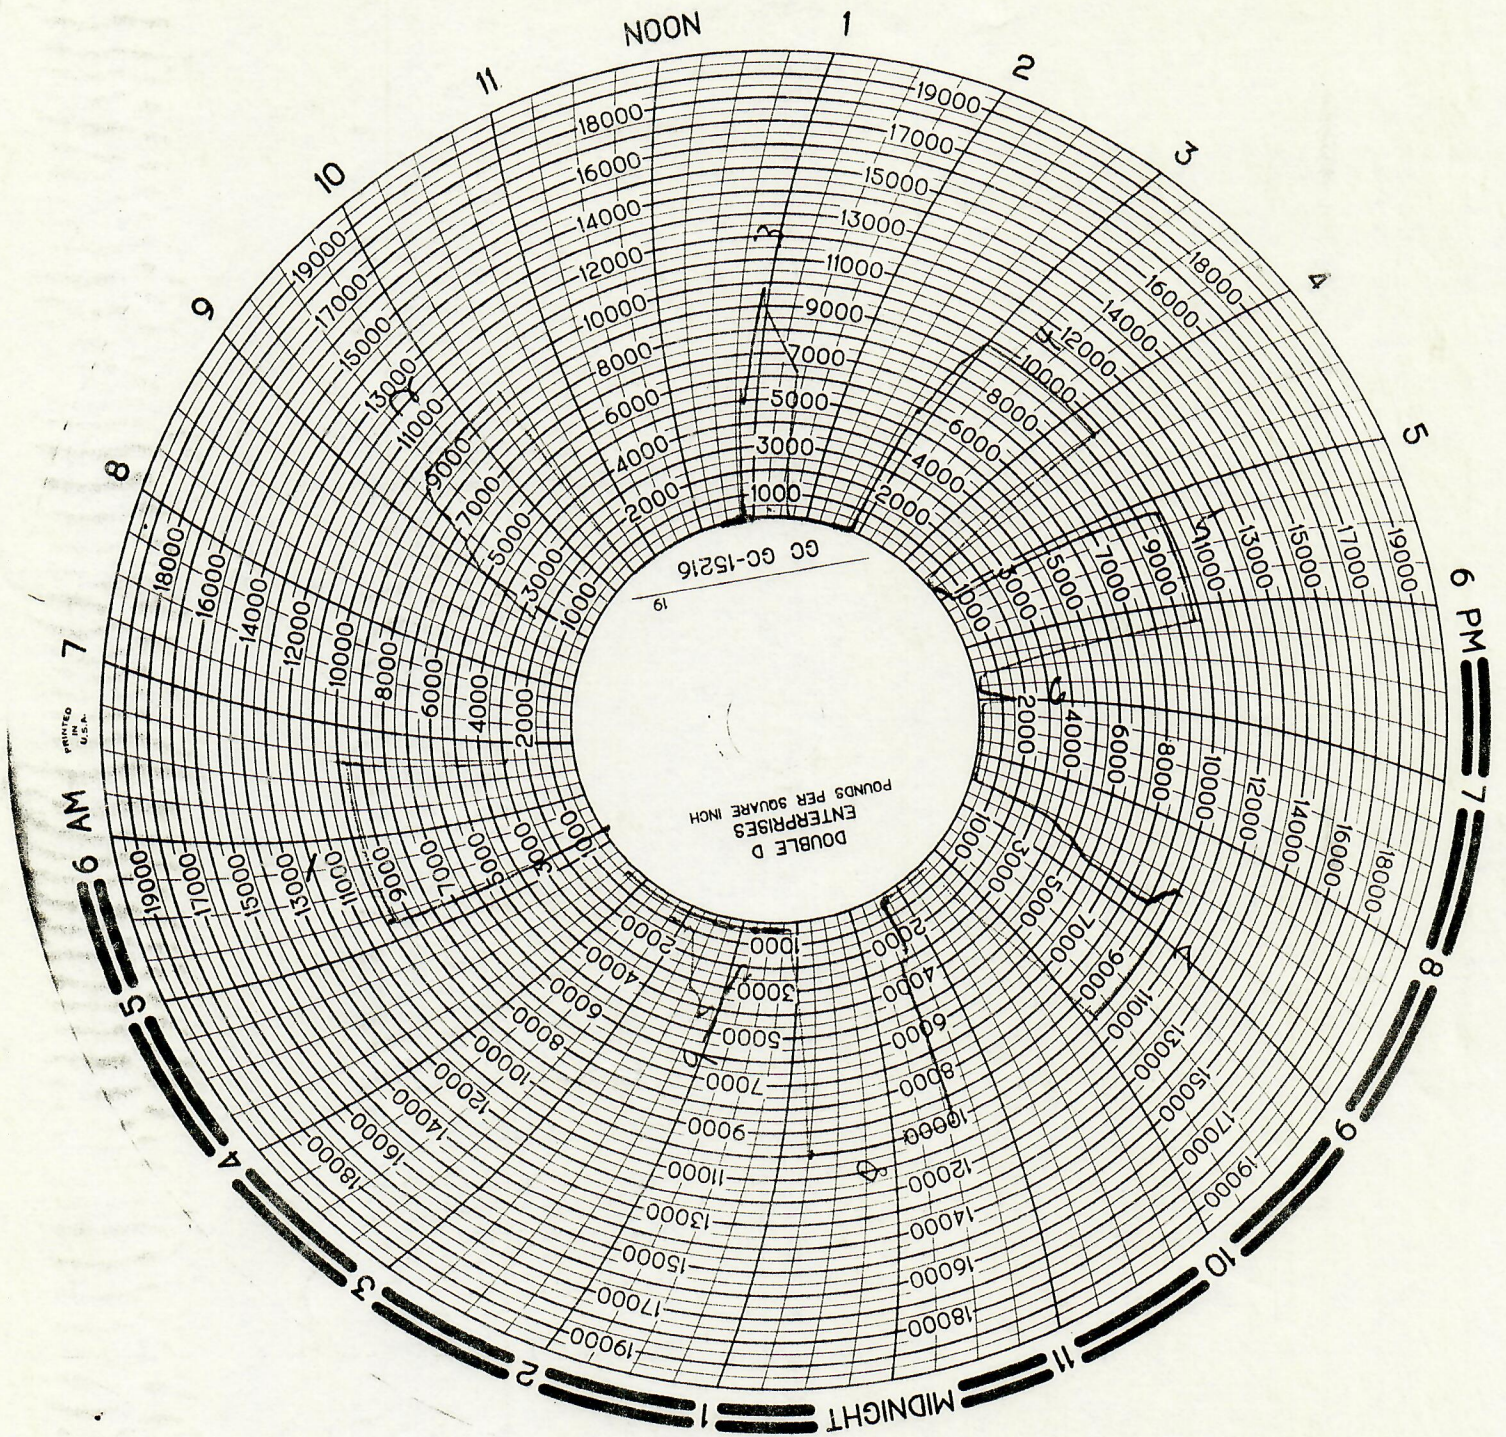

PRINTED  
U.S.A.



