



00238755

RECOMPLETION PROGNOSIS  
MOUNT HOPE WATER FLOOD  
UNIT 47-WI (Formerly Shell-Green A15)



Present Status:

NW SE 30-9N-S3W

DF: 4169 DF

AFE: C-6416

DF-CHF: 10.75'

(All depths refer to open hole logs.)

Proposed Work:

1. Pull any production equipment in hole. Run sand pump and clean out below 4920.
2. Set CIBP @ 4920 and cap w/1 sx cement.
3. Run tubing and packer and pressure test BP to 3000 psi. Install injection equipment and begin injecting down casing. Consult w/Division. (If unable to establish satisfactory rate, consider acidizing.)

Perfs Open  
Muddy

4845-4849


Dakota

4952-4958

PBTD 4965

5- $\frac{1}{2}$ " @ 4999

TD 5011

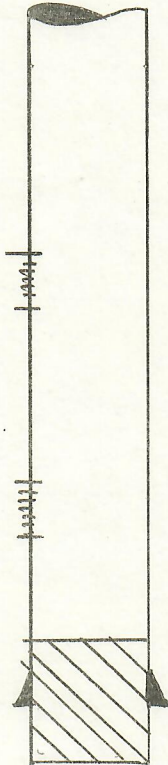

*J. D. Sweet*  
J. D. Sweet

*E. H. Saye*

for J. E. Saye

*A. T. Rylands*  
A. T. Rylands

RGM/kw *gk*  
Billings, Montana  
November 20, 1962