

Inspection Photos

8/23/2021

Operator: NONSUCH NATURAL GAS INC

#10163

Location ID: 453726

Garfield County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: NONSUCH NATURAL GAS INC #10163
Location ID: 453726



Photo 1: Photo shows unused equipment, and/or equipment not necessary for production on the Location. Previous inspections required Operator to submit a Form 4 with records identifying equipment's (Methanol tank, separator, meter shed) current statuses and use for production on the Location by 10/2/2020; Operator failed to submit Form 4 with records; Inspection #696202916 required Operator to comply with Rule 606.a and remove equipment not necessary for use on the Location. To date, records identifying equipment's use and need has not been submitted, and equipment has not been removed.



Inspection Photos

Operator Name: NONSUCH NATURAL GAS INC #10163

Location ID: 453726



Photo 2: Previous inspection observed that protection equipment to prevent wildlife access to the secondary containment BMP at the 500 gallon methanol tank, and the separator was missing or insufficient. Photos show wildlife protection equipment remains missing or insufficient.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: NONSUCH NATURAL GAS INC #10163

Location ID: 453726



Photo 3: Photo shows example of noxious weeds on the Location that appear to have been sprayed; additional weed management appears to have been conducted; however a File Inspection Report Resolution form was not submitted by the Operator upon completion of the corrective action in accordance with Rule 210.b.

Inspection Photos

Operator Name: NONSUCH NATURAL GAS INC #10163

Location ID: 453726



Photo 4: Photos taken from the south end of the Location. Photos show that BMPs to protect and stabilize unpaved areas of the Location and access road, and to allow for sediment laden-free stormwater discharge remain missing, or insufficient; stormwater runoff has resulted in erosion degradation and offsite sediment discharge at Location entrance and access road.

Inspection Photos

Operator Name: NONSUCH NATURAL GAS INC #10163

Location ID: 453726



Photo 5: Photos taken from the access road, south of the Location. Photos show that BMPs to protect and stabilize unpaved areas of the Location and access road, and to allow for sediment laden-free stormwater discharge remain missing, or insufficient; stormwater runoff has resulted in erosion degradation and offsite sediment discharge at Location entrance and access road.

Inspection Photos

Operator Name: NONSUCH NATURAL GAS INC #10163

Location ID: 453726



Photo 6: Photos taken from the access road, south of the Location. Photos show that BMPs to protect and stabilize unpaved areas of the Location and access road, and to allow for sediment laden-free stormwater discharge remain missing, or insufficient; stormwater runoff has resulted in erosion degradation and offsite sediment discharge at Location entrance and access road.. Photo on right also shows sediment deposition due to runoff from the Location.

Inspection Photos
Operator Name: NONSUCH NATURAL GAS INC #10163
Location ID: 453726



August 23, 2021

Photo 7: Photo taken with use of a sUAS; aerial photo shows south end of the Location/Location entrance and access road (see photos 4). Photo shows stormwater runoff from the Location has resulted in erosion degradation.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos
Operator Name: NONSUCH NATURAL GAS INC #10163
Location ID: 453726

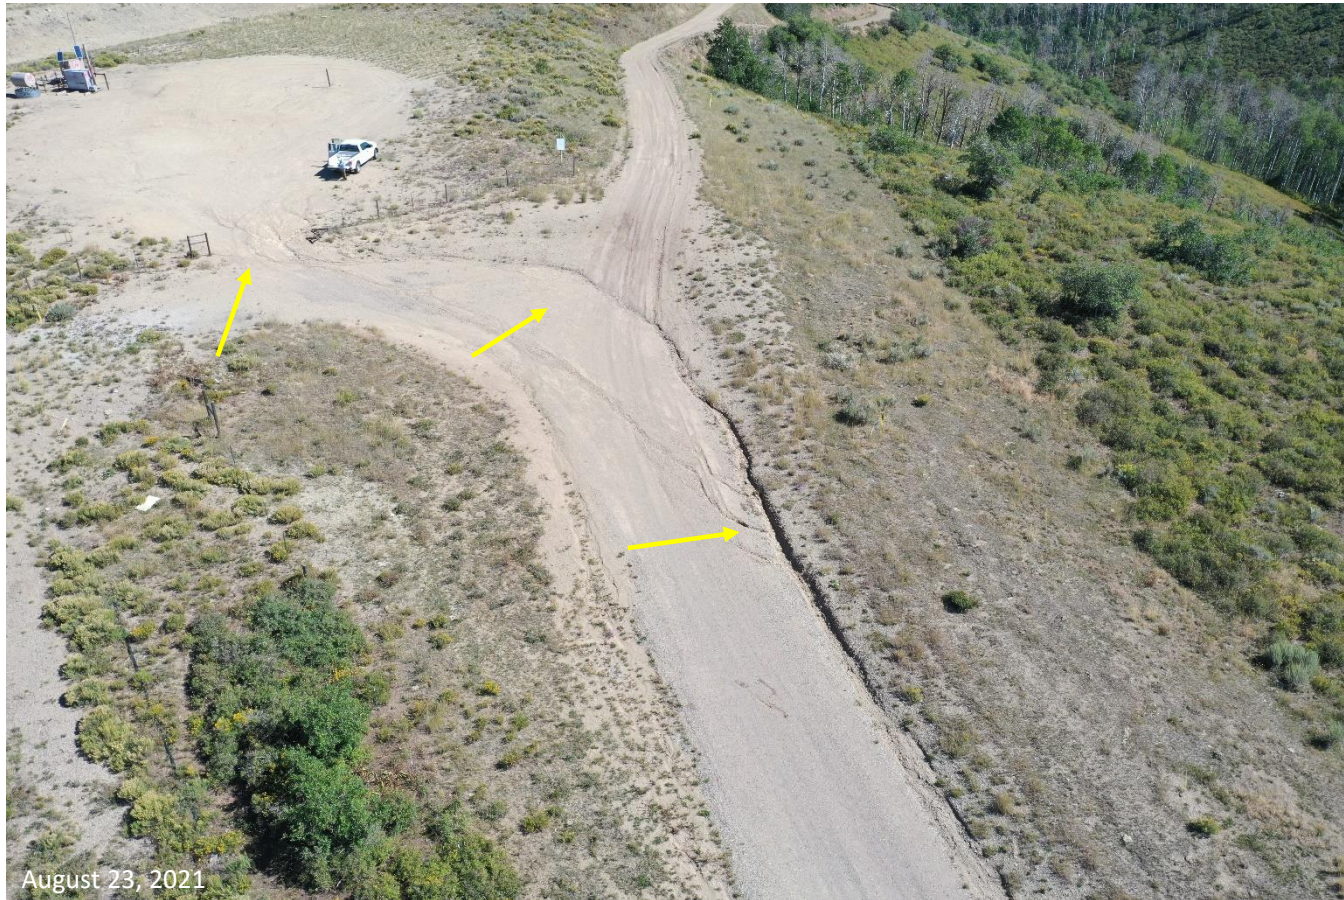


Photo 8: Photo taken with use of a sUAS; aerial photo shows access road and. Photo shows stormwater runoff from the Location has resulted in erosion degradation.



Inspection Photos
Operator Name: NONSUCH NATURAL GAS INC #10163
Location ID: 453726



Photo 9: Aerial photo of sediment deposition observed in photo 6