

Inspection Photos

October 20, 2022

Operator: Crowheart Energy LLC - #10776

Location ID: 313190

Location Name: Bakers Peak Unit-611N91W /12SWSE

Inspection Document #: 702800836

Moffat County, CO

SWSE Section 12 T11N R91W

Anna O'Malley
Reclamation Specialist, COGCC



COLORADO

**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos

Location Name: Bakers Peak Unit-611N91W /12SWSE

Location ID: 313190



Photo 1. Photo taken from the northwest of the Location shows the access road has been ripped. Soil pits and shovel penetration tests throughout the road indicated a maximum ripping depth of 12 inches, sometimes less. 1004 Rules require ripping to a depth of 18 inches.



Photo 2. Photo shows the depth of shovel penetration on the ripped access road is 30 cm (12 inches). Other areas appeared to be ripped shallower.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 702800836

Inspection Photos
Location Name: Bakers Peak Unit-611N91W /12SWSE
Location ID: 313190

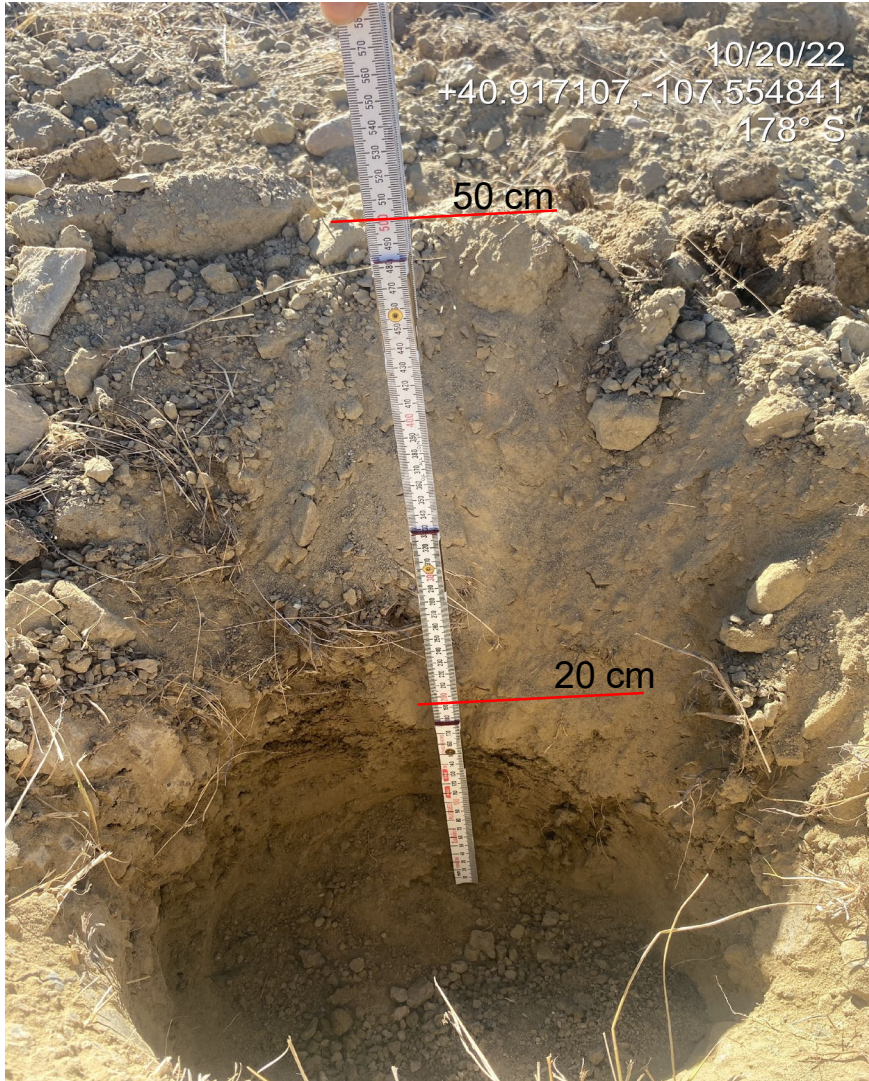


Photo 3. Photo shows a soil pit dug on the ripped access road. Ripped soil in photo is approximately 30 cm (12 inches). Below 12 inches the soil does not appear to be ripped.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 702800836

Inspection Photos

Location Name: Bakers Peak Unit-611N91W /12SWSE

Location ID: 313190



Photo 4. Photo taken from the southeast shows an overview of the Location.



Photo 5. Photo shows the Location appears to have been ripped to approximately 30 cm (12 inches).



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 702800836

Inspection Photos

Location Name: Bakers Peak Unit-611N91W /12SWSE

Location ID: 313190



Photo 6. Photo shows the Location has been ripped in one direction. Soils have not been “cross-ripped” with overlapping passes.



Photo 7. Photo shows a the Location has been ripped in one direction. Shovel was unable to penetrate a continuous strip of unripped soil. “Cross-ripping” means passes should be overlapping. Red line indicates direction of rip. Blue line indicates additional rip direction needed.



COLORADO
Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 702800836

Inspection Photos

Location Name: Bakers Peak Unit-611N91W /12SWSE

Location ID: 313190



Photo 8. Photo shows bull thistle (noxious weed) seed in recently ripped soil. Ongoing weed management will be required.



Photo 9. Photo shows a bull thistle (noxious weed) plant going to seed adjacent to recently ripped soil. Ongoing weed management will be required.



COLORADO

Oil & Gas Conservation
Commission

Department of Natural Resources

Inspection Number: 702800836