

Interim Reclamation and Stormwater Inspection

Date: 01/13/2023

Operator: IMPETRO RESOURCES LLC - 10690

Location ID: 317093

Inspection Document #: 696105685

Washington County, CO

SWNE Section 21 T2N R49W

Dylan Edwardson
Reclamation Specialist, COGCC



COLORADO

**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos
Location Name: Stennett
Location ID: 317093



Photos 1 & 2. Facing south and southeast at tank battery. NFPA placards are missing and or not legible.

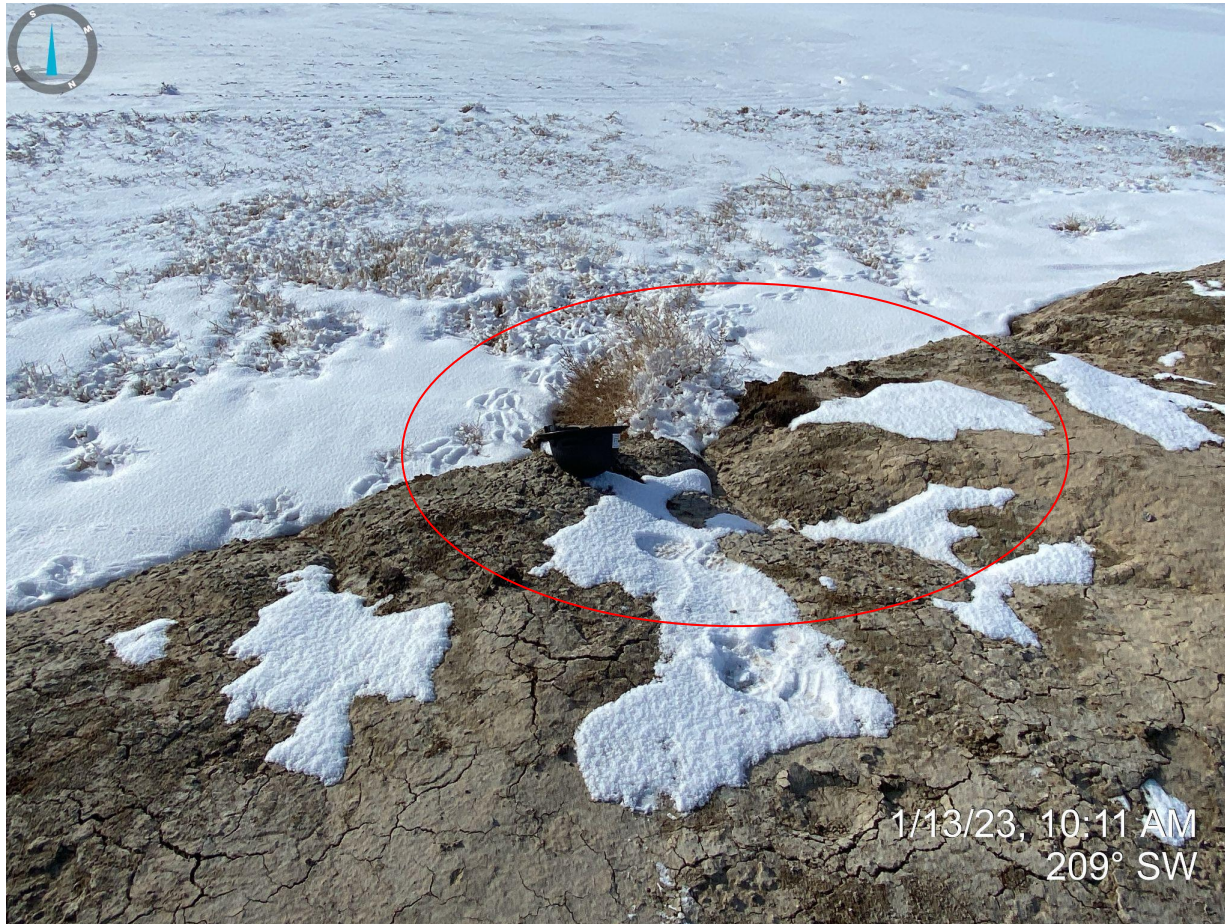


Photo 3. Facing southwest from southern pit wall. Photo illustrates gully erosion on pit wall with hard hat for scale.



Photo 4. Facing east from the southern pit wall. Photo illustrates unconsolidated material comprising the walls with evidence of rill and gully erosion. Snow cover is obstructing view of adjacent ground and a follow-up inspection will be constructed at a later date to assess site conditions.

Inspection Photos
Location Name: Stennett
Location ID: 317093

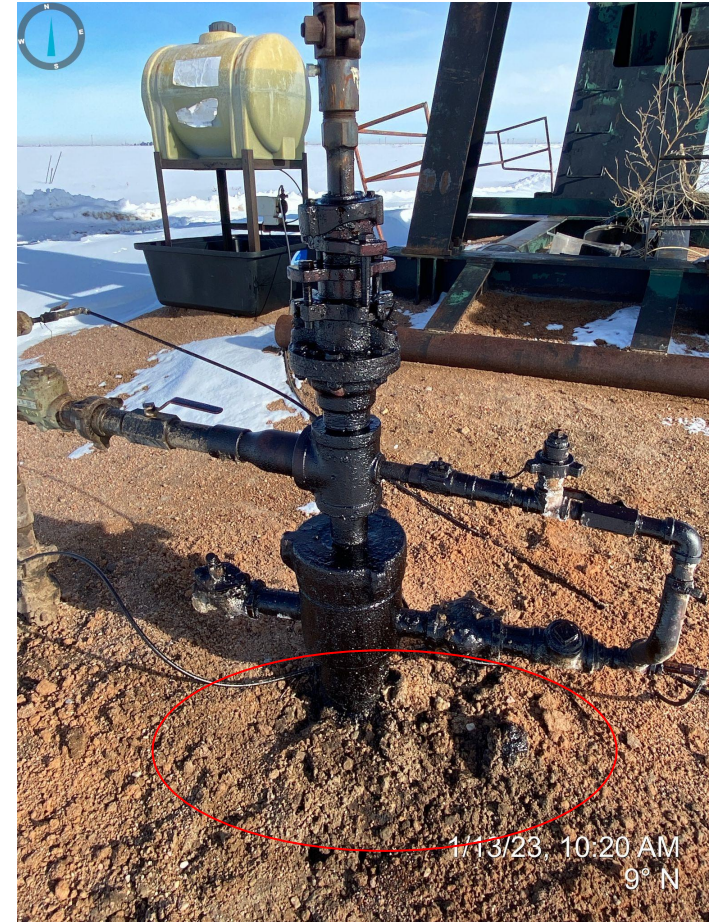


Photo 5. Facing north from the northern pit wall. See comments in Photos 3 & 4.



Photo 6 . Facing east from the northern pit wall. Photo illustrates rill and gully erosion occurring on both the interior and exterior walls.

Inspection Photos
Location Name: Stennett
Location ID: 317093



Photos 7 & 8. Facing west and north from the wellhead/pump jack. Photo illustrates a leaking wellhead at fittings and polishing rod. Stained soil (outlined in red) will need to be removed.