

Construction and Stormwater Inspection

January 17, 2023

Operator: ENERPLUS RESOURCES (USA) CORPORATION - #10177

Location ID: 478120

Inspection Document #: 697504482

Weld County, CO

SWSW Section 26 T8N R67W

Chris Binschus
Reclamation Specialist, COGCC



COLORADO
**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos
Location Name: Calgary Streets/
Location ID: 478120

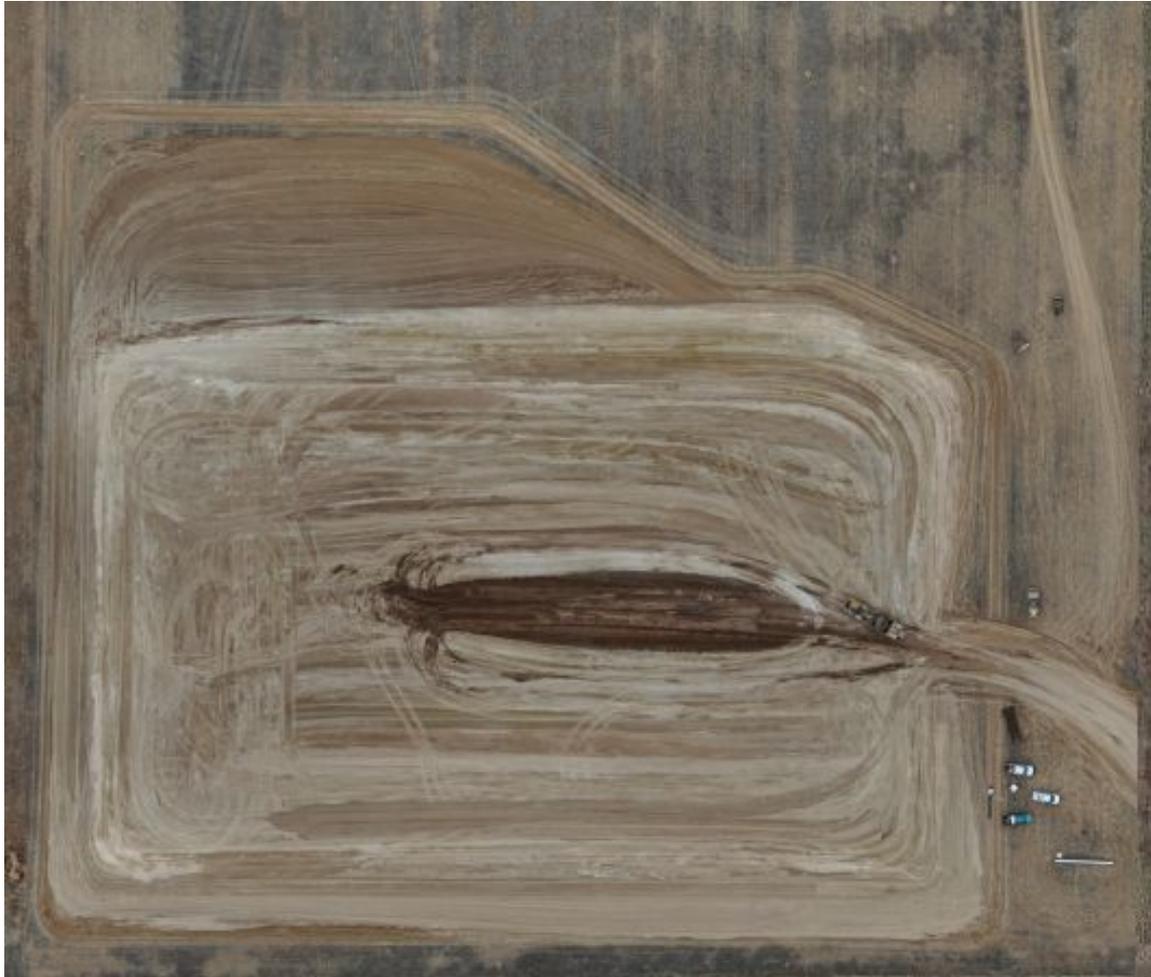


Photo 1. COGCC drone imagery illustrates the location and a disturbance area of 7.95 acres. The stockpile observed in the central location is topsoil from the access road being salvaged. Note- Operator was utilizing a temporary access road north of the location that was not permitted but is owned by Enerplus. See next photo for additional details.

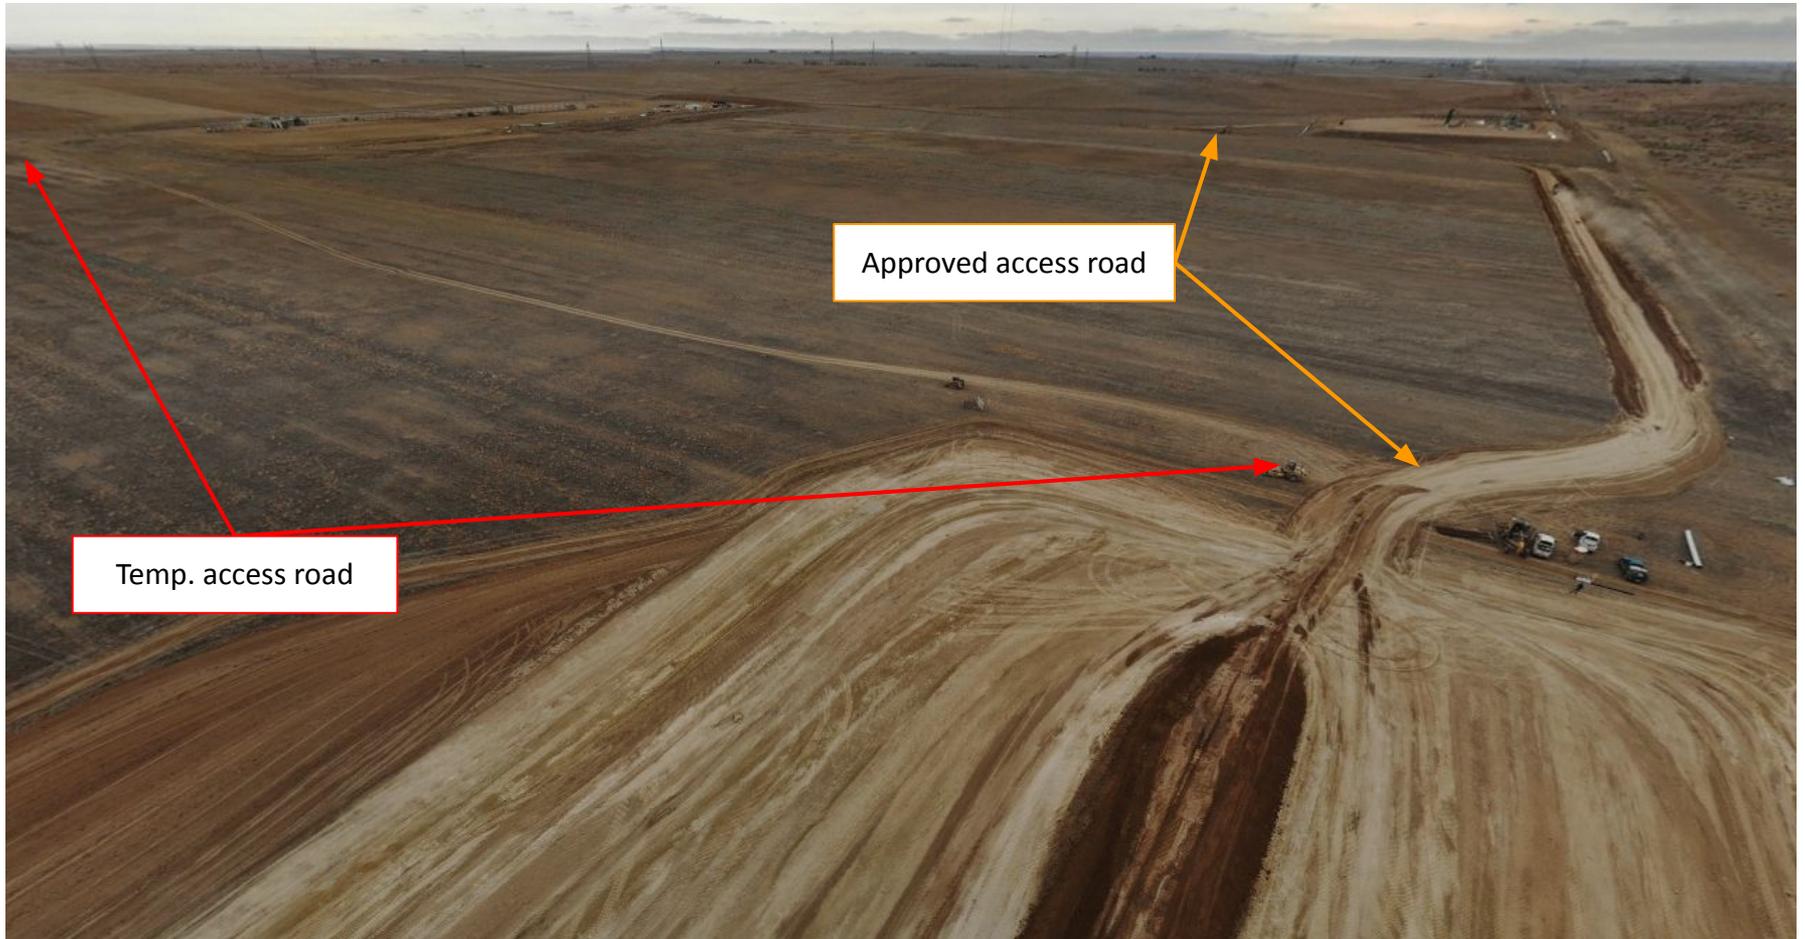


Photo 2. COGCC drone imagery illustrates the temporary access road north of the location that was not permitted and the approved access road.

Inspection Photos
Location Name: Calgary Streets/
Location ID: 478120



Photo 3. Photo taken from the southern location, facing West. Photo illustrates the fill slope material has filled in the temporary stormwater ditch and berm BMP. Note- Operator appears to be constructing a detention pond or detention berm along the southern location per Weld County standards.



Photo 4. Photo taken from the southwestern location, facing East. Photo illustrates the temporary stormwater ditch and berm BMP without fill slope material.

Inspection Photos
Location Name: Calgary Streets/
Location ID: 478120



Photo 5. Photo taken from the southwestern location, facing East. Photo illustrates what appears to be the start of construction for the detention pond or detention berm.



Photo 6. Photo taken from the northwestern location, facing East. Photo illustrates the temporary stormwater ditch and berm BMP and the topsoil stockpile.

Inspection Photos
Location Name: Calgary Streets/
Location ID: 478120



Photo 7. Photo taken from a portion of the access road, facing West. Photo illustrates the Operator is stockpiling/applying topsoil to an approximate depth of 6" along the ditch area of the access road to facilitate final reclamation.



Photo 8. Photo taken from the entrance of the approved access road, facing South. Operator is in process of constructing the access road and completing the culvert installation.