

# Interim Reclamation and Stormwater Inspection

Date: 03/31/2023

Operator: SUMMIT OIL & GAS LLC - 10774

Location ID: 465272

Inspection Document #: 708200090

Weld County, CO

SWSE Section 12 T7N R59W

Dylan Edwardson  
Reclamation Specialist, COGCC



**COLORADO**

**Oil & Gas Conservation  
Commission**

Department of Natural Resources

Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 1.** Facing east from the topsoil stockpile. It appears the Operator has performed work to stabilize the topsoil with evidence of drill rows and mulch.





**Photo 2.** Close up photo of topsoil. It appears the Operator may have broadcasted the seed. A future inspection will be conducted to verify germination and establishment of vegetation.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 3.** Facing south from the topsoil stockpile. Photo illustrates that the production areas don't appear to be stabilized as sediment has been deposited into the stormwater ditch. The BMP will need to be repaired and stabilized to prevent further erosion from occurring.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 4.** See comments in Photo 3.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 5.** See comments in Photo 3.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 6.** See comments in Photo 3.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 7.** Facing south at rip rap check dam area. Rip rap structure will require maintenance as portions were observed to be filled with sediment.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 8.** Facing east from the eastern portion of the location. Debris was observed to have blown off location and will need to be picked up.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 9.** Debris blown off location doesn't appear to have been anchored down.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 10.** Oily waste observed near containment of separators that will need to be properly disposed of.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 11.** See comments in Photo 10.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 12.** See comments in Photo 10.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photos 13 & 14.** Subsidence on trench that will need to be backfilled or fenced to ensure safe operations for personnel and wildlife.





3/31/23, 1:00 PM  
316° NW  
COGCC

**Photo 15.** Oily waste observed on northeast side of tank battery.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photos 16-18.** Photos of tanks with fluid running down the side that will require maintenance on equipment and proper cleanup. Red outline shows additional cleanup of fluids needed at load out lines.





**Photo 19.** Overview of spill at tanks.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photos 20 & 21.** Photo illustrates additional cleanup needed for oily waste within the secondary containment.





**Photo 22.** Close up of oily waste/stained soil within secondary containment at load out line.




Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272



**Photo 23.** See comments in Photo 22.



Inspection Photos  
Location Name: Castor 7-59 12  
Location ID: 465272

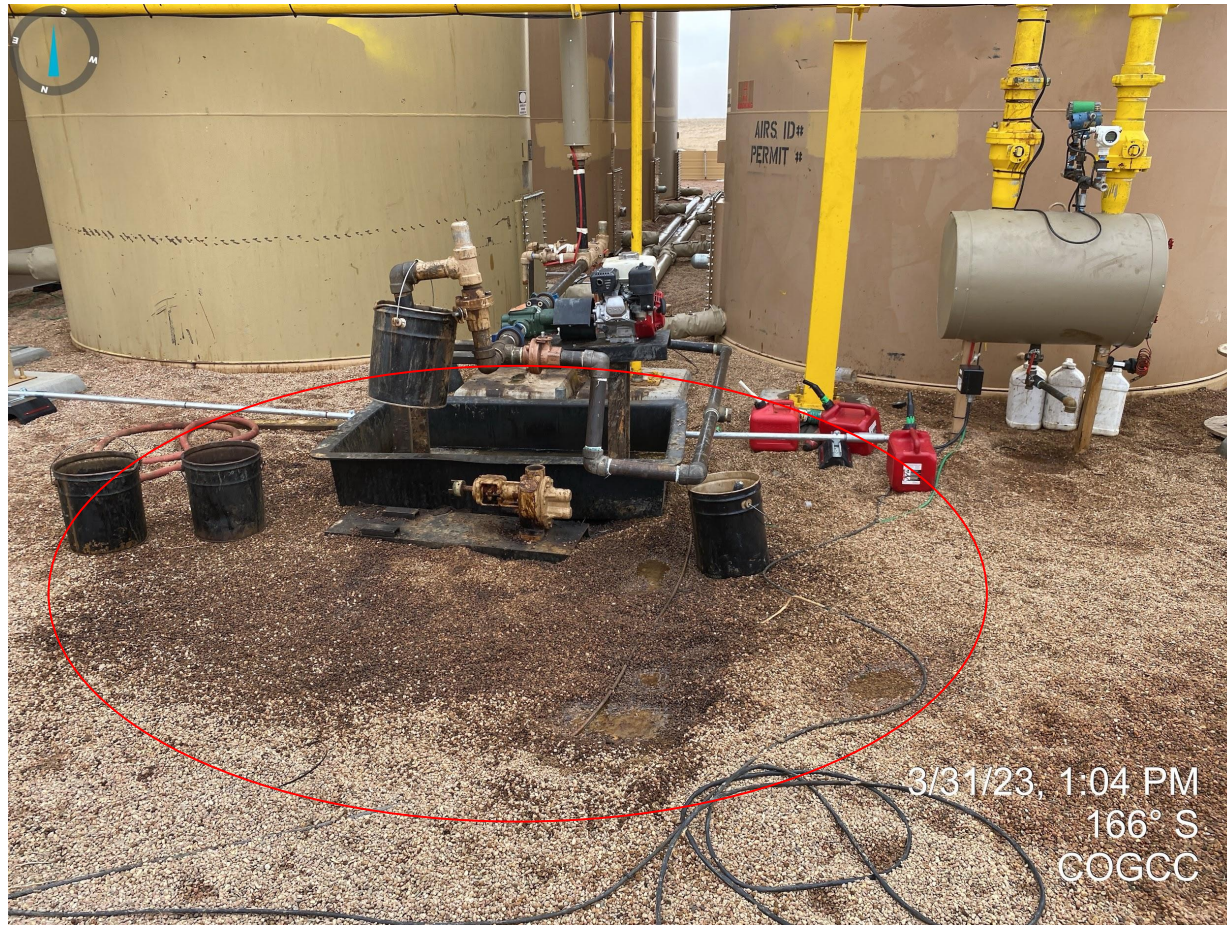

**Photo 24.** Facing south from the northern portion of the battery. Photo illustrates oily waste that requires proper cleanup.