

Interim Reclamation and Stormwater Inspection

Date: 04/10/2023

Operator: CIVITAS NORTH LLC - 10661

Location ID: 476815

Inspection Document #: 708200130

Weld County, CO

NENW Section 30 T8N R59W

Dylan Edwardson
Reclamation Specialist, COGCC



COLORADO
**Oil & Gas Conservation
Commission**

Department of Natural Resources

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 1. Facing north from the western portion of the location. It appears the operator has performed interim reclamation activities with the evidence of drill rows and mulch, and germination present at the time of this inspection. Staff will conduct a follow-up inspection at a future date to verify vegetation establishment in accordance with Rule 1003.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 2. Facing southwest from the northern portion of the location. See comments in Photo 1.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 3. Facing east from the northern portion of the location; see comments in Photo 1.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 4. Facing south from the eastern portion of the location. See comments in Photo 1.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 5. Facing west from the southern portion of the location. See comments in Photo 1.



Photo 6. Close up photo taken near the location's entrance, illustrating evidence of rill erosion. While germination was detected in the interim areas, additional soil stabilization techniques will need to be implemented prevent further site degradation and erosion from occurring.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 7. Facing east from the western portion of the location. See comments in Photo 6.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 8. Facing east from the northwestern portion of the location. See comments in Photo 6.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815

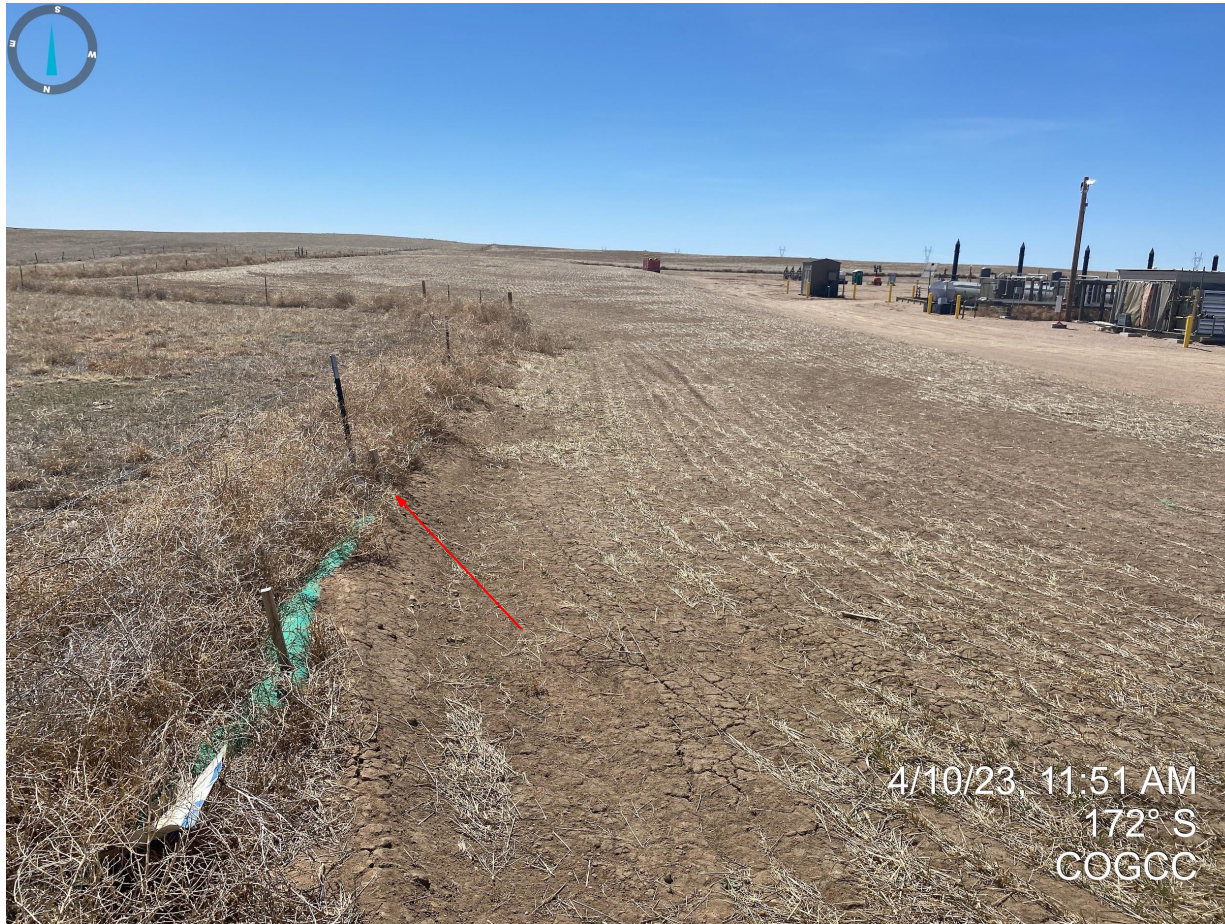


Photo 9. Facing south from the northeastern corner of the location. During this inspection it was observed that the fil-trexx wattles installed on the perimeter of the location have become buried in sediment and show signs of deterioration. These BMPs require maintenance and or replacement to be adequate in controlling stormwater run on and run off.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 10. Taken from the eastern side of the location. See comments in Photo 9.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 11. See comments in Photos 9 & 10.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 12. Taken from the southeastern corner of the location. See comments in Photo 9.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



4/10/23, 11:45 AM
40° NE
COGCC

Photo 13. Road maintainer/drag observed on location. Storage of equipment on location is prohibited.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 14. Jersey barriers observed on the southern edge of production area; see comments in Photo 13.



Photo 15. Tumbleweed accumulations observed in and around equipment will need to be removed as it presents a fire hazard.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 16. See comments in Photo 15.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 17. See comments in Photo 15.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 18. See comments in Photo 15.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 19. Trash and debris observed throughout the location. The operator shall self inspect the entire location to ensure it is kept free from all trash and debris, at all times.

Inspection Photos
Location Name: Allred 8-59-30
Location ID: 476815



Photo 20. See comments in Photo 19.