

SEP 14 1983

STATE OF COLORADO
OIL AND GAS CONSERVATION COMMISSION
DEPARTMENT OF NATURAL RESOURCES



in duplicate for Patented and Federal lands.
in triplicate for State lands.

5. LEASE DESIGNATION & SERIAL NO.
COLO. OIL & GAS CONS. COMM.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
-

1. OIL WELL GAS WELL OTHER

7. UNIT AGREEMENT NAME
-

2. NAME OF OPERATOR
Okmar Oil Company

8. FARM OR LEASE NAME
Forbes-Marick

3. ADDRESS OF OPERATOR
633-17th Street, Suite 2160, Denver, Colorado 80202

9. WELL NO.
3

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 17 below.)
At surface
1980'FNL & 644'FWL, (SNNW) Section 15, T2N, R55W
At proposed prod. zone
same

10. FIELD AND POOL, OR WILDCAT
Zorichak

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
15-2N-55W

14. PERMIT NO.
-

15. ELEVATIONS (Show whether DF, RT, GR, etc.)
4476'GR

12. COUNTY
Morgan

13. STATE
Colorado

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF
FRACTURE TREAT
SHOOT OR ACIDIZE
REPAIR WELL
(Other)
PULL OR ALTER CASING
MULTIPLE COMPLETE
ABANDON
CHANGE PLANS

WATER SHUT-OFF
FRACTURE TREATMENT
SHOOTING OR ACIDIZING
(Other)
REPAIRING WELL
ALTERING CASING
ABANDONMENT*


(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

18. Date of work _____ * Must be accompanied by a cement verification report.

The subject well is non-commercial and it is proposed that the well be plugged and abandoned as follows:

- 1. Fill 5½" casing with sand to approximately 4800' (PBTD 5037'KB) and set a 5 sack cement plug on top of sand.
- 2. Cut off and recover as much 5½" casing as possible.
- 3. Fill hole with mud.
- 4. Set a 10 sack cement plug in bottom of 8 5/8" surface casing @ 167'.
- 5. Set a 10 sack cement plug in top of surface casing to within four feet of ground level.
- 6. Cut off surface casing below plow depth and weld on cap.

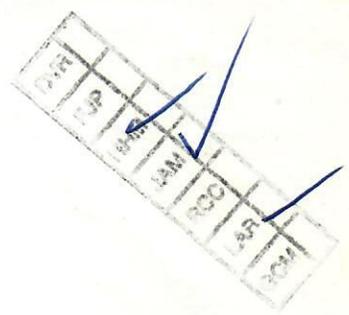

19. I hereby certify that the foregoing is true and correct
SIGNED Roy White TITLE Western Operations Manager DATE September 13, 1983

(This space for Federal or State office use)

APPROVED BY William Smith TITLE DIRECTOR DATE SEP 20 1983
O & G Cons. Comm.

CONDITIONS OF APPROVAL, IF ANY:

Handwritten mark

Handwritten mark