

CURRENT WELLBORE DIAGRAM (2-1-2014)

STATE OF COLORADO #2


Pronghorn Operating LLC (#10422)

C SW SW, Sec. 16-13S-44W 6PM

API #: 05-017-06098

Cheyenne Cty, CO

8 5/8" 24# @ 284'
(cemented to surface w
211sx)

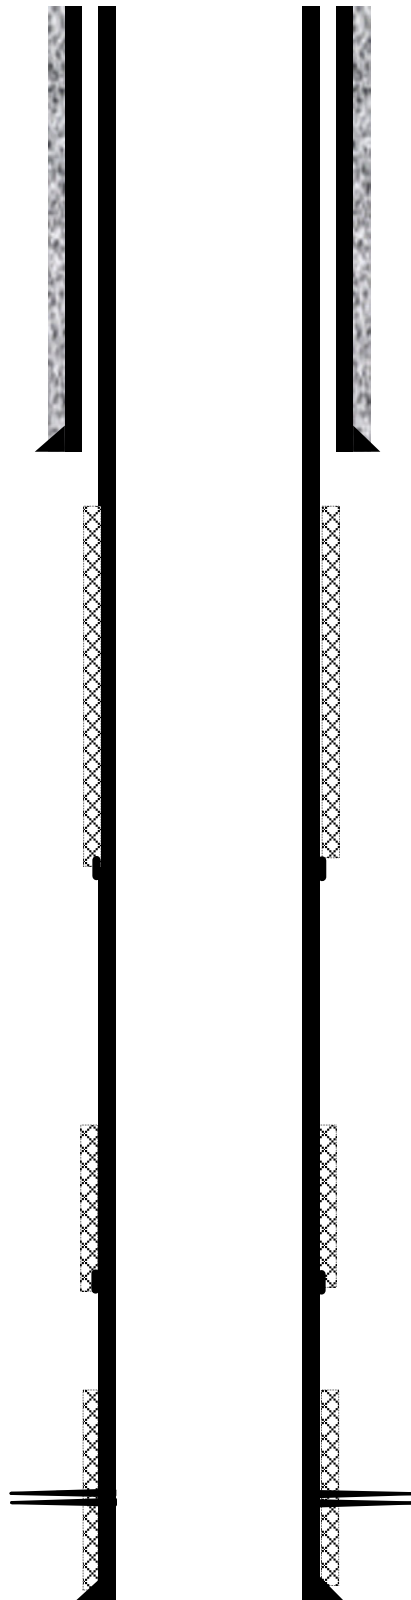

TOC @ 1620'

(CBL)

2664'

Stage Tool, 250sx

3610'

TOC

(CBL)

4309'

Stage Tool, 100sx

5077'

TOC

(CBL)

5416-5422'

perfs

5516'

5 1/2", 15.5# Production Casing, cemented w 125 sx

PROPOSED ABANDONMENT WELLBORE DIAGRAM

STATE OF COLORADO #2


C SW SW, Sec. 16-13S-44W 6PM

API #: 05-017-06098

Pronghorn Operating LLC (#10422)

Cheyenne Cty, CO

8 5/8" 24# @ 284'
(cemented to surface w
211sx)

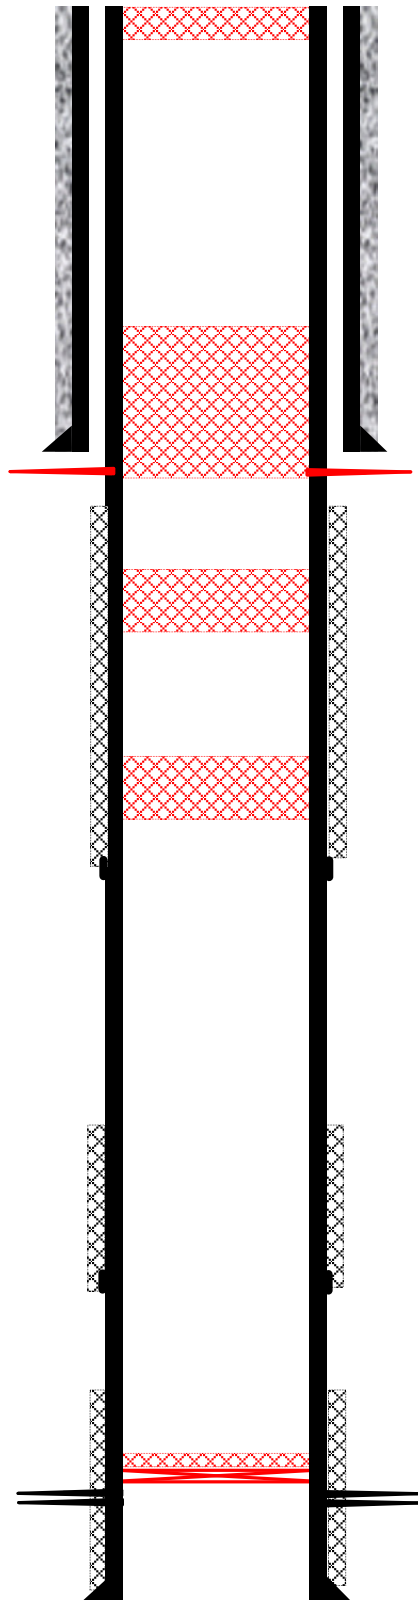

0' - 50' LAY 6 SX CMT

150' - 300' lay 20 sx
300' - 301' perforate & squeeze 20 sx

1620' TOC (CBL)

1778' - 1950' LAY 20 SX CMT

2427' - 2600' LAY 20 SX CMT

2664' Stage Tool, 250sx

3610' TOC (CBL)

4309' Stage Tool, 100sx

5077' TOC (CBL)

5400' SET CIBP W/ 2sx CMT

5416-5422' perms

5516' 5 1/2", 15.5# Production Casing, cemented w 125 sx