



YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date 9-27-16

COMPANY Wesco op.

LEASE Rudnik

WELL NO. 32-27

RIG 9

COUNTY Washington

Work Ordered By:

Job Description: Pan A

| | | HOURS | TOTAL |
|--|---------|---------|-----------|
| Rigged up hydrotesters, tested tubing from derrick blew 2 jnts picked up tested 1a more to tag PBD rigged down tester laid down 4 jnts to spot tubing in ideal place trip bit and scraped out trip in with retainers load back side with fresh water check post entry shut in well pick up tools pump fuel shut down for night | | 10 | \$2500 00 |
| RODS | PUMP | | |
| TUBING 64 stands 2 7/8 | SUBS 8' | | |
| Remarks: | | | |
| FURNISHED | | | |
| 2 trips Baker Seal | | | 40 00 |
| Bop & Adapter Flange | | | 225 00 |
| Tubing rubber | | | 29 00 |
| Triplet pump 5 Hr min | | | 525 00 |
| Extra Man @ \$55.00 | | 11 | 605 00 |
| UNIT CHARGE | | 10 | |
| C. Ladd | | | |
| J. Velk | | | |
| C. Reed | | | |
| TAX | | \$69.00 | 2 00 |
| TOTAL | | | \$3926 00 |

YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date 9-28-16

COMPANY Wesco

LEASE Pudn'K

WELL NO. 32-27

RIG 9

COUNTY Washington

Work Ordered By:

Job Description: *P and A*

String down into retainer break circulation
pump cement clean out string out pull
tubing wireline and shot off test guns
ran tubing with retainer Set retainer
string in could not break circulation
string out pumped cement on top of retainer
pulled tubing out removed retained head
attached cement sub ran in pumped
cement never showed returns of cement
laid down tubing drained eqn. picked up
tools shut in well shut down for night

HOURS

TOTAL

11.5

\$ 2875.00

Cement Pumped 40 sks below returner
12 sks on top returner

2nd Retainer spotted 17 sacks on top

RODS

PUMP

SUBS

TUBING:

SUBS

OTHER

Remarks: 4th moon

FURNISHED *Bopt Adapter Flange*

Baker Seal - 2 trips

tubing rubbed

Extra man @ \$55.00

 $11\frac{1}{2}$

63250

UNIT CHARGE

C. Ladd
C. Reed
J. Volk
John Roth

11.5

| | |
|-----|----------|
| TAX | \$ 69.00 |
|-----|----------|

260

TOTAL

| | |
|------------|--|
| \$ 3803.50 | |
|------------|--|



YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date 9-29-16

COMPANY Wesco OP,

LEASE Rudnik

WELL NO. 32-27


RIG 9

COUNTY Washington

Job Description: P and A.

Work Ordered By:

[illegible]

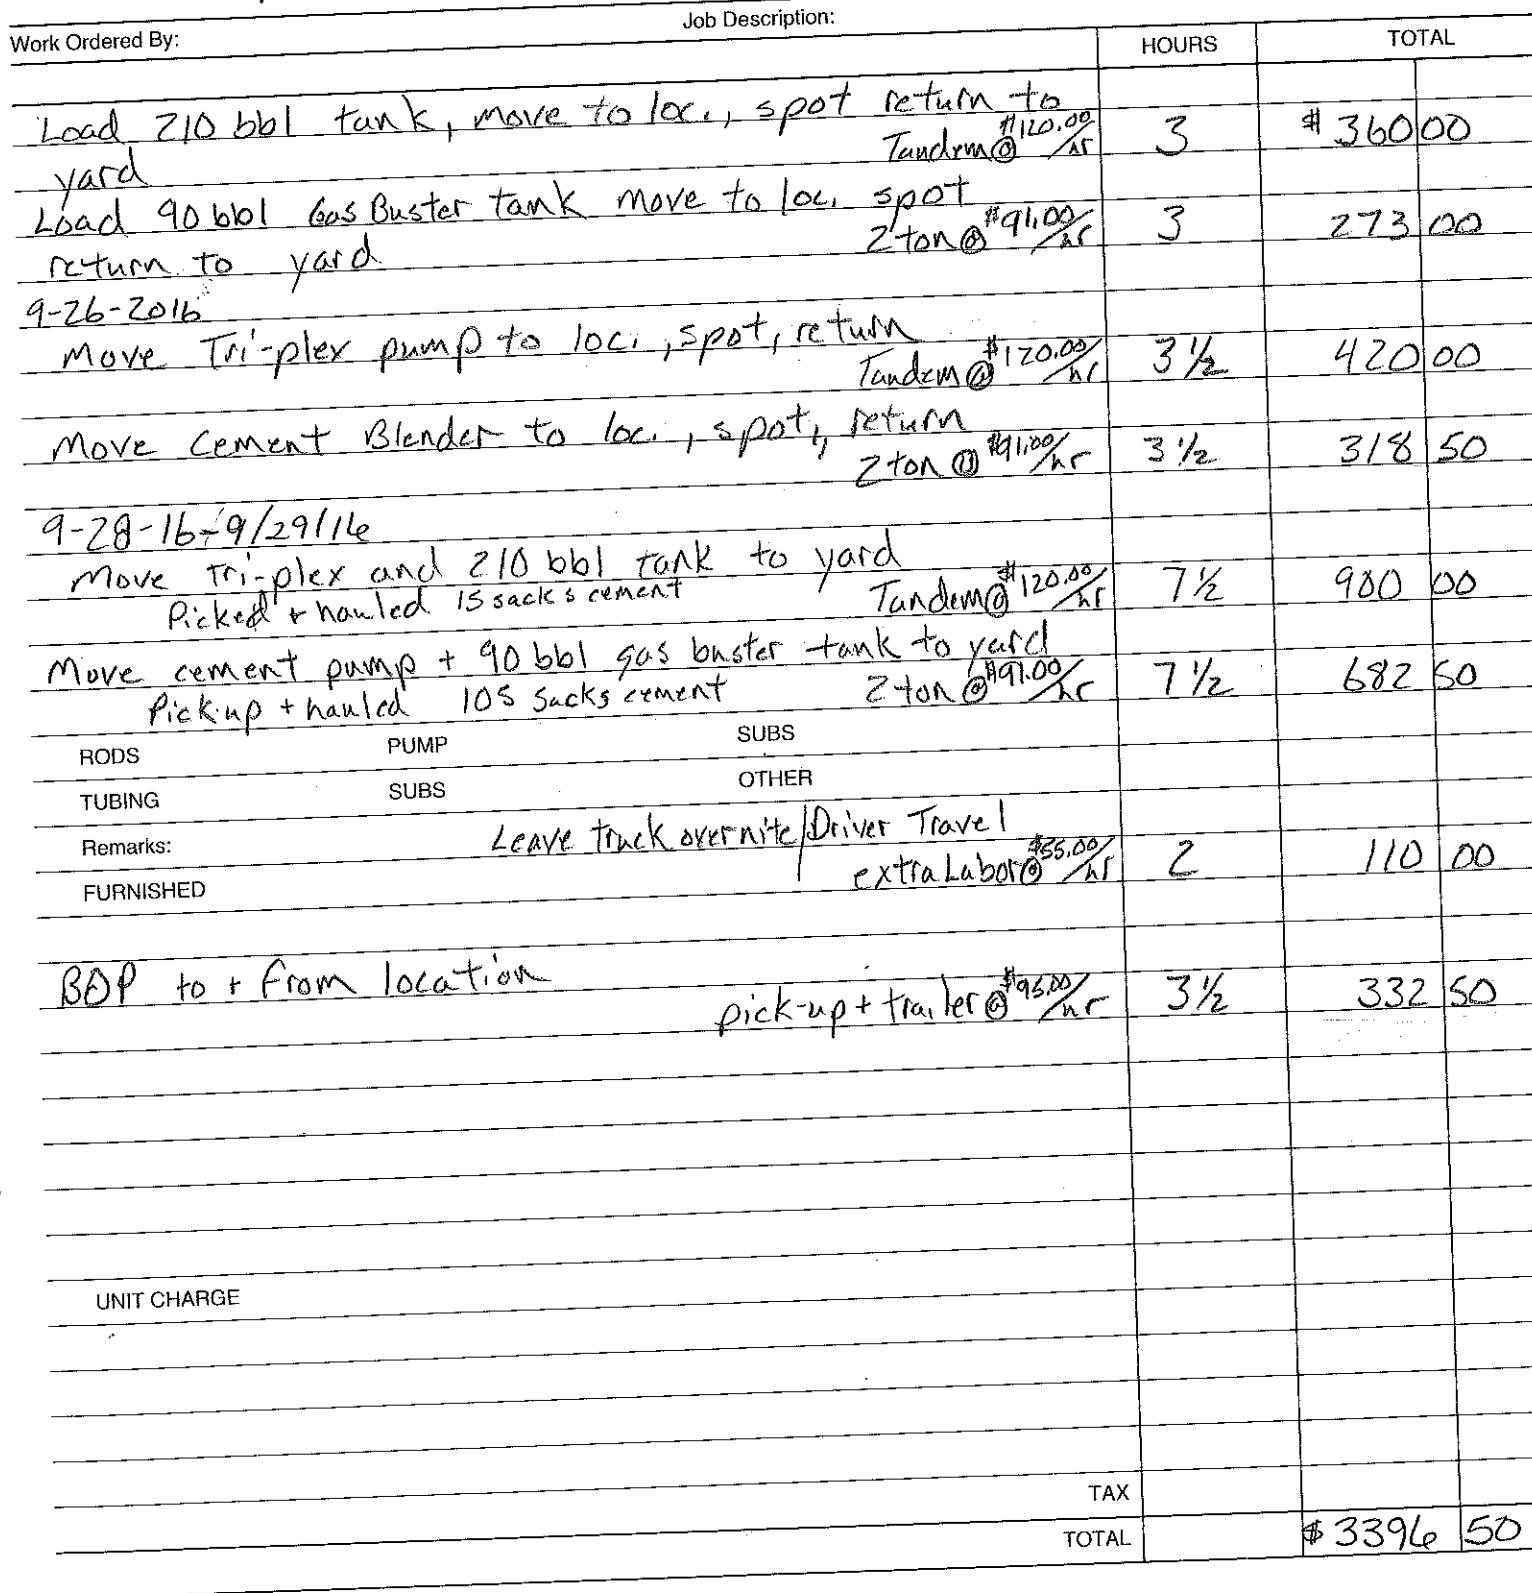

Wesco Rudnik 32-27

Cement Used

9-28-16 1st retainer - above perts, Pumped 40 sacks
below retainer, stung out left 12 sacks on top

2nd retainer, could not pump into @ 2850
spotted 6 sacks on top

3rd plug set at 1981 pumped 17 sacks, balanced
plug 1981 - 1846

4th plug pumped at 371' used 40 sacks

9-29-16 5th tugged at 60', filled 5½ to surface
used 9 sacks

Total Cement used 114 sacks for Job.

Bon JETER