


T1N, R65W

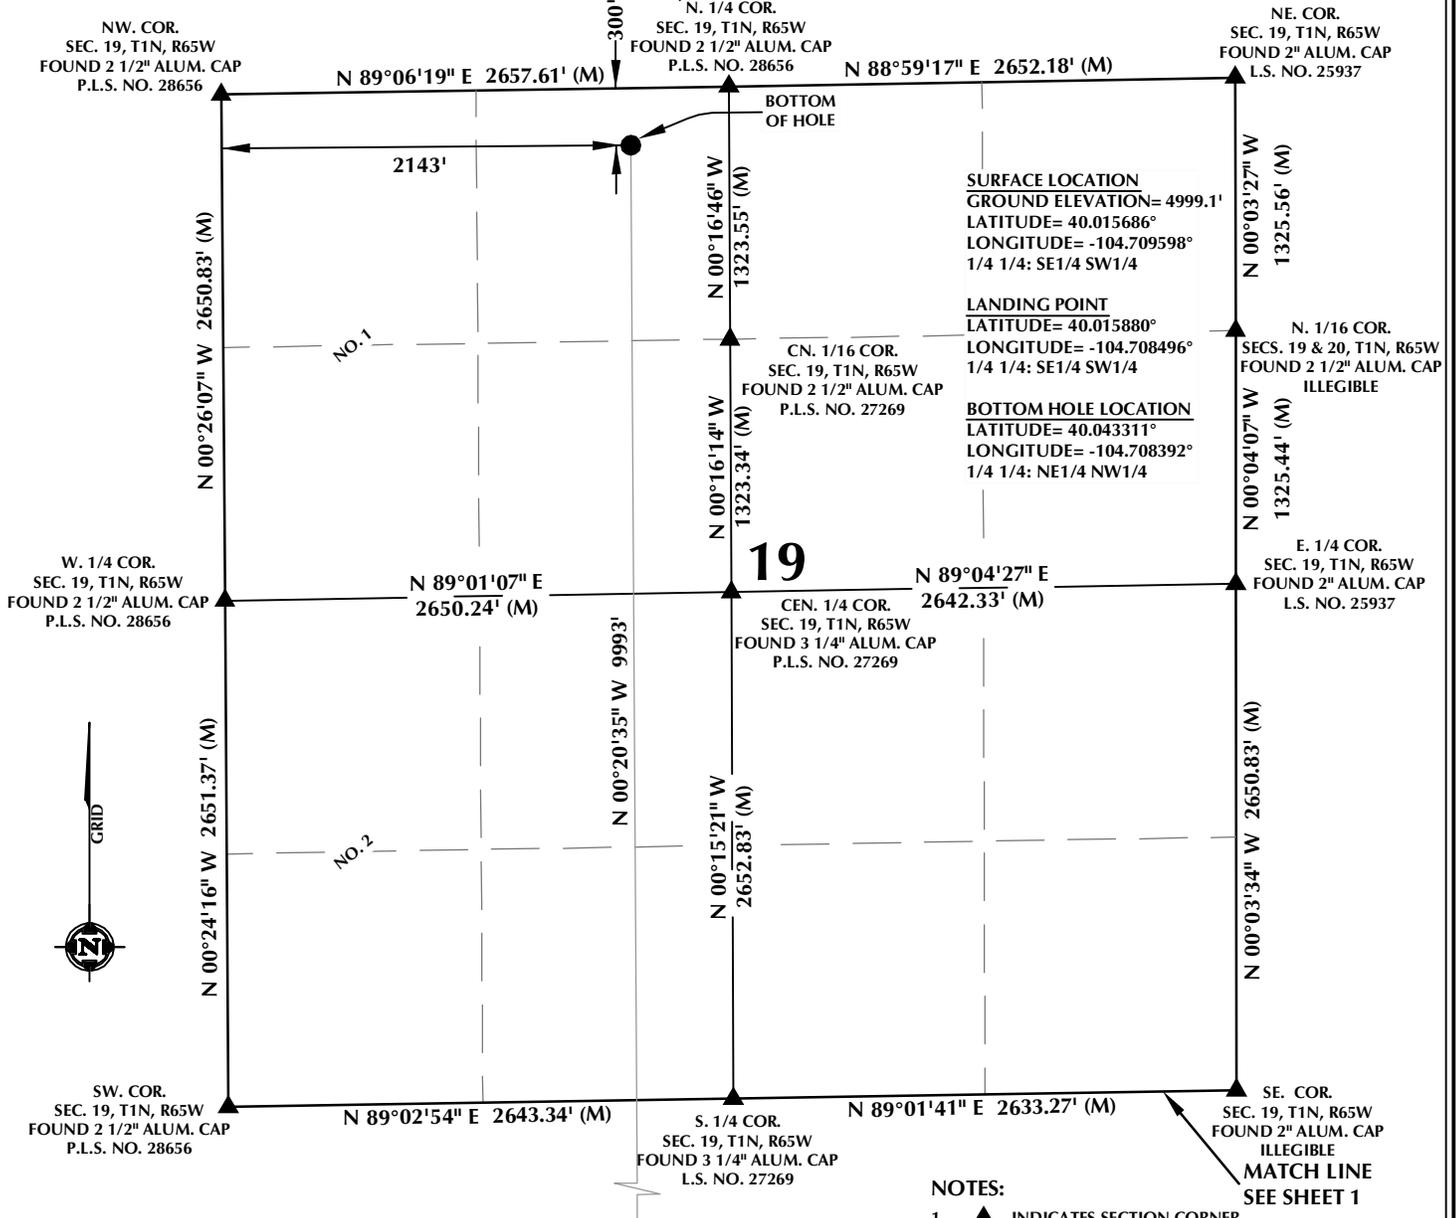

NOTES:

- ▲ INDICATES SECTION CORNER.
- INDICATES CALCULATED CORNER.
- ELEVATION BASED ON NAVD88 (GEOID12B).
- BASIS OF BEARING DERIVED FROM COLORADO COORDINATE SYSTEM OF 1983 NORTH ZONE.
- ALL MEASURED DISTANCES ARE GRID. COMBINED SCALE FACTOR: .99972845 CALCULATED FROM THE W. 1/4 CORNER OF SECTION 30, T1N, R65W.
- OPERATOR: PRESTON KNUITSEN / PDOP = 1.5.
- SEE ADDENDUM TO WELL LOCATION CERTIFICATE FOR EXISTING IMPROVEMENTS WITHIN 500' OF THE WELL PAD.
- WELL FOOTAGES ARE MEASURED AT RIGHT ANGLES TO THE SECTION LINES.
- THE BOTTOM OF HOLE BEARS N00°20'35"W, 9993' FROM THE LANDING POINT.
- NO. 1 & NO. 2 AS SHOWN HEREON ARE GOVERNMENT LOTS 1 & 2 PER THE ORIGINAL GLO SURVEY.

CERTIFICATE OF SURVEYOR:


THIS IS TO CERTIFY THAT THE ABOVE PLAT WAS PREPARED FROM FIELD NOTES OF ACTUAL SURVEYS MADE BY ME OR UNDER MY SUPERVISION AND TO THE BEST OF MY KNOWLEDGE AND BELIEF. THIS CERTIFICATE DOES NOT REPRESENT A LAND SURVEY PLAT OR IMPROVEMENT SURVEY PLAT AS DEFINED BY C.R.S. 19-51-302 AND CANNOT BE RELIED UPON TO DETERMINE OWNERSHIP.

Randall K. French
 38512
 RANDALL K. FRENCH
 PROFESSIONAL LAND SURVEYOR
 COLORADO REGISTRATION NUMBER: 38512
 6/4/18

NOTICE:
 ACCORDING TO COLORADO STATE LAW YOU MUST COMMENCE LEGAL ACTION BASED UPON ANY DEFECT IN THIS SURVEY WITHIN THREE YEARS AFTER YOU FIRST DISCOVER SUCH DEFECT. IN NO EVENT MAY ANY ACTION BASED UPON ANY DEFECT IN THIS SURVEY BE COMMENCED MORE THAN TEN YEARS FROM THE DATE ON THE CERTIFICATION SHOWN HEREON.

WELL DISTANCES:

- BUILDING: ±854' E
- BUILDING UNIT: ±1697' W
- PUBLIC ROAD: ±232' S
- ABOVE GROUND UTILITY: ±272' S
- RAILROAD: ±2746' SE
- PROPERTY LINE: ±230' S
- HIGH OCCUPANCY BUILDING UNIT: ±4258' S
- DESIGNATED OUTSIDE ACTIVITY AREA: 5280'+

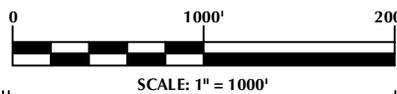

WELL PAD - JOHNSON 01N-65W-30

JOHNSON 01N-65W-30-10H
 WELL LOCATION CERTIFICATE
 230' FSL & 1835' FWL (SESW) (SURFACE)
 300' FSL & 2143' FWL (SESW) (LANDING POINT)
 LOCATED IN SECTION 30
 300' FNL & 2143' FWL (NENW) (BOTTOM)
 LOCATED IN SECTION 19
 T1N, R65W, 6TH P.M.
 WELD COUNTY, COLORADO

5950 Cedar Springs Road, Suite 200
 Dallas, Texas 75235

CONSULTING, LLC
 SHERIDAN OFFICE: 1095 Saberton Avenue, Sheridan, Wyoming 82801, Phone 307-674-0609
 LOVELAND OFFICE: 6706 North Franklin Avenue, Loveland, Colorado 80538, Phone 970-776-4331

DRAFTED BY:	GLK	CHECKED BY:	RKF	SHEET NO:
DATE DRAFTED:	1/30/18	DATE SURVEYED:	1/17/18	2
REVISED:	6/4/18	FILE NAME:	17-171	2 OF 2