


PLUG AND ABANDONMENT PROGNOSIS  
DIVIDE WATERFLOOD UNIT  
UNIT NO. 1



OIL & GAS  
CONSERVATION COMMISSION

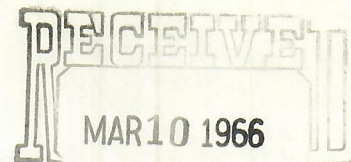

PERTINENT DATA:

ELEV:	4105 KB	AFE:	R-7065
KB-CHF:	7'	PBTD:	4754'±
T.D.:	4998'		
CASING:	Sfc - unknown		
	5½" (14#) at 4997'		
TUBING:	2 3/8" (153 jts)		

Last Test: On 1-31-66, tested 4 B0 and 34 BWPD.

PROPOSED WORK:

1. Pull production equipment.
2. Locate 5 1/2" csg free point. Shoot off and recover.
3. Spot the following cement plugs:
  - (a) 40 sx across Muddy at 4744'.
  - (b) 30 sx across casing stub.
  - (c) 30 sx across bottom of sfc. csg.
  - (d) 10 sx at sfc.
4. Install abandonment marker.
5. Fill out attached form and mail to Division Exploitation Engineer.

*D. B. O'Neill*  
D. B. O'Neill

*C. L. Creager*  
C. L. Creager

*R*  
RHR/djc  
2-23-66  
Denver, Colorado