

SG INTERESTS DAILY COMPLETION REPORT

COMPANY		AFE NUMBER	COMPANY REP.	CONSULTANT	
SG Interests		LOE	Bud Guffey	Garrett Stagg	
WELL NAME		COUNTY, STATE		DATE	DAYS
Federal 11-90-35 #1		Gunnison, CO		September 11, 2021	4
PRESENT OPERATION		CONTRACTOR AND RIG NO.		TOOL PUSHER/FOREMAN	
P&A		Hurricane 23		Cesar El Mundo	
API NO:	05-051-06059	PROPERTY NO.:			

SUMMARY OF OPERATIONS

FROM	TO	HRS	
0600	0800	2.00	Rig crew, cementers, & BLM rep Ed Fancher travel to location.
0800			Open braden head to check pressure, 60 psi was present. Bleed pressure off to 14 psi. Shut in & pressure did not build. Open well to 0 psi, TIH tag TOC @ 323', BLM rep Ed Fancher received approval from BLM supervisor Stephen Garcia to proceed and cut off wellhead to fill void with cement and install P&A marker
			Contacted Greg Vick & Bud Guffey discussed BLM approval to proceed & decided to continue procedure
	0945	1.75	COGCC representative was not present during today's plugging operation
0945			TOOH to 137'. Mix 30 sx 1.18 yield 15.4 ppg type II (B) cement & pump to surface. TOOH cleaning equipment
	1030	0.75	& 2 7/8" EUE tbg. Pull doors off of BOP and flush out with fresh H2O.
1030			ND BOP, RD Hurricane 23. Hurricane employees returned flowback tank to SG yard & took 230 jts 2 7/8" EUE
	1200	1.50	tbg to the Helo yard. Cementers traveled to Parachute to get equipment to cut wellhead assembly off.
1200	1530	3.50	Excavate wellhead to 5', Braden head pressure dropped to 10 psi, bleed pressure to zero no build up
1530			Cut well head off, Cement to surface 13 3/8" csg & TOC @ 50" on the 9 5/8" csg. Top fill cement w/ 1sx of type II (B) cement at surface. Worked the cement down between the 9 5/8" & 13 3/8" csg along with filling the 7" at surface. Install marker plate w/ Operator name, API number, section township #'s well name & #.
	1900	3.50	Braden head did not build pressure or have gas migration while cutting.
			Marker plate is @ 4' deep. Finished P&A ops leave location.
			BLM rep Ed Fancher witnessed everything up to 16:00 hrs & we were told to we can cont ops as planned
			Sent before and after pictures to Mr. Fancher after completing P&A.

ALL OF INTERESTS
1770
Red 11-90 55 #1
56 35 T-115
CO 7700
APR 95 05 06 05 9






Inspection Photos
Location Name: Federal 11-90-35 #1
API: 05-051-06059



Identifying information is not present on steel plate.

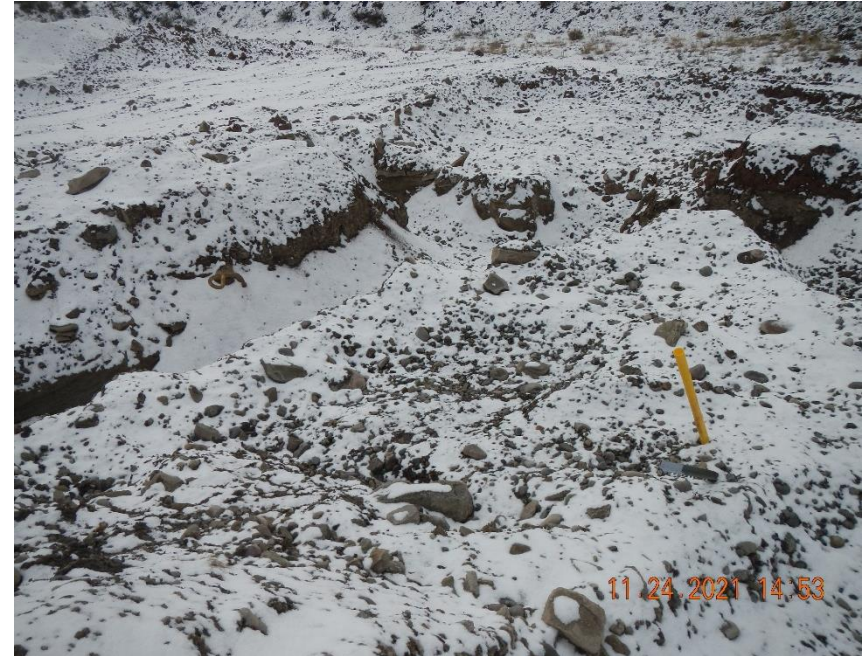

Guy line anchor and marker observed during this inspection.