

Inspection Photos

4/04/2022

Operator: GUNNISON ENERGY LLC - 10515

Location ID: 412922

Gunnison County, CO

Aaron Trujillo

NW Reclamation Specialist

COGCC

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



April 4, 2022
39.0187228N 107.36796823W



April 4, 2022
39.01870695N 107.36795938W

Photo 1: Photos show signage at Location entrance. Location received a variance to delay IR with COAs requiring a sign at the Location entrance stating the following: ""A COGCC variance has been approved to delay the commencement of interim reclamation to no later than December 9, 2022"". Photos show sign has not been posted.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



Photo 2: Photos 2-3 taken from the west end of the production area. Photos provide an overview of the Location from northwest, north, southeast to south.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



Photo 3: See comments under photo 2.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



Photo 4: Photo left shows legal description on well sign remains illegible. Photo right shows containment BMP has filled with fluids and is no longer adequate to contain a spill.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



Photo 5: Photos show conductor and cellar for Well API #051-06213; records show well is abandoned; conductor and cellar for this well have not been plugged and reclaimed per Rule 406 requirements; conductor and cellar remaining; plate on top of the conductor pipe not welded per requirements. No Form 4 - "Report of work done" to report plugging of the conductor has been submitted. Well conductor requires plugging and reclamation.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922

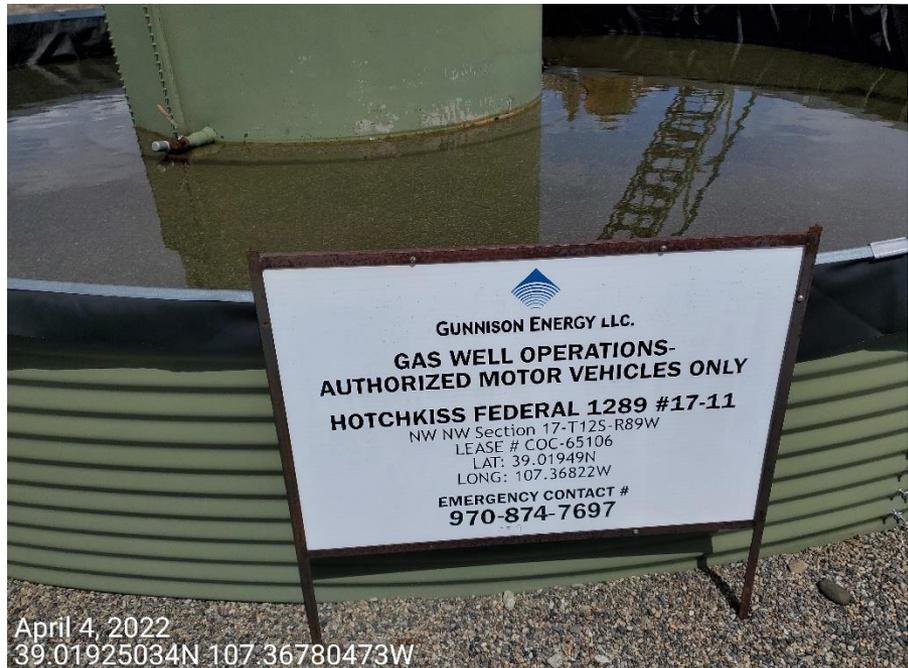


Photo 6: Signage at tank battery remains inadequate; sign missing information per Rule 605.e.. EMS# or 911, Nearest public road, and API. First letter of tank contents on side of the tank remains missing.

Inspection Photos
Operator Name: GUNNISON ENERGY LLC - 10515
Location ID: 412922



Photo 7: Required labeling at Heated separator with glycol storage tank not evident.