




P&A Wellbore For State

Well Name: RURAL 9-31A

Land, Original Hole, 1/12/2023 1:54:08 PM

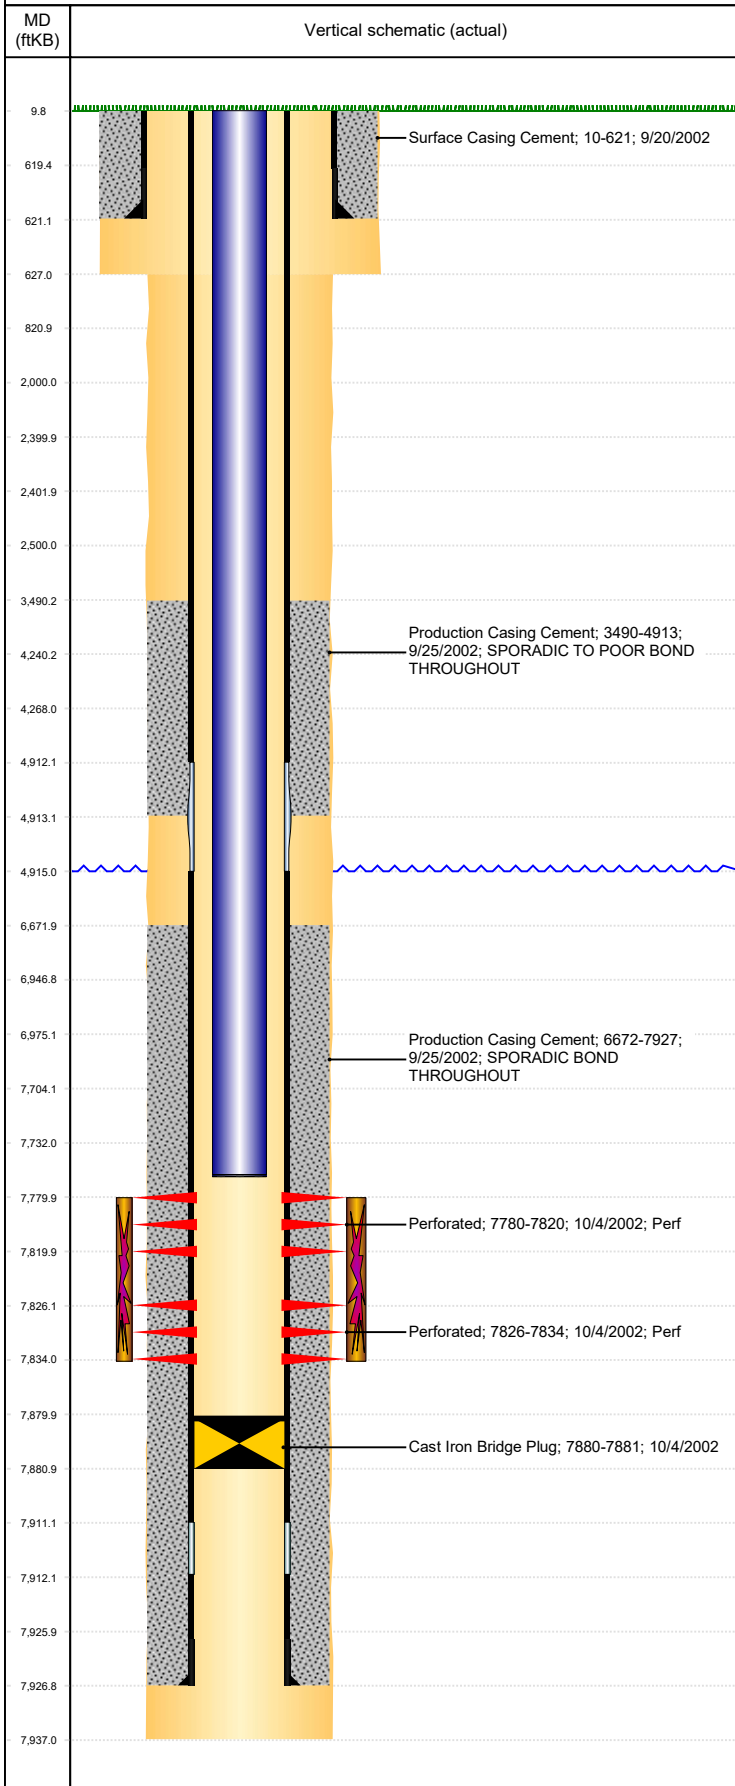

Well Header

Surface UWI 0512321087	Business Unit Rockies	Gov Auth Dist	Prod Tree Loc Land
Orig. KB to Gnd (ft) 10.00	Original Spud Date 9/20/2002	Abandon Date	Well Sub-Status PR
High... N			

Comment

DV TOOL @ +/- 4913', DRILLED OUT 10/02/02

CIBP W/ CEMENT CAP @ 7880', SET DUE TO FLOAT COLLAR LEAK

Surface Location (Congressional)

Qtr 3 NE	Qtr 4 SE	Section 31	Twonshp 4	Twonsh... N	Range 65	Rng E... W	Latitude (°) 40.26738	Longitude (°) -104.69862
-------------	-------------	---------------	--------------	----------------	-------------	---------------	--------------------------	-----------------------------

Wellbore Sections

Section Des	Hole Size (in)	Act Top (ftKB)	Act Btm (ftKB)
SURFACE	12 1/4	10.0	627.0
PRODUCTION	7 7/8	627.0	7,937.0

Casing Strings

Csg Des	Run Date	OD (in)	Wt/Len (lb/ft)	Grade	Top Depth (MD) (ftKB)	Set Depth (MD) (ftKB)
Surface	9/20/2002	8 5/8	24.00	J-55	10	621
Production Casing	9/24/2002	4 1/2	11.60	I-80	10	7927

Cement

Des	Start Date	Top (ftKB)	Btm (ftKB)
Surface Casing Cement	9/20/2002	10.0	621.0
Production Casing Cement	9/25/2002	3,490.0	4,913.0
Production Casing Cement	9/25/2002	6,672.0	7,927.0

Zone Statuses

Zone Name	Status Date	Status	Fluid Type	Job	Prod Method
J SAND	10/21/2002	PR	Oil		Flowing
J SAND	3/10/2014	PR	Water		Flowing

Perforation Data

Linked Zone	Explosive Type	Entered Shot Total	Top (ftKB)	Btm (ftKB)	Date
J SAND, Original Hole		80	7,780.0	7,820.0	10/4/2002
J SAND, Original Hole		16	7,826.0	7,834.0	10/4/2002

Stimulation Intervals

Zone	Start Date	Top (ftKB)	Btm (ftKB)
J SAND, Original Hole	10/11/2002	7,780.0	7,834.0

Other In Hole

Run Date	Des	Make	OD (in)	Top (ftKB)	Btm (ftKB)
10/4/2002	Cast Iron Bridge Plug		4	7,880.0	7,881.0

Logs

Date	Type	Depth Top (MD) (ftKB)	Btm (ftKB)
9/24/2002	COMPENSATED DENSITY	4,400	7,913.0
9/24/2002	INDUCTION	621	7,933.0
10/3/2002	CBL/CCL/GR	3,210	7,890.0
5/9/2018	GYRO	10	7,700.0

Plug Back Total Depths

Date	Type	Com	PBTD (ftKB)
10/4/2002	PLUG	CIBP W/ CEMENT CAP SET DUE TO FLOAT COLLAR LEAK	7,880
8/15/2007	FILL	CLEAN OUT	7,880