


INVOICE

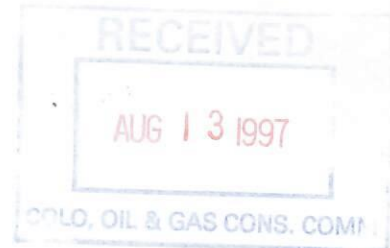

00250948

WESTERN SERVICE COMPANY**P. O. Box 30
Sterling, CO 80751**DATE: July 31, 1997INVOICE # RIG 97/7-07**SOLD TO:** WALSH PRODUCTION, INC
P. O. Box 30
Sterling, CO 80751**LEASE NAME:** Henderson #3

DATE	DESCRIPTION	TOTAL
7-21-97	Moved to location. Rigged up. Rigged up dump bailer and set 6 sack cement plug on bottom. (5 1/2)	
7-22-97	Used dump bailer and set additional 6 sacks of cement on bottom, which brought us to a total of 20 sacks of cement on the bottom plug. Got bell nipple strapped. Set blocks on casing jacks. Pulled threads off of bell nipple trying to get casing slips out. Waited on a welder. Welded and strapped collar on bell nipple. Cut surface head off. Reset blocks and casing jacks. Started working casing with jacks. Ended day with 22 1/2" of stretch @ 152,550#. Which indicated an 100% free point @ 1486'. (12)	
7-23-97	Rigged down casing equipment. Rigged down. Moved off location. (2)	
7-25-97	Moved back to location and spotted in. (2 1/2)	
7-28-97	Rigged up and rigged up casing equipment. (1 1/2)	
7-28-97	Worked casing with jacks. Ended day with 38" of stretch @ 152,550#. (10 1/2)	
7-29-97	Used "slick-line" trailer and cut casing @ 3895'. Worked casing with jacks trying to work it free. Ended with 41 1/4" of stretch but couldn't get pipe loose. (10 1/2)	
7-30-97	Used "slick-line" trailer and cut casing @ 3763'. Used casing jacks and jacked out first 4 joints of casing. Started pulling and laying down casing. (11)	
7-31-97	Pulled and laid down rest of casing. Rigged down casing, equipment and rigged up for tubing. Ran 750' of tubing. Mixed and pumped 40 sack cement plug. Pulled tubing. to 180'. Mixed and pumped 40 sack cement plug. Waited one hour. Tagged top of cement @ 105' from surface. Mixed and pumped 10 sack cement plug @ surface. Rigged down tubing equipment. Loaded casing. jacks. Cleaned up location. Rigged down. Moved to location. (12 1/2)	
	Rig Charges, 63 Hours @ \$105.00/Hour	\$6,615.00
	TOTAL	\$6,615.00