


Colorado Interstate Gas Company

LEASE: Flank #12
FIELD: Flank
COUNTY: Baca
STATE: Colorado
LOCATION: 7-34S-42W
API #: 05-009-05062-00
SPUD: 09/30/61 [Original]
SPUD: 07/01/80 [Re-Entry]
Rev. Date 06/29/22 - APT

Proposed Plugging Procedure

ELEVATION: GL: 3,779' [Re-Surveyed (10/20/81)]
KB = GL + 9'
TD: 4,766' GL PBTD: 4,552' GL

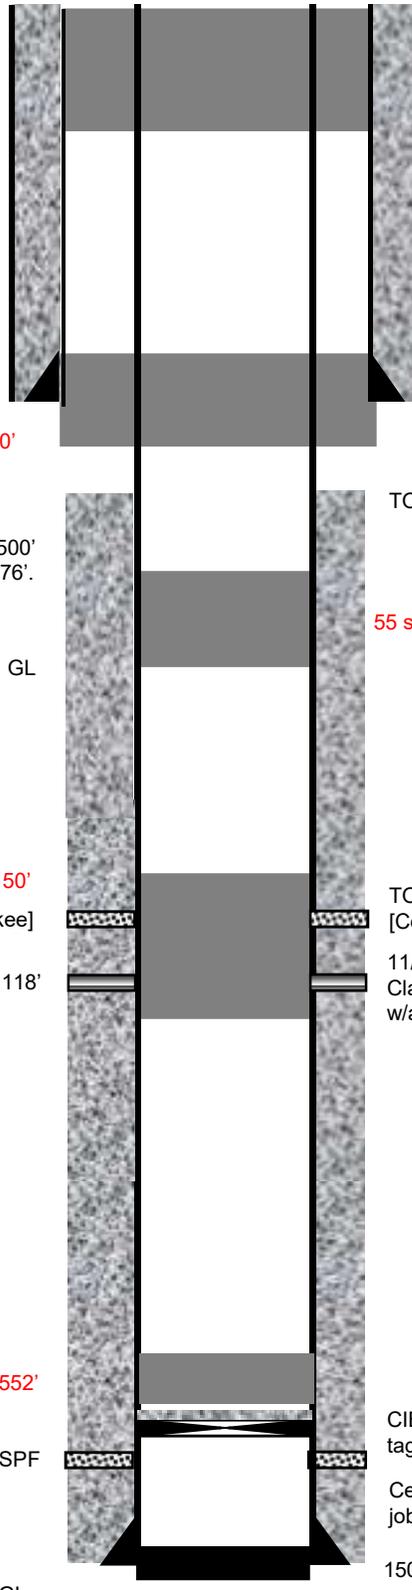

Perforate casing @ 500'
 150 sacks of cement @ 500' to surface

Cemented w/465 sx. poz & 100 sx. common. Cmt. circ.

55 jts. 8 5/8", 24#, J-55 @ 1,435' GL
 TD 12-1/4" Surface hole @ 1,436' GL

Perforate casing @ 1,500'
 40 sacks of cement @ 1,375-1,500'

TOC unknown

07/04/80: Corroded casing from 2,528' to 4,500'
 07/08/80: Set retainer @ 2,440', RBP @ 4,576'.
 Cemented w/550 sx. Lost returns.

07/09/80: Sqzd. holes 2nd time w/400 sx.

07/15/80: Sqzd. holes 3rd time w/200 sx. w/pkr @ 2,422' GL

55 sacks of cement @ 2,515'-3,000'

20 sacks of cement from 3,974'-4,150'

11/10/84: Perf: 4,083'-4,093' w/4 SPF [Cherokee]

TOC @ 4,049' GL – Original operator.
 [Cement Location Log (10/21/61)]

11/06/84: Perf 4 sqz. holes 4,117' – 4,118'

11/09/84: Squeezed 4,117' - 4,118' w/100 sx.
 Class H. Did not squeeze off. Sqzd
 w/additional 100 sx. Squeezed off.

10 sacks of cement from 4,464'-4,552'

[Morrow] Perf: 4,629'-4,637' GL w/4 SPF
 (10/22/61)

CIBP @ 4,570' GL w/ 2 sx. cmt on top. Cmt
 tagged @ 4,552' GL (11/06/84)

Cement w/ 275 sx. common, lost returns during
 job

150 jts, 5-1/2", 15.5#, J55, 8R, ST&C @ 4,761' GL

TD 7-7/8" hole @ 4,766' GL