



Little Beaver "D" Sand Unit # 64

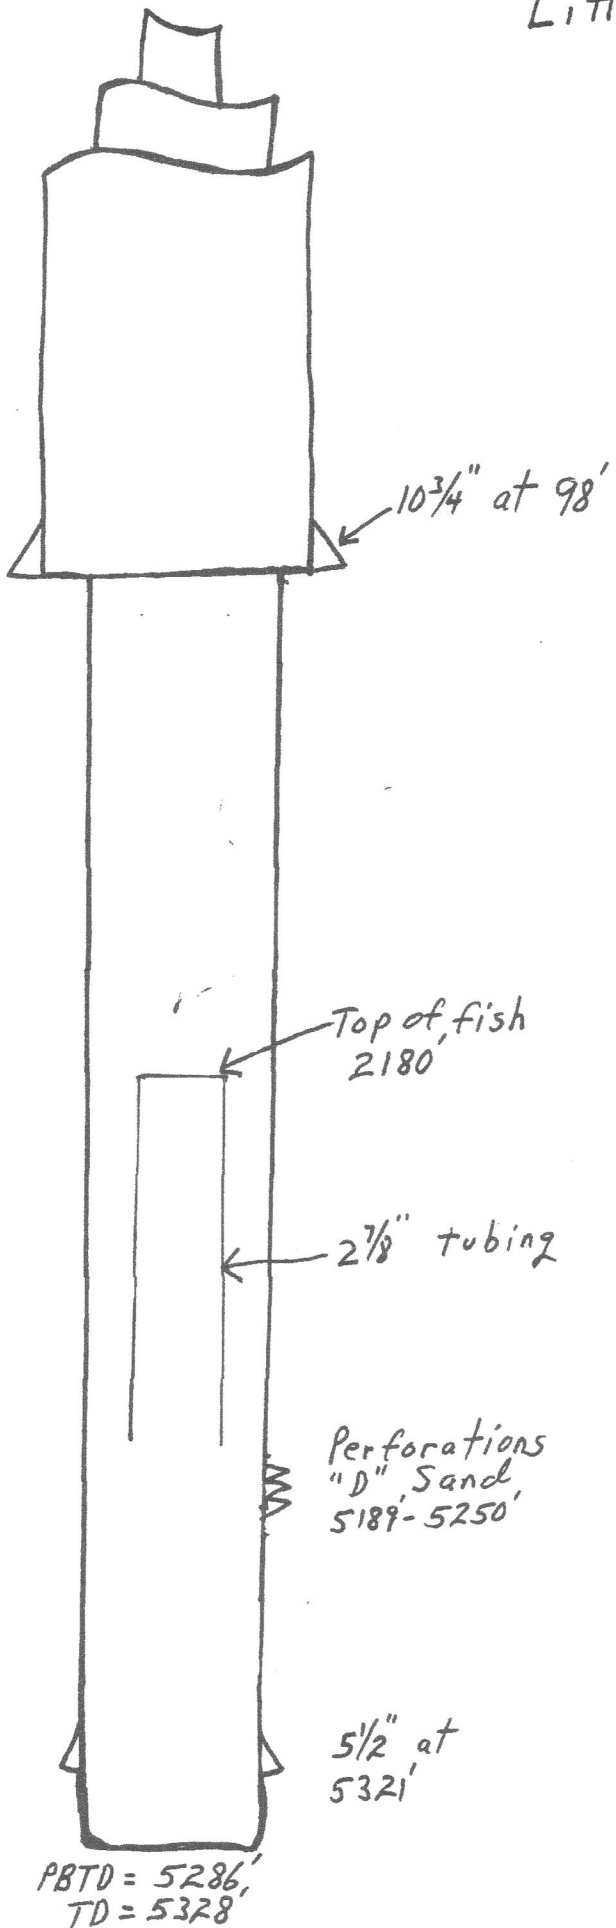


Little Beaver "D" Sand Unit # 64
After PA

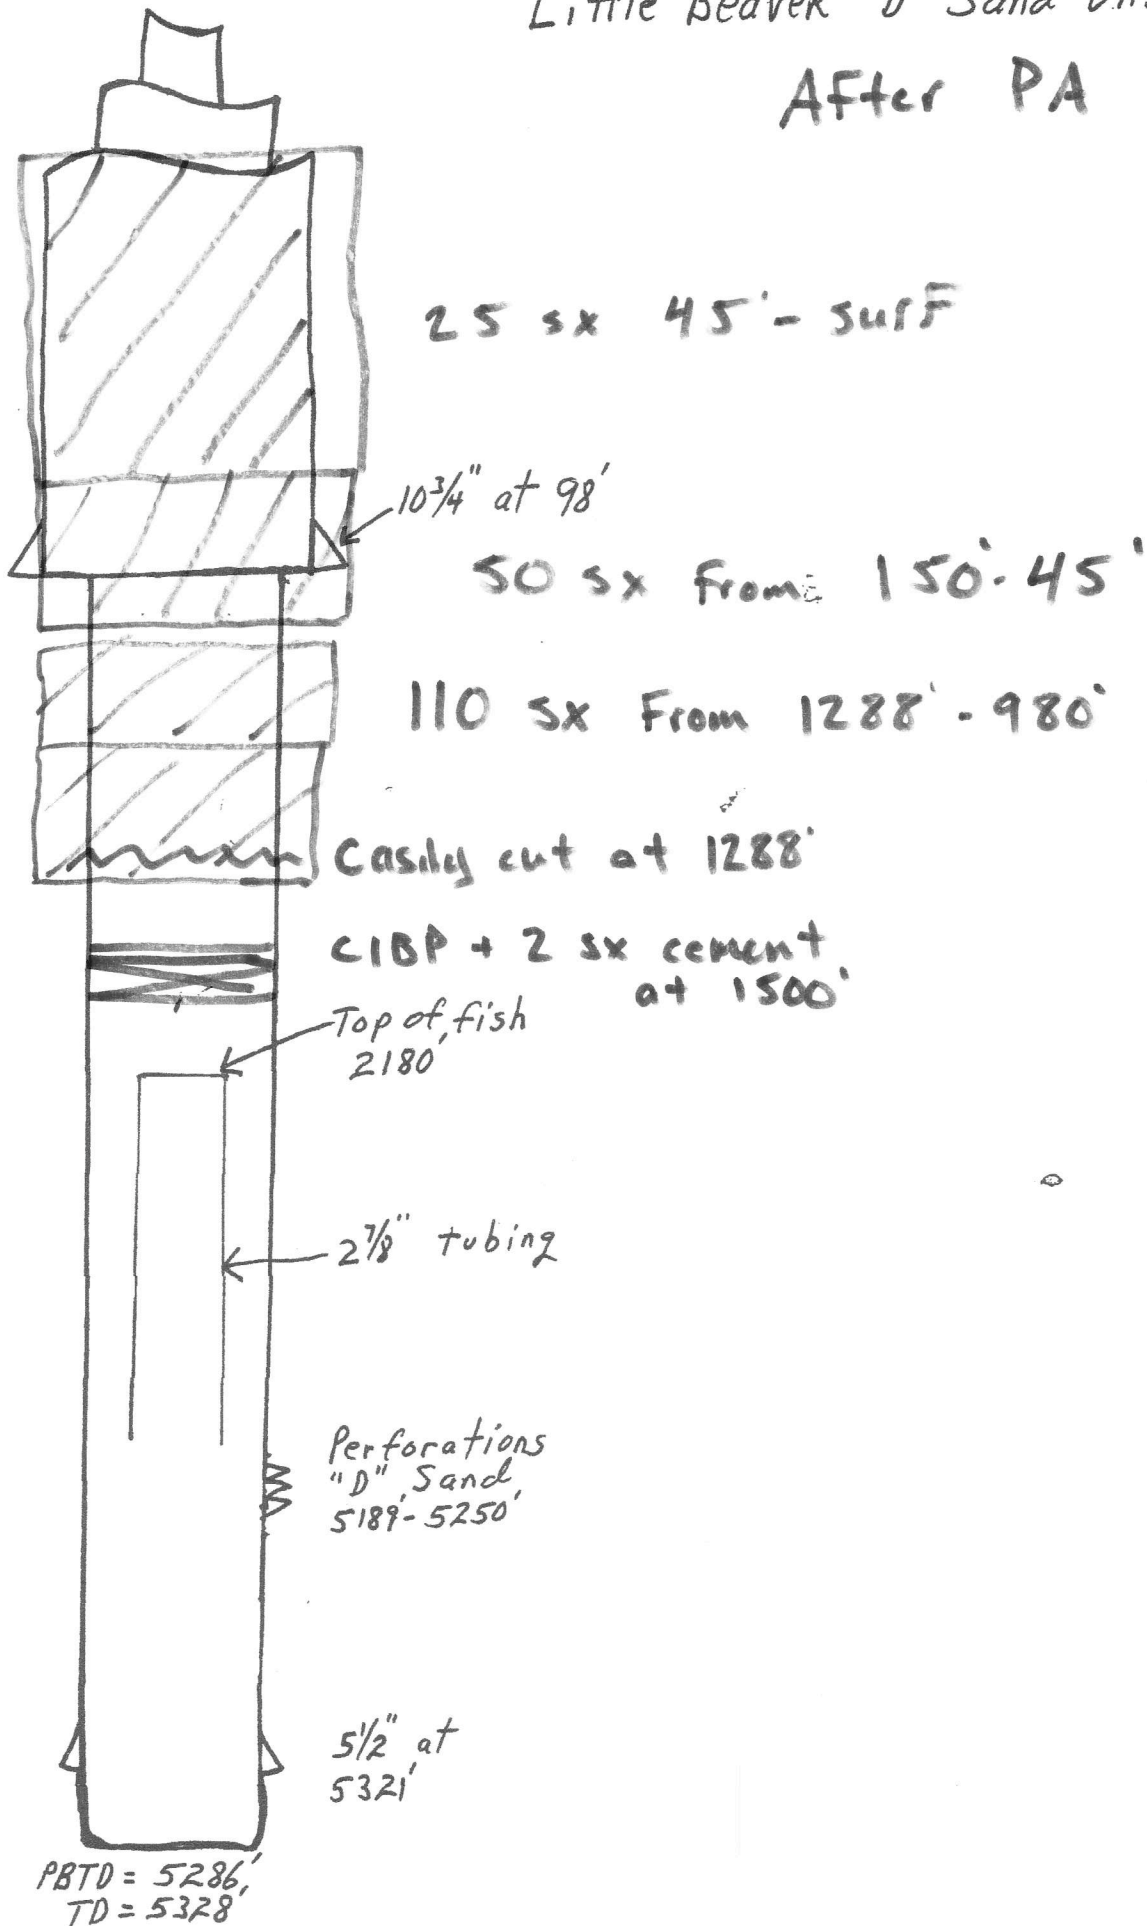

LBDSU # 64

- 9-30-08 Rigged up and tallied out of hole w/ tubing.
- 10-1-08 Worked casing all day.
- 10-2-08 J/W Wireline shot off casing at 1288'.
POOH w/ casing and laid it down.
- 10-3-08 RIH w/ tubing to 1275'. Hooked up new
Cement trailer and tested it.
- 10-6-08 Set 60 sack plug at 1288' & POOH
w/ tubing.
- 10-7-08 RIH w/ tubing and tagged cement at
1120'. Set additional 50 sack plug at
1120'. POOH w/ tubing to 150'. Set
60 sack plug & POOH w/ tubing.
- 10-8-08 Tagged cement at 45'. Topped off
to surface. Approx 20-25 sacks.
Well P & A.

Date <u>2-Oct-2008</u>	 JW WIRELINE COMPANY 8455 S. Detroit Yuma, CO 80759 Phone: (970) 848-2234 Fax: (970) 848-2236
Service Number <u>07-34-</u>	
Page <u>1001</u> of <u>1001</u>	
Time Arrive on Location	
Time Depart Location	
Miles from Nearest Field Office	

Company Maggie Customer No _____
 Bill to (if other than above) _____ Purchase Ord _____
 Address _____ AFE / Contra _____
 City, State Zip Code _____

Wellsite Information	Lease/Well Name <u>Little Beaver #6W</u>	Field Name <u>Little Beaver</u>
	County/Parish <u>Washington</u>	State <u>COLO</u>
	Section / Township / Range or Latitude / Longitude <u>6, T2S, 56W</u>	Rig Name or Crane
	Log Measured From _____	Feet Above Permanent Data _____

Line Item #	DESCRIPTION	Quantity
1	Ripe Recovery Service Charge	
2		
3	split shot 1288'	6000
4		
5		
6		
7		
8		
9		
10	Environmental Protection charge	
11	Fuel surcharge	
12		
13		
14		
15		
16		
17		
18		
19		
20		
21		
22		
23		
24		
25		

Surface Pressure	# Wireline Runs					
Pressure Equip. Type:						
Run No.	Interval Perforated / Plug Set	Type	SPF	# of Holes Shot	Run No.	Interval