

WELL LOCATION CERTIFICATE

McCall 43-09

Found #5 rebar and 3.25" aluminum cap PLS 38106.

N 89°11'24" E 2658.08'

N 89°57'56" E 2653.32'

Found #6 rebar and 3.25" aluminum cap PLS 38106.

N 00°22'35" W 2612.38'

N 00°16'11" W 2655.01'

Found #6 rebar and 3.25" aluminum cap PLS 38106.

S 00°23'04" W 2653.00'

Legend

- ⊙ Found monument as described
- ⊕ Set monument as described
- Proposed well

NAD 83 Decimal Degrees
 Lat: 40.065284° N
 Lon: 102.514227° W
 PDOP: 1.6
 Operator: John Thompson
 Ground elevation: 3958'



Found #6 rebar and 3.25" aluminum cap PLS 38106.

S 89°53'25" E 2653.15'

Found #6 rebar and 3.25" aluminum cap PLS 38106.


N 89°55'14" E 2623.04'

Found #6 rebar and 3.25" aluminum cap PLS 38106.

N 00°11'40" W 2671.84'

N 00°08'54" E 2674.61'

Section 9
 T1N R46W




Found #5 rebar and 3.25" aluminum cap PLS 38106.

N 89°49'45" W 2637.17'

Found #6 rebar and 2.5" aluminum cap PLS 23401.

N 89°49'37" W 2637.04'

Found #6 rebar and 3.25" aluminum cap PLS 23401.

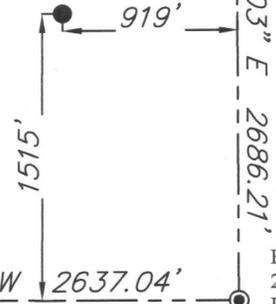

Notes

McCall 43-09 is to be located at a point 1515' from the SOUTH line and 919' (measured at right angles) from the EAST line of the Southeast Quarter of Section 9, Township 1 North, Range 46 West of the Sixth Principal Meridian, Yuma County, Colorado.

Latitude, Longitude, and Elevation are derived from RTK-GPS observations, and are corrected by the OPUS solution of a static GPS observation. Horizontal Datum: NAD83(2011) Vertical Datum: NAVD88


Distances shown hereon are at ground level and are field-measured.

Bearings of this survey are based on the assumption that the south line of the Southeast Quarter of Section 9, Township 1 North, Range 46 West of the 6th Principal Meridian, between monuments described hereon bears N 89°49'37" W as shown hereon.

This well location certificate is not a land survey plat or improvement survey plat and it is not to be relied upon for the establishment of fence, building, or other future improvement lines.

I hereby state that this survey and well location certificate were made under my responsible charge and are in accordance with applicable standards of practice, that the monuments shown hereon actually exist and that this plat and the notes shown hereon accurately represent said survey to the best of my knowledge, information and belief.

John W. Thompson
 Colorado PLS 38321
 For and on behalf of
 Forty North, LLC

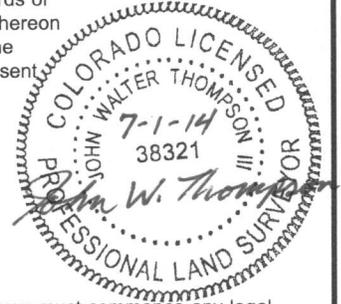

NOTICE: According to Colorado law you must commence any legal action based upon any defect in this survey within three years after you first discover such defect. In no event may any action based upon any defect in this survey be commenced more than ten years from the date of the certification shown hereon.



FORTY NORTH, LLC LAND SURVEYING

53575 County Road NN
 Wray, CO 80758
 (970) 466-0552
 fortynorthllc@gmail.com

DATE OF FIELD WORK
 7/1/2014

DATE OF DRAWING
 7/1/2014

PROJECT NO.
 1083.028

Augustus Energy Resources, LLC
 McCall 43-09 1N46W

NE1/4 SE1/4 SEC. 9, T1N, R46W, 6PM, Yuma County, Colo.