


TIFFANY 2-1 - PROPOSED PILOT HOLE & MULTI-LATERAL WELLBORE SCHEMATIC (NOT TO SCALE)

SHL (NAD 83): 37.097397287 N LAT / 107.527639041 W
 SEC 17 / T33N / R06W - La Plata County, Colorado
 261' FSL 1508' FWL

Revised: 4/18/2016

Depths referenced to GL of 6669.66' & RKB 11' @ 6680.66'

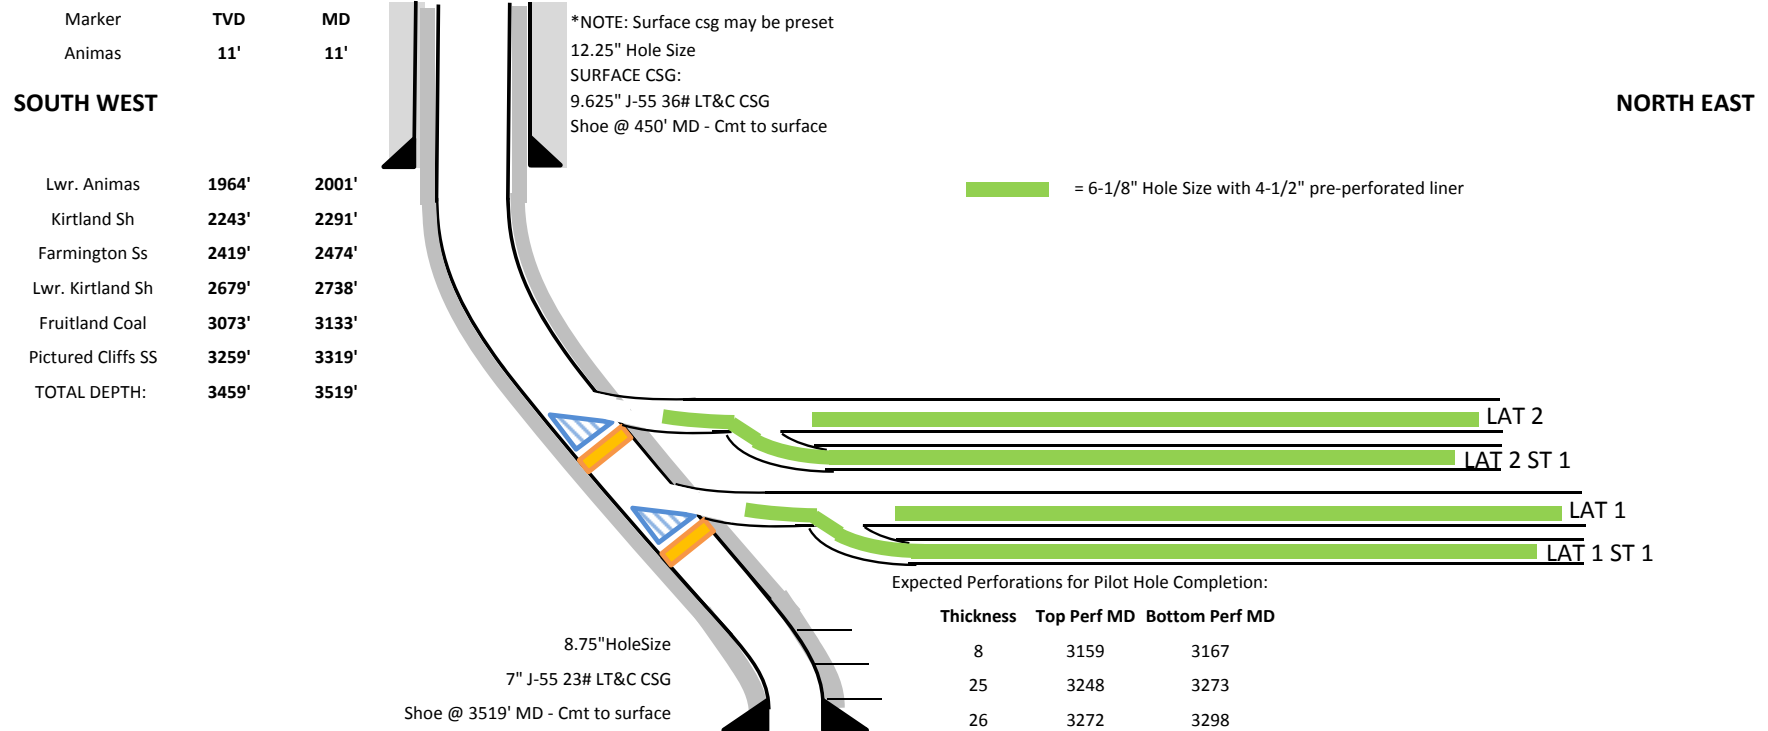

Lateral Name	Top of Window (MD)	Base of Window (MD)	Bridge Plug (MD)	KOP (MD)	KOP (TVD)	KOP Method	TD (MD)	TD (TVD)	Top of Liner (MD)	End of Liner (MD)	Target Formation	BHL
PILOT	N/A	N/A	N/A	540	540	OH	3519.4	3459	N/A	N/A	Fruitland Coal	625' FSL & 1851' FWL SEC 17 / T33N / R06W
LAT 1	2867	2877	2882	2871.7	2811.6	Whipstock	7254.5	3221	3862	7254	Fruitland Coal	1711' FNL & 710' FEL SEC 17 / T33N / R06W
LAT 1 ST1	N/A	N/A	N/A	3787	3330.4	OH	7392.2	3206	2882	7392	Fruitland Coal	710' FNL & 2261' FWL SEC 17 / T33N / R06W
LAT 2	2816	2826	2831	2821	2761.2	Whipstock	7233.3	3181	3683	7233	Fruitland Coal	1612' FNL & 710' FEL SEC 17 / T33N / R06W
LAT 2 ST1	N/A	N/A	N/A	3608	3207.9	OH	7266.7	3181	2831	7267	Fruitland Coal	710' FNL & 2161' FWL SEC 17 / T33N / R06W

*NOTE: Tops are approximate and may shift based on tops after the pilot is logged. Number of whipstocks and KOPs will be adjusted for formation tops, BHA selection and casing collars. Whipstocks and bridge plugs to be removed after running the last liner. Casing exits and whipstock removals may be performed with a service rig.