


TIFFANY 2-5 - PROPOSED PILOT HOLE & MULTI-LATERAL WELLBORE SCHEMATIC (NOT TO SCALE)

SHL (NAD 83): 37.09718072 N LAT / 107.52729555 W
 SEC 17 / T33N / R06W - La Plata County, Colorado
 182' FSL 1608' FWL

Revised: 5/4/2016

Depths referenced to GL of 6669.75' & RKB 11' @ 6680.75'

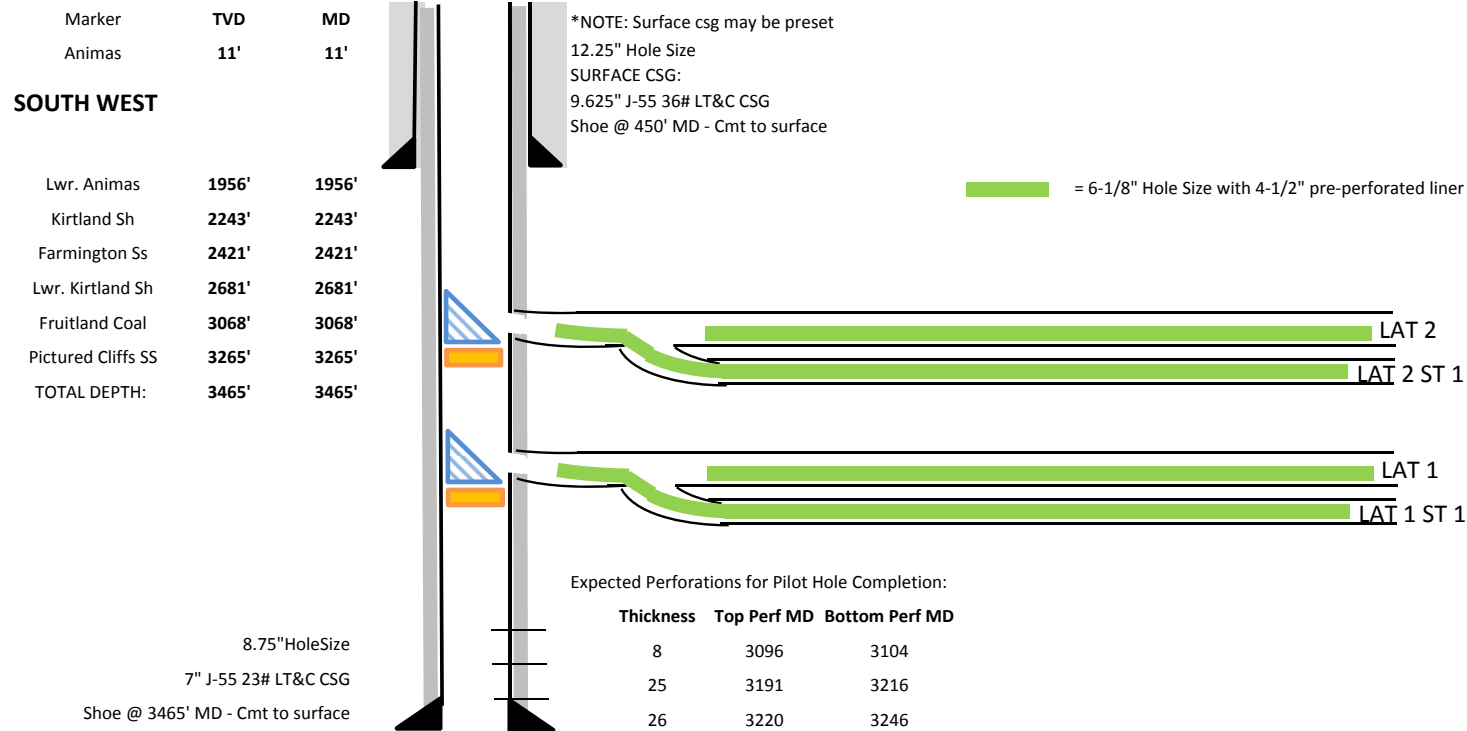

Lateral Name	Top of Window (MD)	Base of Window (MD)	Bridge Plug (MD)	KOP (MD)	KOP (TVD)	KOP Method	TD (MD)	TD (TVD)	Top of Liner (MD)	End of Liner (MD)	Target Formation	BHL
PILOT	N/A	N/A	N/A	N/A	N/A	OH	3465	3465	N/A	N/A	Fruitland Coal	182' FSL & 1608' FWL SEC 17 / T33N / R06W
LAT 1	2662	2672	2677	2667.1	2667.1	Whipstock	7735.3	3216	3695	7735	Fruitland Coal	1212' FSL & 560' FEL SEC 19 / T33N / R06W
LAT 1 ST1	N/A	N/A	N/A	3620	3239.7	OH	7337.4	3201	2677	7337	Fruitland Coal	2197' FSL & 1946' FEL SEC 20 / T33N / R06W
LAT 2	2612	2622	2627	2617	2617	Whipstock	7568.6	3168	3681	7569	Fruitland Coal	1206' FSL & 460' FEL SEC 19 / T33N / R06W
LAT 2 ST1	N/A	N/A	N/A	3606	3210.8	OH	7333.5	3171	2627	7333	Fruitland Coal	2244' FSL & 1859' FEL SEC 20 / T33N / R06W

*NOTE: Tops are approximate and may shift based on tops after the pilot is logged. Number of whipstocks and KOPs will be adjusted for formation tops, BHA selection and casing collars. Whipstocks and bridge plugs to be removed after running the last liner. Casing exits and whipstock removals may be performed with a service rig.