


TIFFANY 2-3 - PROPOSED PILOT HOLE & MULTI-LATERAL WELLBORE SCHEMATIC (NOT TO SCALE)

SHL (NAD 83): 37.09754164 N LAT / 107.52786806 W
 SEC 17 / T33N / R06W - La Plata County, Colorado
 313' FSL 1441' FWL

Revised: 4/29/2016

Depths referenced to GL of 6669.66' & RKB 11' @ 6680.66'

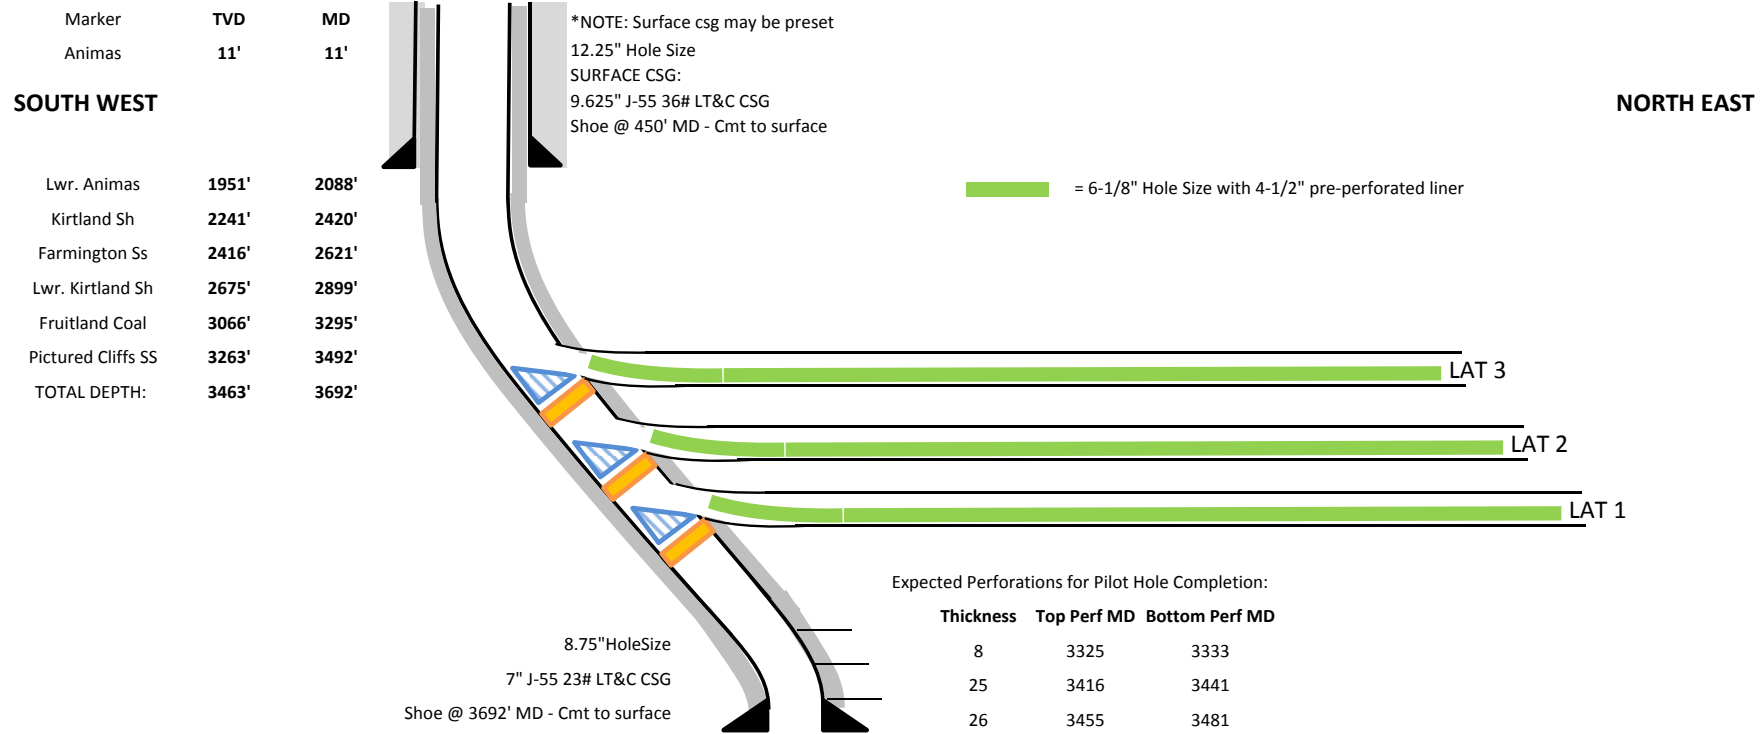

Lateral Name	Top of Window (MD)	Base of Window (MD)	Bridge Plug (MD)	KOP (MD)	KOP (TVD)	KOP Method	TD (MD)	TD (TVD)	Top of Liner (MD)	End of Liner (MD)	Target Formation	BHL
PILOT	N/A	N/A	N/A	540	540	OH	3692.3	3463	N/A	N/A	Fruitland Coal	438' FSL & 450' FWL SEC 17 / T33N / R06W
LAT 1	3008	3018	3023	3013	2785.6	Whipstock	9526.3	3136	3023	9526	Fruitland Coal	1264' FSL & 508' FEL SEC 13 / T33N / R06W
LAT 2	2956	2966	2971	2961.3	2735.1	Whipstock	9441	3086	2971	9441	Fruitland Coal	1170' FSL & 476' FEL SEC 13 / T33N / R06W
LAT 3	N/A	N/A	N/A	2914.2	2689.4	Whipstock	9344.2	3011	2924	9344	Fruitland Coal	1071' FSL & 459' FEL SEC 13 / T33N / R06W

*NOTE: Tops are approximate and may shift based on tops after the pilot is logged. Number of whipstocks and KOPs will be adjusted for formation tops, BHA selection and casing collars. Whipstocks and bridge plugs to be removed after running the last liner. Casing exits and whipstock removals may be performed with a service rig.