


# R. 94 W.

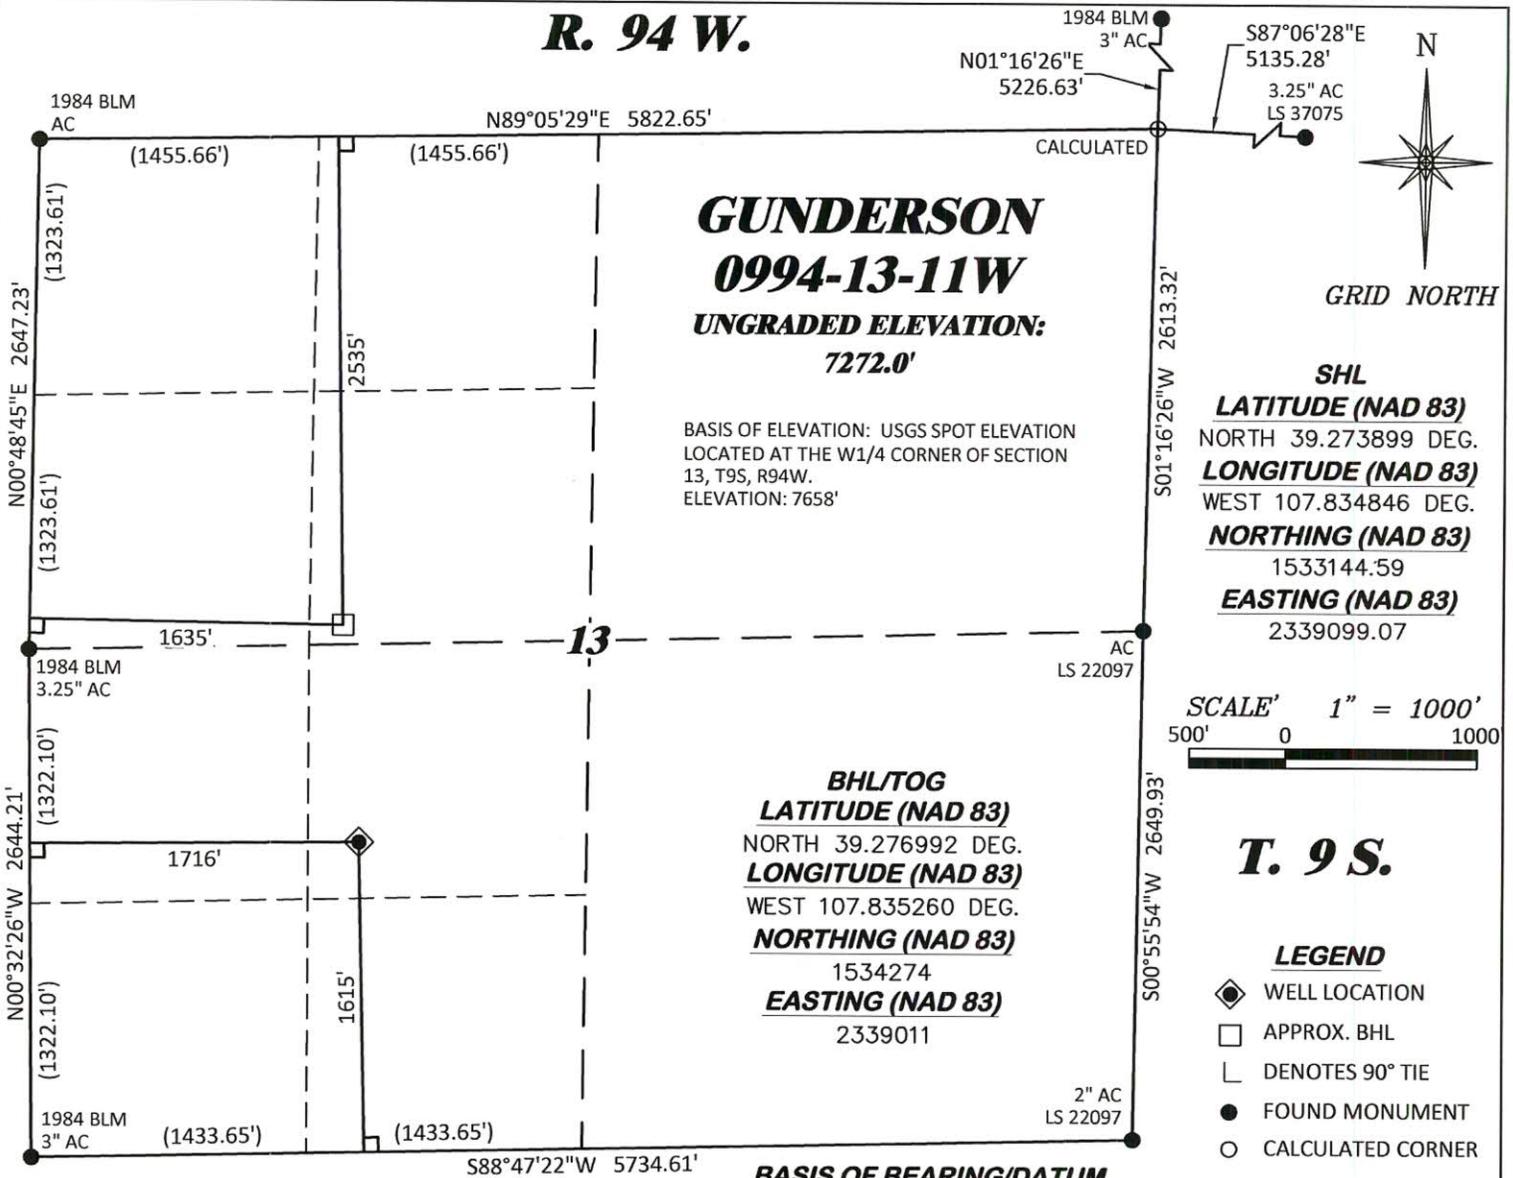

**GUNDERSON**  
**0994-13-11W**  
**UNGRADED ELEVATION:**  
**7272.0'**

BASIS OF ELEVATION: USGS SPOT ELEVATION  
 LOCATED AT THE W1/4 CORNER OF SECTION  
 13, T9S, R94W.  
 ELEVATION: 7658'

**SHL**  
**LATITUDE (NAD 83)**  
 NORTH 39.273899 DEG.  
**LONGITUDE (NAD 83)**  
 WEST 107.834846 DEG.  
**NORTHING (NAD 83)**  
 1533144.59  
**EASTING (NAD 83)**  
 2339099.07

**SCALE'** 1" = 1000'  
 500' 0 1000'

**BHL/TOG**  
**LATITUDE (NAD 83)**  
 NORTH 39.276992 DEG.  
**LONGITUDE (NAD 83)**  
 WEST 107.835260 DEG.  
**NORTHING (NAD 83)**  
 1534274  
**EASTING (NAD 83)**  
 2339011

**T. 9 S.**

- LEGEND**
- ◆ WELL LOCATION
  - APPROX. BHL
  - └ DENOTES 90° TIE
  - FOUND MONUMENT
  - CALCULATED CORNER

**BASIS OF BEARING/DATUM**

SPCS COLORADO CENTRAL ZONE NAD 27 BASED ON GPS OBSERVATIONS  
 AND OPUS SOLUTION ON DRG CONTROL POINT "23-9-94" HAVING A  
 POSITION OF:  
 NAD83(2011)  
 LAT 39° 15' 45.58" NORTH  
 LONG 107° 51' 00.68" WEST  
 NAVD88 ELEVATION: 7182.10

THE WEST LINE OF THE SW¼ OF SECTION 13, MONUMENTED BY BLM  
 AC'S AND BEARING N 00°32'26" W.


**NOTES**

1. GPS OPERATOR T. SHERRILL OBSERVED A PDOP OF 1.2.
2. ALL GPS OBSERVATIONS ARE IN COMPLIANCE WITH COGCC RULE No.215.
3. EXISTING IMPROVEMENTS WITHIN 500' OF LOCATION. SEE LOC. DRAWING.
4. SURROUNDING SURFACE USE IS NATIVE BRUSH, NON CROP RANGELAND.

**SURVEYOR'S STATEMENT**

I, DAVID E. HENDERHAN, AN EMPLOYEE AND AGENT ON BEHALF OF D.R. GRIFFIN & ASSOCIATES, INC. STATE THE PLAT HEREON IS A CORRECT REPRESENTATION OF A SURVEY MADE UNDER MY SUPERVISION ON THE 29th DAY OF SEPTEMBER, 2017 OF THE SHOWN GUNDERSON 0994-13-11W AND THAT THE LOCATION HAS BEEN STAKED ON THE GROUND AS SHOWN ON THIS PLAT.

Notice: In accordance with Colorado State Law, any legal action based upon any defect in this survey plat must commence within three (3) years after first discovery of such defect. In no event, may any action based upon any defect in this survey plat be commenced more than ten (10) years from the date of certification shown hereon.

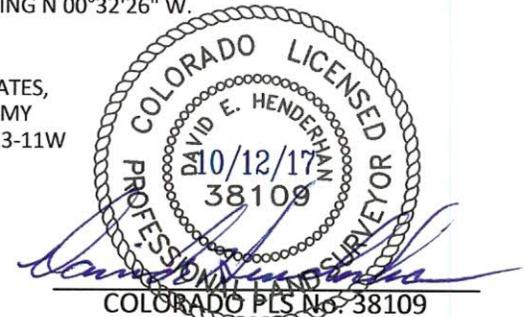

**GUNDERSON 13-11 PAD**

COLORADO PLS No. 38109

<p><b>DRG RIFFIN &amp; ASSOCIATES, INC.</b>                  (307) 362-5028 1414 ELK ST., ROCK SPRINGS, WY 82901</p>	<p><b>PLAT OF DRILLING LOCATION IN</b>  <b>NESW, SECTION 13, FOR</b>  <b>LARAMIE ENERGY, LLC.</b></p>
	<p><b>1615' F/SL, &amp; 1716' F/WL, SECTION 13,</b>  <b>T. 9 S., R. 94 W., 6TH P.M.,</b>  <b>MESA COUNTY, COLORADO</b></p>
<p><b>DRAWN: 10/11/2017 - TCM</b></p>	<p><b>SCALE: 1" = 1000'</b></p>
<p><b>REVISED: N/A -</b></p>	<p><b>DRG JOB No. 21443</b></p>
	<p><b>B9-13-11W</b></p>