

# YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date Jan 4th 2002

COMPANY Coral Production

LEASE Jost

WELL NO. A-2


RIG 9

COUNTY Washington

Work Ordered By: JACK CRUMLEY

Job Description: laydown rods

		HOURS	TOTAL	
Drive to location		1	\$185	00
Warm Up Rig- Un load tools- uncap well- unhang head- Remove polish rod & stuffing box- Work to unseat pump- laydown 2'x7/8" rod sub- trip out & laydown 8'3x7/8", 128x3/4" rods- laydown 2'x1 1/2" x 16' pump- rig down rod equip- rig up tubing equip- breakout plug line- unrack tubing to rods- uncap tubing head- unload tubing- Work string & release ASIX- pick up 1x2 7/8" joint- dog bottom- laydown single- land tubing- cap head off- Shut in well- pick up tools.		7.5	2250	00
Drive home		1	185	00
RODS 8'3x7/8", 128x3/4"	PUMP 2'x1 1/2" x 16'			
TUBING	SUBS			
OTHER				
Remarks:				
FURNISHED				
Rod Wiping Rubber			12	75
UNIT CHARGE				
Tristobal Galaviz		9.5		
Angel Mills		9.5		
Rodrigo fernandez		9.5		
4.4% SALES TAX (\$12.75)				56
SUB TOTAL			\$2633	31

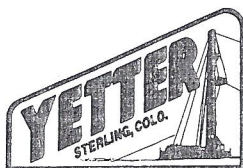

# YETTER WELL SERVICE, INC.

P.O. Box 1608 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date Jan 5<sup>th</sup> 2002

COMPANY Coral Production

LEASE Just

WELL NO. A-2

RIG 9


COUNTY Washington

Work Ordered By: JACK CRUMLEY

Job Description:

		HOURS	TOTAL	
Drive to location		1	\$185	00
Warm Up Rig - Unload tools - Uncap well - Unload tubing - pick up single 2 3/8" joint - tag - lay down single - rig up hydratester - hydratester to back - and trip out 152 x 2 3/8" joints - inspect on/off tool - trip in w/ 4 joints - rig down hydratester - trip in 198 more joints - latch on to packer - laydown single - load tubing cap tubing head off - Cap off well - pick up tools		8.5	2550	00
Drive home		1	185	00
RODS				
PUMP				
SUBS				
TUBING				
SUBS				
OTHER				
Remarks:				
FURNISHED				
1/2 gal Pipe thread seal			34	65
UNIT CHARGE				
Cristobal Galavi 2		10.5		
Angel Mills		10.5		
Rodrigo Hernandez		10.5		
4.4% SALES TAX (\$34.15)			1	5.3
TOTAL			\$2956	18



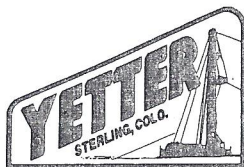

# YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date Jan 7<sup>th</sup> 2021

COMPANY Coral Production

LEASE lost

WELL NO. 14-2


RIG 9

COUNTY Washington

Work Ordered By: JACK CRUMLEY

Job Description: Per A

			HOURS	TOTAL
Drive to Location			1	\$ 185 00
Warm Up Rig - Unload tools - Uncap tubing head and well - trip out 152 x 2 3/8" joints - remove on/off tool - lay down arrow set - trip out 4 x 2 3/8" joints - S/N 4' x 2 3/8" perp sub - 24' mud joint - pick up 5 1/2" mud set plug - trip in 155 x 2 3/8" joints - Set plug - trip out Standing back 34 x 2 3/8" joints - lay down 121 x 2 3/8" joints - Cap well off - clean & pick up tools			8.5	2550 00
Drive Home			1	185 00
RODS	PUMP	SUBS		
TUBING	SUBS	OTHER		
Remarks:				
FURNISHED				
1/2 gal pipe thread seal				34 65
2 3/8" tubing wiping rubber				36 50
UNIT CHARGE				
Crisobal Galaviz			10.5	
Angel Mills			10.5	
Rodrigo Hernandez			10.5	
4.4% SALES TAX (\$71.15)				3 13
Sub TOTAL				\$ 2994 28

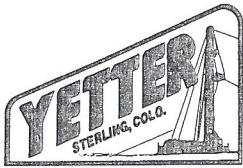

# YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date 1-10-22

COMPANY Coral production

LEASE JOSE

WELL NO. A-2

RIG 9

COUNTY Washington

Work Ordered By: Jim Wiegner

Job Description: P+ A

	HOURS	TOTAL
Drive to rig	1	185 00
Warm up rig. Rig up wire line. Dump Bar 1200		
50 CLIP at 4832. Perforate at 1200 and		
190. Run down wire line. Trip in with CIRC		
Set at 1091. Rig up pumps and establish		
Injection Rate. Mix and pump 3050s Below	7.5	2250 00
and 1050s on top. Trip out of hole leaving down		
top well and mix 1000s at 2% calcium chloride		
Pump cement till cement returns at surface		
shot well in and clean up.		

Drive Home.	1	185 00
-------------	---	--------

RODS	PUMP	SUBS
TUBING	SUBS	OTHER

Remarks: 1.30 BP/15K

FURNISHED

140 SKS CEMENT - @ 15.25/SACK		2135 00
190 BII Tank		90 00
90 BII Tank		80 00
1/2 Bag calcium chloride		19 50
Cement pump		900 00
Triplex	5	625 00
2 3/8 wing Rubber		36 50
2 3/8 Hindaliner rubber		167 70

UNIT CHARGE

Rodrigo	8.5
Angle	8.5
ROT	6.5

4.40% SALES TAX

TAX


(\$2358.70)

103 78

SUB TOTAL

\$6977 48



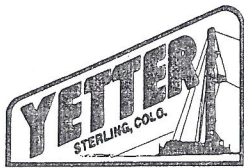

# YETTER WELL SERVICE, INC.

P.O. Box 1808 • Sterling, Colorado 80751-7808

Phone (970) 522-2885

Date Jan 11<sup>th</sup> 2021

COMPANY Coral Production

LEASE Just

WELL NO. A-2

RIG 9

COUNTY Washington

Work Ordered By: JACK CRUMLEY

Job Description: P&A

	HOURS	TOTAL	
Drive to location	1	\$ 185	00
Warm Up Rig- Unload tools- Uncap Well- Pick 5 joints- tarp rig up cement equip- mix 45sx of cement- pump down tubing- rig down + clean up pump lines- trip out casing down 5 joints- rig up triplex to flow lines- Pump down flow line- drain triplex pump- rack out equip- pick up tools- rig down- wave off location.	6.5	1950	00

RODS	PUMP	SUBS
TUBING	SUBS	OTHER

Remarks: Yield @ 1.29' per x

FURNISHED			
Triplex Pump	2	250	00
Cement Unit	2	200	00
Cement	45sx	686	25
Calcium		19	50

UNIT CHARGE			
Cristobal Galaviz	7.5		
Angel Mills	7.5		
Rodrigo Hernandez	7.5		
Nathan Hall	7.5		

4.4% SALES TAX (\$705.75) 31 05  
SUB TOTAL \$3321 80