


FOUND 2014  
ALUM CAP  
"PLS 22097"

**R. 93 W.**

FOUND  
0.9'x0.9'  
STONE

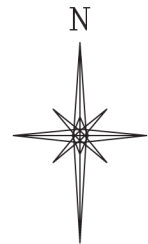

**GRID NORTH**  
SCALE' 1" = 1000'  
500' 0 1000'

**T. 9 S.**

**LARAMIE FED**  
**0993-21-15W**  
**UNGRADED ELEVATION:**  
**7460.0'**

S87°57'02"E 5209.33'

(1302.33')

(1302.33')

268'

47'

(1360.79')

N01°12'11"E 2721.58'

(1360.79')

**29**

FOUND 2011  
ALUM CAP  
"LS 12180"

**SHL**  
**LATITUDE (NAD 83)**  
NORTH 39.254645 DEG.  
**LONGITUDE (NAD 83)**  
WEST 107.783972 DEG  
**NORTHING (NAD 83)**  
1525768.21  
**EASTING (NAD 83)**  
2353319.92

**BASIS OF BEARING/DATUM**  
SPCS CO CENTRAL ZONE NAD 27 BASED  
ON GPS STATIC OBSERVATIONS AND  
OPUS SOLUTION ON DRG CONTROL  
POINT "CP 16-9-93" HAVING A  
POSITION OF:  
NAD83(2011)  
LAT 39° 16' 16.64" NORTH  
LONG 107° 46' 11.24" WEST  
NAVD88 ELEVATION: 7245.29

THE NORTH LINE OF SECTION 29,  
MONUMENTED AS SHOWN AND  
BEARING S87°57'02"E.

**NOTES**

1. GPS OPERATOR T. SHERRILL OBSERVED A PDOF OF 1.4.
2. ALL GPS OBSERVATIONS ARE IN COMPLIANCE WITH COGCC RULE No.215.
3. EXISTING IMPROVEMENTS WITHIN 2000' OF LOCATION. SEE LOC. DRAWING.
4. SURROUNDING SURFACE USE IS NATIVE BRUSH, NON CROP RANGELAND.


**LEGEND**

- ◆ WELL LOCATION
- FOUND MONUMENT

**SURVEYOR'S STATEMENT**

I, DAVID E. HENDERHAN, AN EMPLOYEE AND AGENT ON BEHALF OF D.R. GRIFFIN & ASSOCIATES, INC. STATE THE PLAT HEREON IS A CORRECT REPRESENTATION OF A SURVEY MADE UNDER MY SUPERVISION ON THE 24th DAY OF APRIL, 2023 OF THE SHOWN LARAMIE FED 0993-21-15W AND THAT THE LOCATION HAS BEEN STAKED ON THE GROUND AS SHOWN ON THIS PLAT.

Notice: In accordance with Colorado State Law, any legal action based upon any defect in this survey plat must commence within three (3) years after first discovery of such defect. In no event, may any action based upon any defect in this survey plat be commenced more than ten (10) years from the date of certification shown hereon.

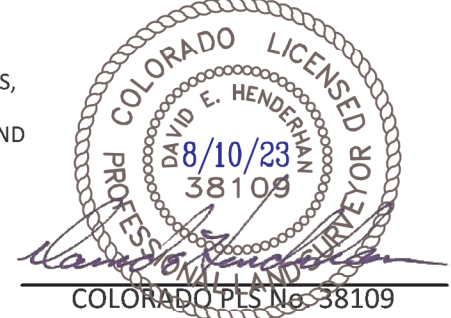

**LARAMIE 0993-29-01**


COLORADO PLS No. 38109




**PLAT OF DRILLING LOCATION IN  
NENE, SECTION 29, FOR  
LARAMIE ENERGY, LLC**

DRAWN: 8/10/2023 - DEH	SCALE: 1" = 1000'
REVISED: N/A	DRG JOB No. 22334
	A10-21-15W

**268' F/NL, & 47' F/EL, SECTION 29,  
T. 9 S., R. 93 W., 6TH P.M.,  
MESA COUNTY, COLORADO**

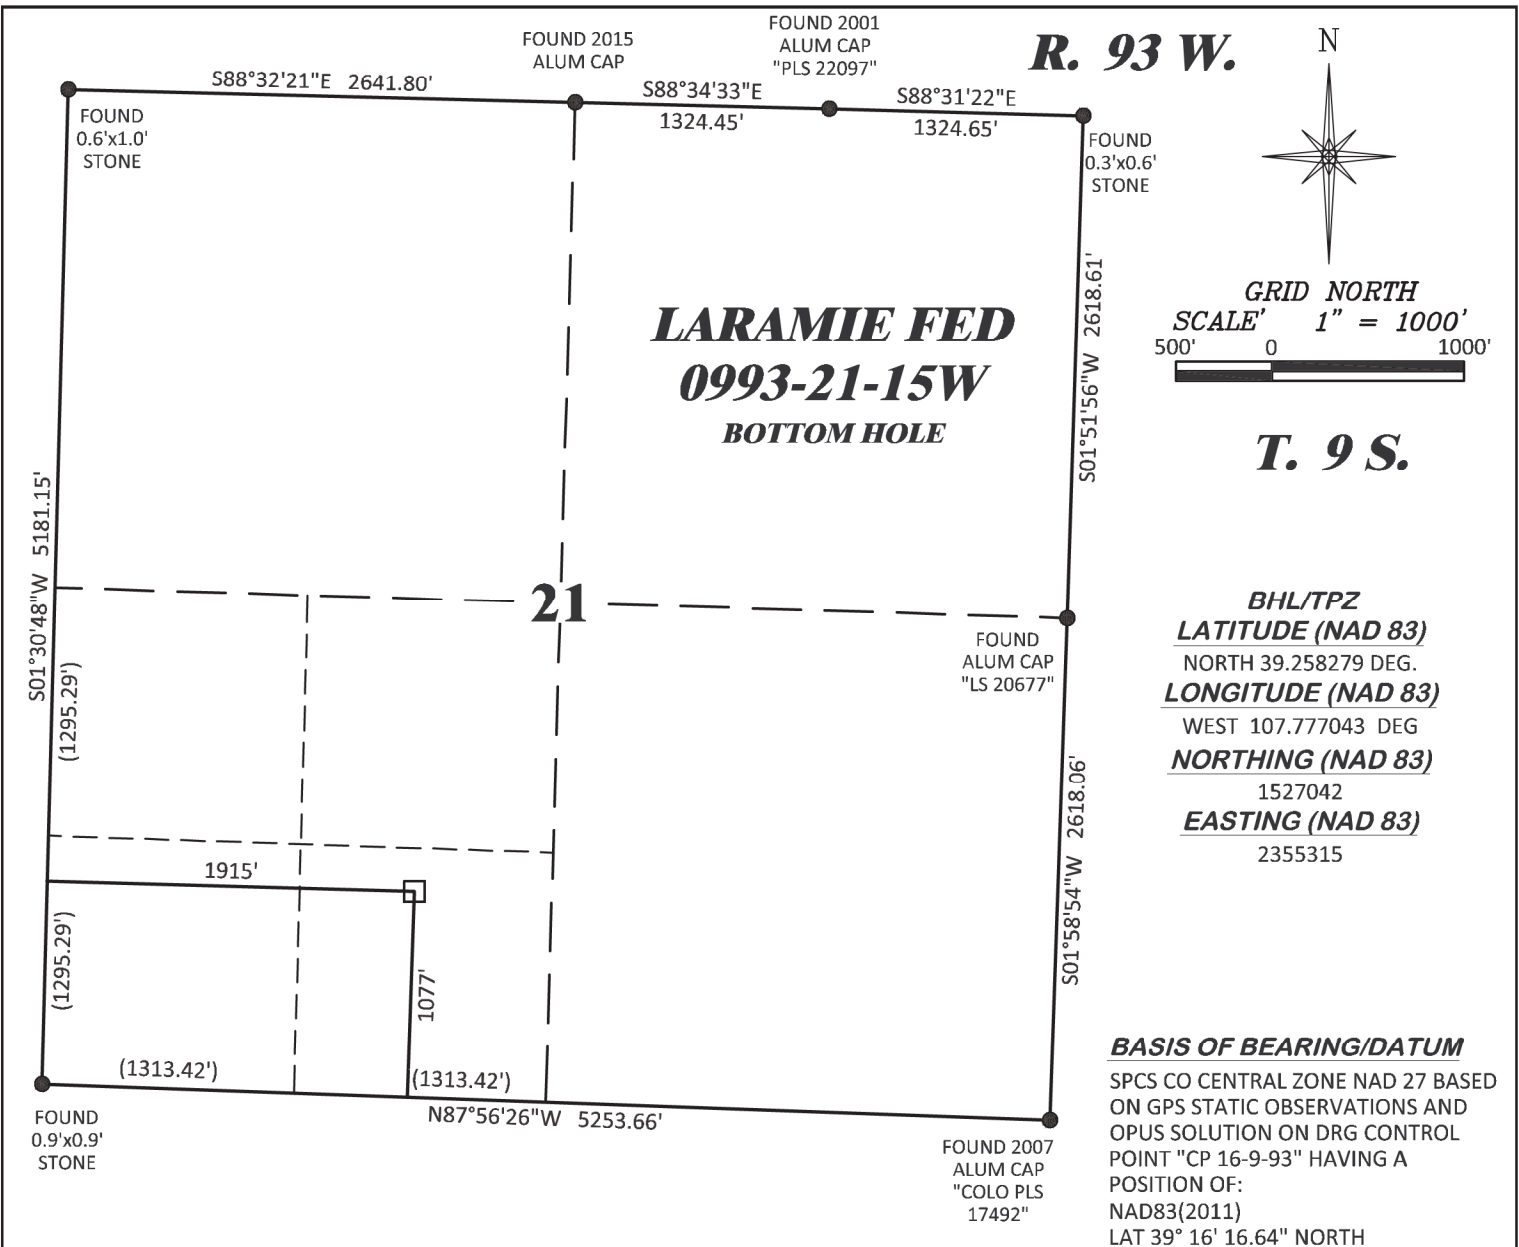

**R. 93 W.**

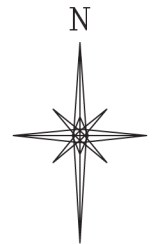

**GRID NORTH**  
**SCALE' 1" = 1000'**  
 500' 0 1000'

**T. 9 S.**

**LARAMIE FED**  
**0993-21-15W**  
**BOTTOM HOLE**

**BHL/TPZ**  
**LATITUDE (NAD 83)**  
 NORTH 39.258279 DEG.  
**LONGITUDE (NAD 83)**  
 WEST 107.777043 DEG  
**NORTHING (NAD 83)**  
 1527042  
**EASTING (NAD 83)**  
 2355315

**BASIS OF BEARING/DATUM**  
 SPCS CO CENTRAL ZONE NAD 27 BASED  
 ON GPS STATIC OBSERVATIONS AND  
 OPUS SOLUTION ON DRG CONTROL  
 POINT "CP 16-9-93" HAVING A  
 POSITION OF:  
 NAD83(2011)  
 LAT 39° 16' 16.64" NORTH  
 LONG 107° 46' 11.24" WEST  
 NAVD88 ELEVATION: 7245.29

**LEGEND**

- APPROX. BHL/TPZ
- FOUND MONUMENT


THE WEST LINE OF SECTION 21,  
 MONUMENTED AS SHOWN AND  
 BEARING S01°30'48"W.

**SURVEYOR'S STATEMENT**

I, DAVID E. HENDERHAN, AN EMPLOYEE AND AGENT ON BEHALF OF D.R. GRIFFIN & ASSOCIATES, INC. STATE THE PLAT HEREON IS A CORRECT REPRESENTATION OF A SURVEY MADE UNDER MY SUPERVISION ON THE 24th DAY OF APRIL, 2023 OF THE SHOWN LARAMIE FED 0993-21-15W BOTTOM HOLE.

Notice: In accordance with Colorado State Law, any legal action based upon any defect in this survey plat must commence within three (3) years after first discovery of such defect. In no event, may any action based upon any defect in this survey plat be commenced more than ten (10) years from the date of certification shown hereon.

**LARAMIE 0993-29-01**

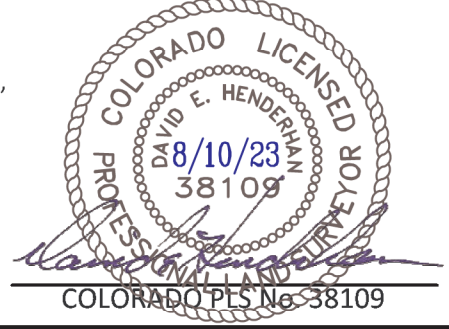

**DRG** **GRIFFIN & ASSOCIATES, INC.**  
 (307) 362-5028 1414 ELK ST., ROCK SPRINGS, WY 82901

<b>DRAWN: 8/10/2023 - DEH</b>	<b>SCALE: 1" = 1000'</b>
<b>REVISED: N/A</b>	<b>DRG JOB No. 22334</b>
	<b>A10-21-15W BHL</b>

**PLAT OF BOTTOM HOLE LOCATION IN**  
**SESW, SECTION 21, FOR**  
**LARAMIE ENERGY, LLC**  
**1077' F/SL, & 1915' F/WL, SECTION 21,**  
**T. 9 S., R. 93 W., 6TH P.M.,**  
**MESA COUNTY, COLORADO**