

Fee 156X

<u>Company</u>	SCOUT	
<u>Field Name</u>	RANGELY	
<u>Location</u>	SESE Section 18,T2N,R102W, 6TH P.M.	
<u>Short Name</u>	FE156X	
<u>County & State</u>	Rio Blanco, CO	Casim
<u>API No.</u>	05-103-10336	
<u>Updated by</u>	Austin Mayer	
<u>Date of Diagram</u>	4/11/2025	
<u>Kelly Bushing</u>	5,384'	
<u>Ground Level</u>	5,364'	
<u>Spud Date:</u>	1/6/2004	
<u>Completion Date:</u>	2/4/2004	

Casing Leak Details

Surface Casing							
Size	9 5/8"	Weight	36.0#	Grade	K-55	Depth	0-1029
Year	2004	Sx. Cmt.	505 sx	Circulate		TOC @	0' - Calc

Production Casing							
Size	7"	Weight	23.#	Grade	K-55 & L-80	Depth	0-6210
Size		Weight		Grade		Depth	
Size		Weight		Grade		Depth	
Year	2004	Sx. Cmt.	750 sx	Circulate		TOC @	0' - Calc


Production Linear 1			
Size	Weight	Grade	Depth
Year	Sx. Cmt.	Circulate	TOC @

<u>Upper Perf</u>	_____
<u>Lower Perf</u>	_____
<u>Open Hole</u>	6210-6518

Current Completion

Formation Tops

T/Niobrara	
B/Niobrara	
T/Frontier	3272
T/Frontier 1st Sand	
T/Mowry	
T/Dakota	3628
T/Morrison	3709
T/Curtis	4426
T/Entrada	4352
T/Carmel	4573
T/Navajo	4427
T/Chinle	5339
T/Shinarump	5467
T/Moenkopi	5559
T/L Moenkopi	
T/L Weber	6230

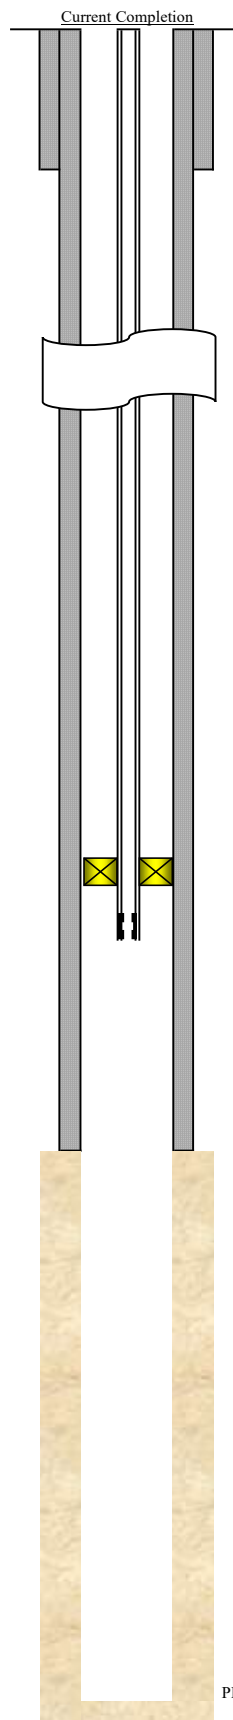

PBTD: 6,518'
TD: 6,518'

Cement
Weber
Fill