

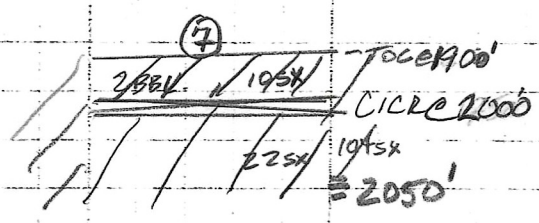


APP'D PTA PLAN
WBD
30 APR 26

STRACHAN EXPLORATION, INC
WOLLERT #1
API 05-011-06039
SPUD 8/10/74
STR SENW 3-215-48W
COUNTY BENT
LOCID 321215
FACILITYID 206293
LAT/LNG 38.26277/-102.7909
FED LEASE
MORROW 4749-69
STONE CORRAL 1880-1940
NIO @ SURF

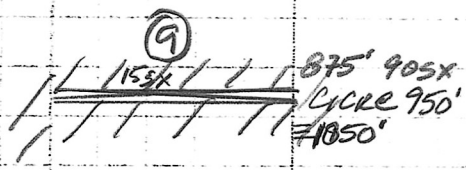

- PROPOSED PTA PROCEDURE
RUN BH TEST, RECORD & REPORT TO SDR.
- 1) MIX, PULL 2 3/8" TBG
 - 2) PU CIBP, RTH, SET @ 4700'
 - 3) DUMP BAIL 4 SX ON TOP OF PUG.
 - 4) LOAD HOLE & PTEST TO 250 PSI
 - 5) RU WL PERF @
2050', 1050', 530'
 - 6) SET CICRE 2000'
 - 7) MIX & PUMP 50 SX & 40 SX THEN 10 SX ON TOOL
 - 8) PU CICRE 950'
 - 9) MIX & SQZ 90 SX & 75 SX THEN 15 SX ON TOOL
 - 10) MIX & CIRCULATE 160 SX LEAVE CSG FULL

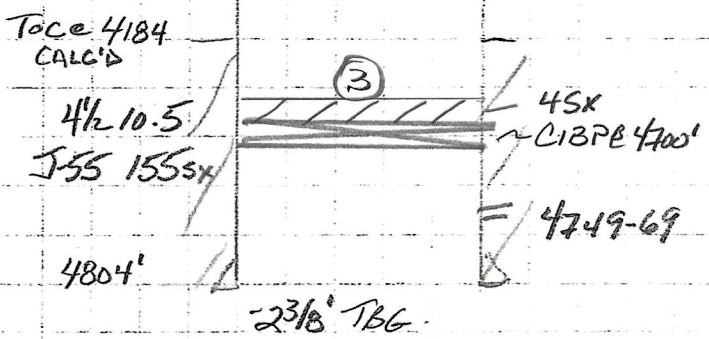

WAIT MIN 5 DAYS TO CUT & CAP
PERFORM BUBBLE TEST
TAKE STILL PICS TO SDR.