


Dickinson Exploration Non-Bond Claim: Task 1 - Plug and Abandon - 392920 , 083-06089
Walter Goff #1

Prepared 1/20/2025 **Notes:**
Operator # 24300 Spud 07/25/1974
FIELD NAME Sierra
FIELD NUMBER 77460

LOCATION

Basin Paradox Mineral Owner: Fee
Location-Townships 35N Surface Owner: Fee
Location-Ranges 13W
Elevation 6,920'

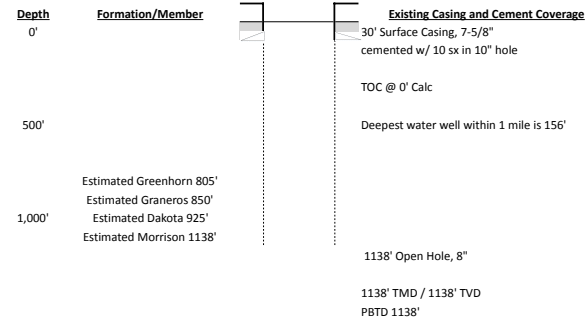


Estimated Greenhorn 805'
Estimated Graneros 850'
Estimated Dakota 925'
Estimated Morrison 1138'

Annulus above shoe	Space	Hole/Csg	Csg	cf/f	bbls/ft
Casing				6	0.1963 0.0350
Hole		8		0.3491	0.0622
Plug #	sx	bbls			
1	55	10.8			
2	110	21.6			
3	55	10.8			
4	110	10.8			
Total		330	53.9		

Units			
Sacks Cement	ft	ft^3/ft	ft^3/sack
275.00	Length of Plug	Capacity	Yield
	250	5454.0000	1.15

Units			
Sacks Cement	ft	ft^3/ft	ft^3/sack
275.00	Length of Plug	Capacity	Yield
	579.85	0.5454	1.15

*BOP or other mechanical method should be used for well control

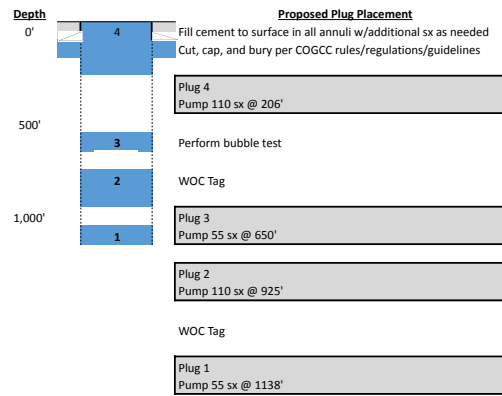

Run CBL/CCL/Caliper Log

RIH w/gauge ring & tag existing PBTD
Remove any obstructions in the well to reach PBTD
Remove rods, tubing, tubing anchor/packer/BHA
Kill the well - Do not assume well is dead