

Sanjel (USA) Inc.
200, 505 - 2nd Street SW
Calgary, Alberta, T2P 1N8
Telephone: (403) 269-1420



SERVICE TICKET
9154251

This service ticket is not an invoice; pricing is subject to review and change without notice.

[illegible]

Sanjel

Client Name	Well Name	Job Date
Augustus Energy Partners	Round Tree 24-27	July 26, 2010
Client Representative	Well Location	Job Type
Justin Stone	Sec 27 T1S R46W	Surface

Description	Size (in)	Weight (lb/ft)	Grade	Max. Pres. (psi)	True measured depth		Capacity (bbls)	Casing Attachments and Tools	TMD (ft)
					Start (ft)	End (ft)			
Drill Pipe/Tubing	-	-	-	-	-	-	-	Guide/Float Shoe	20
Open Hole	9.88	-	-	-	kb	411.00	-	Float Collar	353.5
Casing	7.00	20.00	-	-	Kb	408.98	-	MSCC	
	-	-	-	-	-	-	-	ECP	
	-	-	-	-	-	-	-	Liner Hanger	
	-	-	-	-	-	-	-		
	-	-	-	-	-	-	-	Cementing Plug	


[illegible]

Event	Time	Pressure (psi)		Rate bbls/min	Stage Volume (bbls)	Total Volume (bbls)	Remarks	
		Tubular	Annular					
1	0:00	-	-	-	-	-	Arrive on Location - Time Requested :	13:00
2	0:00	-	-	-	-	-	Safety Meeting Held 1:30	
3	13:36	-	-	-	-	-	Pressure Test Surface Treating Lines	
4	13:37	50.0	-	2.5	1.0	1.0	Fresh H2O Ahead	
5	13:39	100.0	-	2.5	29.0	30.0	Lead Cement	
6	13:46	100.0	-	2.5	9.5	39.5	Tail cement	
7	0:00	-	-	-	-	-	Drop Plug	
8	13:52	100.0	-	1.0	15.7	55.2	Displace Plug	
9	0:00	-	-	0.0	-	-	Bump Plug 500 PSI Over	
Fluid Returns							Vol : (bbls) BBLs Returns 12bbls	


Employee	Unit #	Arrive	Depart	Travel Bonus	Bin #
Ty Pratt	200525	7/26/2010 1:10PM	7/26/10 2:20		Bin # -
Jarrold Gerbitz	740017	"	"		Bin # -
Granite Mcmartin	746075	"	"		MTS# 258118
Ron Carwin	746089	"	"		MTS# -
-	-	"	"		MTS# -

Client	Augustus Energy	Client Rep	Justin Stone	Supervisor	Ty Pratt
Ticket No.	9154251	Well Name	Round Tree 24-27	Unit No.	740017
Location	Sec 27 T1s R46w	Job Type	Surface Casing	Service District	51 Wray
Comments	Pump Fresh H2O Cement Fresh H2O				Job Date
					07/26/2010


Unit 740017 Rate Total

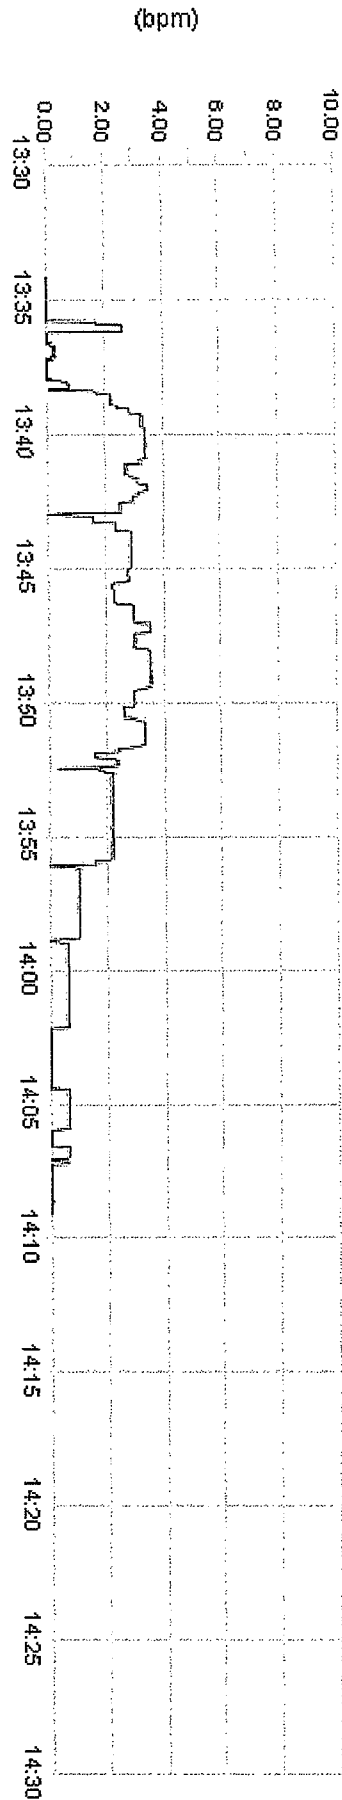

Unit 740017 Pump Pressure



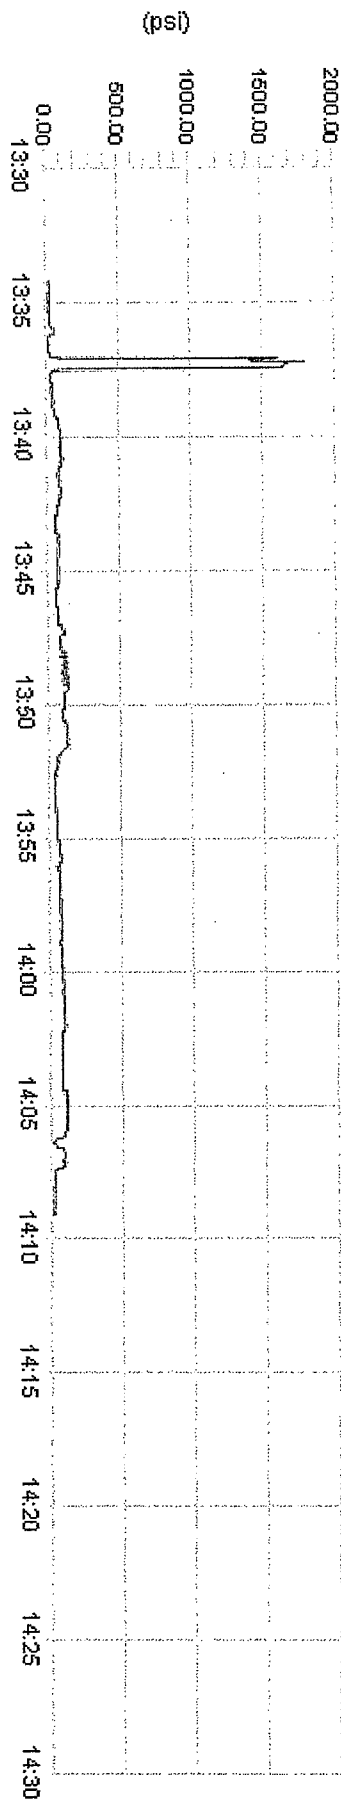


Unit 740017 Density

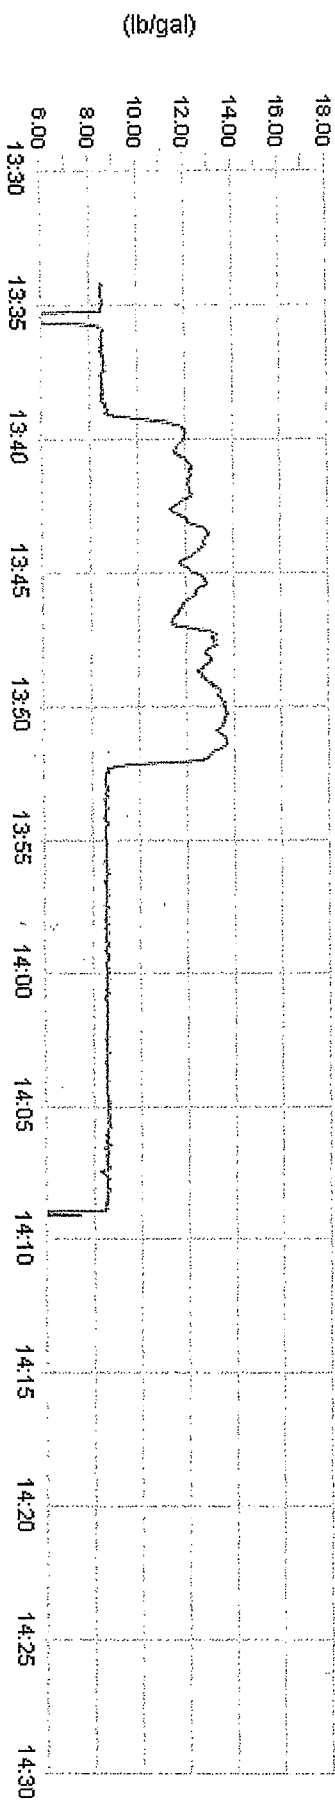



Client	Augustus Energy	Client Rep	Justin Stone	Supervisor	Ty Pratt
Ticket No.	9154251	Well Name	Round Tree 24-27	Unit No.	740017
Location	Sec 27 T1s R46w	Job Type	Surface Casing	Service District	51 Wray
Comments	Pump Fresh H2O Cement Fresh H2O				Job Date 07/26/2010

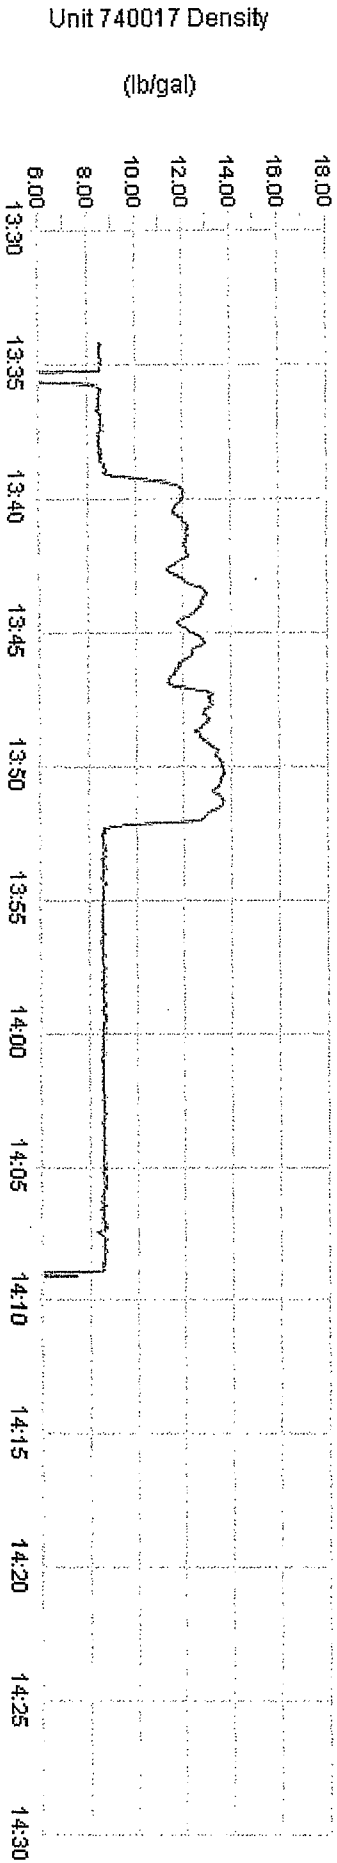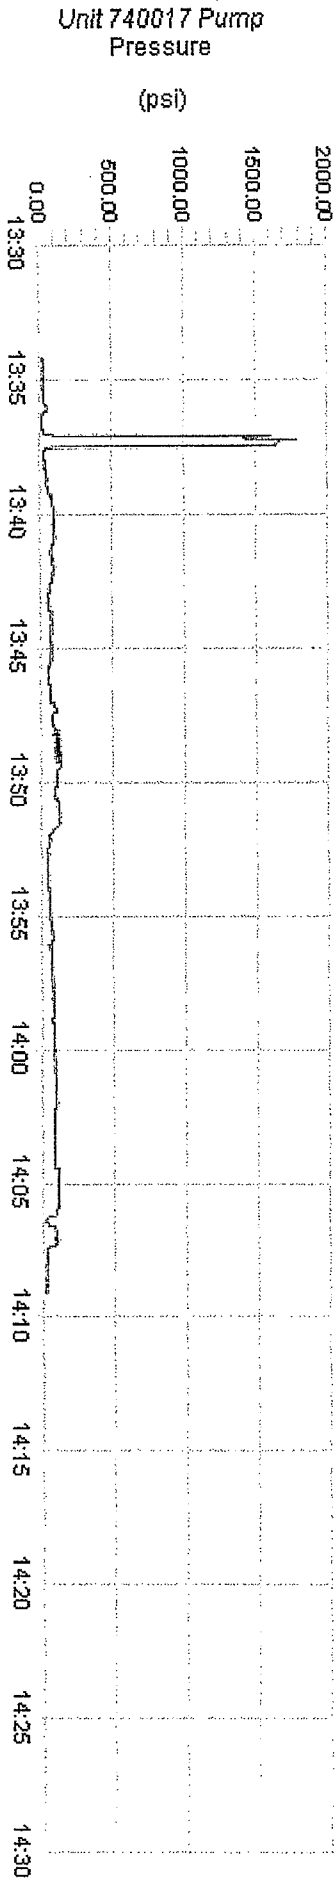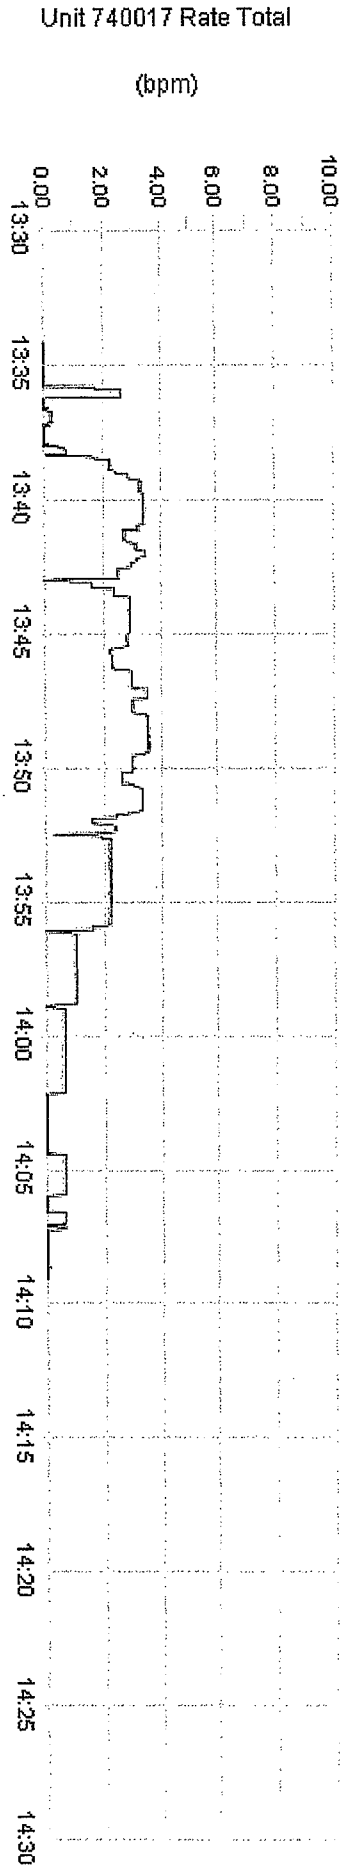



PRE-JOB SAFETY MEETING - JOB SAFETY ANALYSIS (JSA)

Customer Name: Augustus Energy Date: 7-26-10 Service Ticket No.: 9154251

Total People on Location: #12 Location: SCE

Emergency Response Plan: (muster point, emergency procedures, location of emergency shower, eyewash station, fire extinguishers, first aid kits)
Meet at Reese Entrance

How do we signal "STOP WORK"? Move hand Across throat

Safety Meeting Discussion: (Topics should include brief job scope, PPE, site specific hazards, environmental issues, people's responsibilities)
Pressure test, Rigg'n Cement Dust

Job Safety Analysis:

1. Break the job down into steps.	2. Identify the hazards associated with each step.	3. Develop ways to control the hazards.
Sequence of Basic Job Steps	Potential Hazards	Recommended Controls
Move oil to cage	Hitting someone	use ground guide
Rig in	Hammers hitting	Stay back
Pressure Test	Lines Parting	Stay back
Cement Job	Cement Dust	wear goggles
Rig out	Rig Hammer hitting	stay back
Move oil cage	Hitting someone	use ground guide
	Pressure	
	Radiation	
	Temperature Extremes	

Attendees: (Print name, and sign. If there are not enough lines use a second document from this book and enter the same Service Ticket No.)

<u>[Signature]</u>	<u>Lucas Villagar</u>	
<u>[Signature]</u>	<u>Gilberto</u>	
<u>[Signature]</u>	<u>Alfonso</u>	
<u>[Signature]</u>	<u>[Signature]</u>	
<u>[Signature]</u>		
<u>[Signature]</u>		

Customer Representative:

Justin J. Stone
 Print Name

[Signature]
 Signature

Sanjel Supervisor:

Ty V. Pratt
 Print Name

[Signature]
 Signature