

### **Compliance Needs for Black Hills wells May 2011 Inspections**

This is a written order you will not receive a letter. Actions due at various dates. Submit written notice upon completion, email is acceptable. Contact Cathy Ventling, NRS BLM Grand Junction 970-244-3009, [cventling@blm.gov](mailto:cventling@blm.gov) if you have any questions.

**Emailed to Jessica Donahue 05/23/11**

Black Hills, lease COC22504, well Fed 6-2, CLV May 3, 2010

Facilities onsite: 1-WH-rail fenced, 1-Ca tower, no production equipment. Tire and plastic tank

Condition: Pad not apparently re-contoured for IR. Needs paint.

Compliance Needed:

- Paint all permanent equipment BLM Standard Environmental Color Yuma or Beetle, in a non-reflective finish. Due July 30, 2011
- Remove all unused materials/equipment and trash to appropriate storage or disposal facility. Due July 30, 2011

**Order CLV2011013- email**

**Black Hills, lease COC64824, well Bronco Flats 7-7, CLV May 3, 2010**

Facilities onsite: 1-WH-rail fenced, 1-sep, 1- MH, 1-PW pit w. tank sunken in pit.

Condition: Reveg is coming in ok for now, watch for weeds they might decrease success. Pipeline looks good. Road is good, has cow pocking, but dewater structures and culverts are armored well.

Compliance Needed:

None

**Black Hills, lease COC64824, well Bronco Flats 7-5, CLV May 3, 2010**


Facilities onsite: 1-WH-rail fenced, 1-sep, 1- MH, 1-200bbl tank in pit w/ fence, 1-com tower? (photo).

Condition: Reveg is coming in but still lots of cheatgrass in reclamation and also in undisturbed areas, watch for weeds they might decrease success. Tank has staining, previous orders for this cleaning CLV2010 has not occurred.

Compliance Needed:

- Please identify the tower on this pad, its purpose and function. Due 05/30/11
- Advise to status for cleanup of tank and oil-stained soil/gravel from order #CLV2010080. Due 05/30/11

**Order CLV2011014-email**

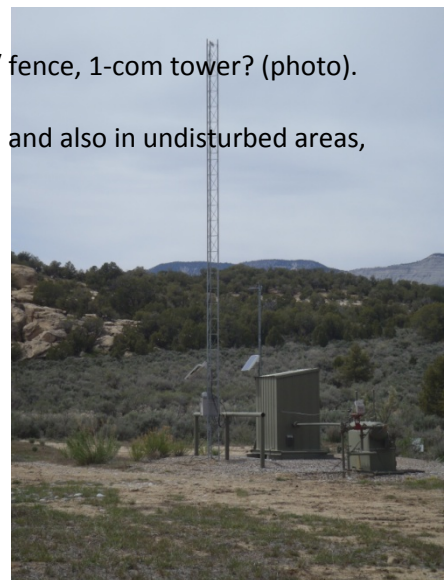

**Black Hills, lease COC46161, well Wagon Track 12-16, CLV May 3, 2010**

Facilities onsite: 1-WH-, 1HT w/ cone, 1- MH, 1-300bbl tank sunken in pit and fenced.

Condition: Good ryegrass, western wheatgrass, crested wheat, globemallow. Weeds-cheatgrass and pepperweed.

Compliance Needed:  
None

**Black Hills, lease COC46161, well Wagon Track 12-14, CLV May 3, 2010**

Facilities onsite: 1-WH rail fenced-, 1HT w/ cone, 1- MH, 1-300bbl tank sunken in pit and loosely fenced.

Condition: Tank containment pit is breached. Driving surface of pad is ponding and rutted-could slope to move water off surface into established vegetation between tank and well head. Some seeded grass, rabbitbrush, GUSA, slender wheat. Weeds- cheat, pepperweed, various annuals. Paint is good.

Compliance Needed:

- Rebuild or install tank/pit berms/containment to standard: Containment shall hold 110% of the capacity the largest single tank it contains and be impervious to any oil, glycol, produced water, or other toxic fluid for 72 hours. Earthen berms must be compacted and of fine material that will prevent seepage of any spill to surrounding area. Due July 30,2011 ::: PREVIOUSLY ORDERED # CLV2010066
- Maintain driving surface of pad, if necessary install storm water measures (grading/sloping, sediment basins) to control erosion and sediment transport and keep water off running surface. Due July 30,2011

**Order CLV2011015-email**

**Black Hills, lease COC46161, well Wagon Track 12-8, CLV May 3, 2010**

Facilities onsite: 1-WH rail fenced-, 1- MH, 1-300bbl tank sunken in pit and fenced-rusted with liquids in pit (photo)

Condition: Tank containment pit has a lot of liquids. Tank is severely rusted with several visible holes. This is potentially a leak. Other tank pits in this area are completely dry. Sign is behind Meter House. Veg is good crested 4wing shadscale. Road is cow pocked.

Compliance Needed:

- Well is not easily seen from a distance. Well and facility identification (3162.6): Every well within a Federal lease or supervised agreement shall have a well identification sign. All signs shall be maintained in a legible condition. **Due May 30, 2011**

- Replace tank. Report leak to all agencies, remove water and contaminated soils, and perform testing in accordance with COGCC 910 Series Rules. Provide testing data to BLM upon completion. **Soil Testing Due May 27, 2011. Final clean up Due August 1, 2011.**

**Order CLV2011016- email**



**Black Hills, lease COC46161, well Wagon Track 12-6, CLV May 3, 2010**

Facilities onsite: 1-WH-rail fenced, 1- sep, 1- MH, 1-300bbl tank sunken in pit and fenced.

Condition: Tank containment pit has liquids. Tank is rusted (photos). This is potentially a leak. Other tank pits in this area are completely dry (now 2 of several in area have liquid). Pad is relatively close to a large drainage. Access road has gullies.

Compliance Needed:

- Replace tank. Report leak to all agencies, remove water and contaminated soils, and perform testing in accordance with COGCC 910 Series Rules. Provide testing data to BLM upon completion. **Soil Testing Due May 30, 2011. Final clean up Due August 1, 2011.**
- Maintain access road and Storm Water/ Erosion Control structures including water dips or culverts. Armor water outlets to prevent erosion and head-cutting. Maintain to BLM Gold Book guidelines. **Due July 30, 2011**

**Order CLV2011017- email**

