

**Rangely C-4 SITREP**  
**March 12, 2017**

Spill Status	
<b>Source Status:</b>	SECURED

**Today's Field Operations:**

- Scrape top layer of contaminated soil in Division 1. Load recovered soil into dump truck to take to land farm.
- Conduct brooming operations of liquid in Divisions 2 and 3.
- Water washing operations in Division 2 and 3.
- Decontamination stations established and working in Divisions 1, 2, and 3.
- Monitor and repair, as needed, deployed wildlife deterrents.

**Summary of Previous Day:**

Recovered Materials					
Type	Since Last Report		Cumulative Recovered		UOM
	Recovered	Disposed	Recovered	Disposed	
Oily Liquid	36		2,839		bbls
Solid		140		870	y <sup>3</sup>

Wildlife Impacts						
Type	Captured	Cleaned	Released	DOA	Died in Facility	
					Euth.	Other
Birds				2		2
Mammal				1		
Reptile						
Fish						
Other						

**Rangely C-4**  
**Rangely, Colorado**

Environmental Unit

Version 1

March 11, 2017

Page 1 of 1

**DAILY SCAT REPORT**

SCAT re-surveyed from 1-000 through 1-1350 (beginning to end of Division 1) and 2-000 through 2-950 (beginning to end of Division 2) to assess the segments following implemented treatments. SCAT re-surveyed a total of ~2,300 feet of stream corridor.

General status of oiling observations at the Rangely C-4 site to-date includes the following:

SCAT Divisions	Oil Distribution*	Thickness	Oil Type*	Oil Area Width*	% Cleaned	Cleanup Actions Taken to Date	Comments
1	NOO, Trace, Patchy, Sporadic	CT	Fresh oil	Wide and Medium	~85%	broom crews, trash pumps, vac trucks, excavation	Scraping had occurred to ~SCAT segment 1-1350 as of 1445, 3/11/17. Sporadic oiling observed in scraped areas.
2	Broken and Continuous	TO/CV	Fresh oil	Wide and Medium	~25%	broom crews, trash pumps, vac trucks, hot water flushing	More oil recovered in this Division compared to yesterday.
3	Continuous	TO/CV	Fresh oil	Wide, medium and narrow	Undetermined	drip trap, siphon, broom crews, hot water flushing	Broom crews or flushing have been deployed.
4	NA	NA	NA	NA	NA	NA	---
<small>*SCAT terminology is based on the standards and guidelines provided by NOAA in the document: <a href="http://response.restoration.noaa.gov/sites/default/files/manual_shore_assess_aug2013.pdf">http://response.restoration.noaa.gov/sites/default/files/manual_shore_assess_aug2013.pdf</a></small>							

Prepared By: Bruce Jones

Date Approved: 3/11/17



# Rangely C-4 Incident Picture Reporting - Overview Map

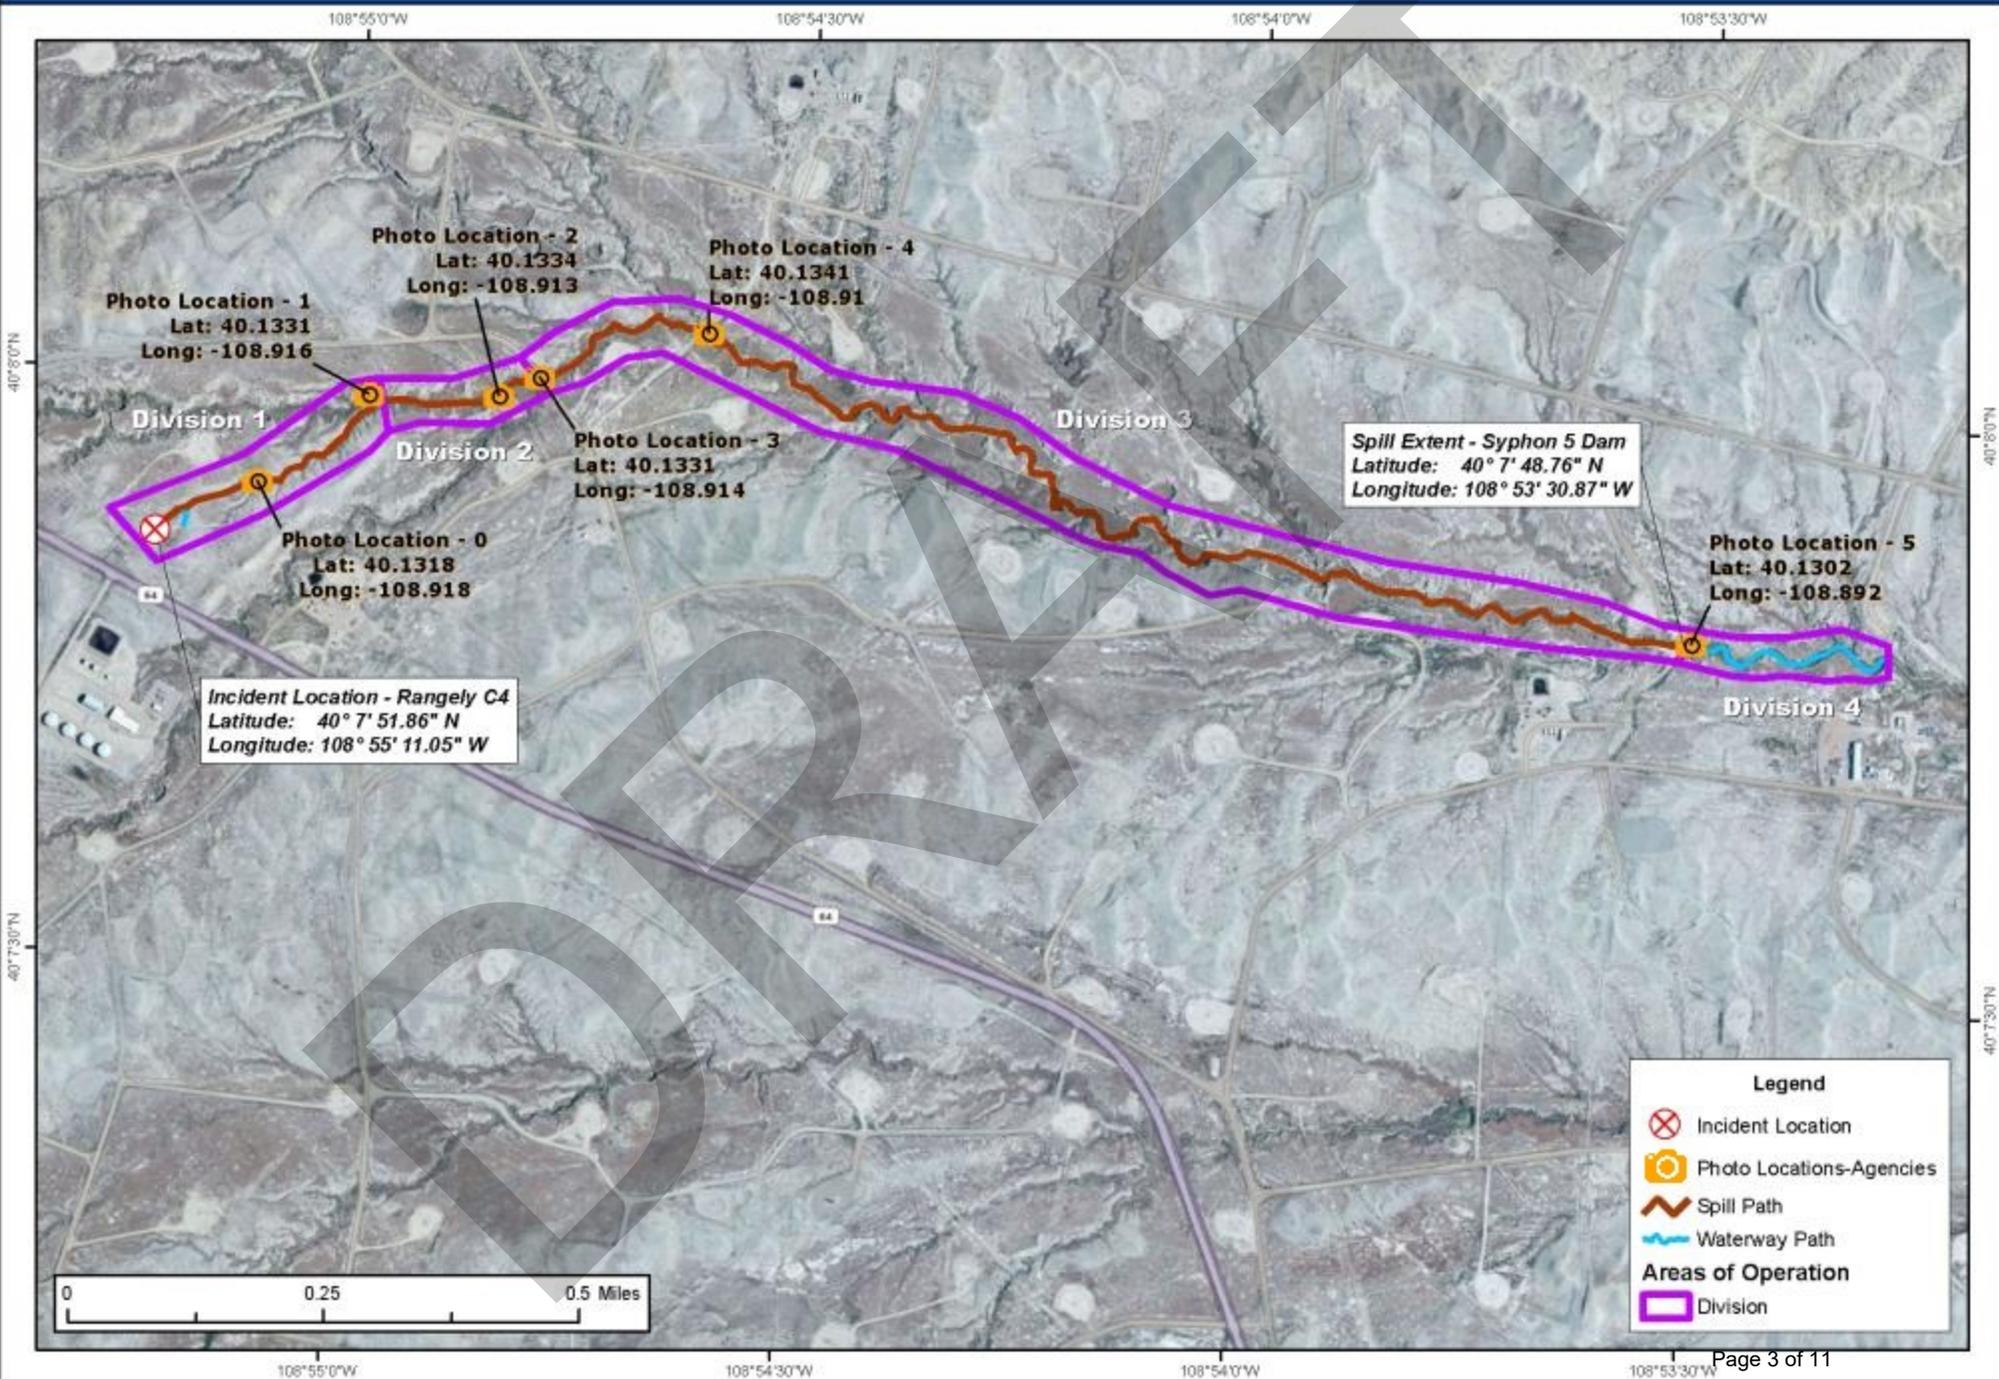


Photo Location 0  
Upstream



Photo Location 0  
Middle



Photo Location 0  
Downstream



03.11.2017 14:08

Photo Location 1  
Upstream



03.11.2017 14:42

Photo Location 1  
Middle



Photo Location 1  
Downstream



Photo Location 2  
Upstream



Photo Location 2  
Middle



Photo Location 2  
Downstream



Photo Location 3  
Downstream



Photo Location 4  
Upstream



Photo Location 4  
Middle



Photo Location 4  
Downstream



Photo Location 5  
Upstream



Photo Location 5  
Downstream



DRY