

**Rangely C-4 SITREP**  
**March 18, 2017**

Spill Status	
<b>Source Status:</b>	SECURED

**Today's Field Operations:**

- Scrape or shovel contaminated soil in Division 1. Load recovered soil into dump trucks then transfer to land farm.
- Conduct brooming and water washing operations in Division 3.
- Conduct collection operations in Division 3.
- Personnel and equipment decontamination stations established and working in Divisions 2 and 3.
- Deployed wildlife deterrents at Drip Trap 18 per BLM request.
- Monitor and repair deployed wildlife deterrents, as needed.

**Summary of Previous Day:**

Materials of Interest			
Material	Daily	Cumulative	UOM
Introduced Water for Flushing	960	6,840	bbl
Recovered Oily Liquid	1,060	9,923	bbl
Disposed Soil	65.5	1,805.50	y <sup>3</sup>

Wildlife Impacts						
Type	Captured	Cleaned	Released	DOA	Died in Facility	
					Euth.	Other
Bird				2		2
Mammal				6		
Reptile						
Fish						
Other						

**Rangely C-4**  
**Rangely, Colorado**

Environmental  
Unit

Version 1

March 17, 2017

Page 1 of 1

**DAILY SCAT REPORT**

SCAT re-surveyed Division 1 from 0 to 1,300 feet, Division 2 from 0 to 900 feet, and Division 3 from 200 to 7,550 feet to assess the segments following implemented treatments. SCAT re-surveyed a total of ~9,550 feet within the dry drainage feature corridor.

General status of oiling observations at the Rangely C-4 site to-date includes the following:

SCAT Divisions	Oil Distribution*	Thickness	Oil Type*	Oil Area Width*	% Cleaned	Cleanup Actions Taken to Date	Comments
1	NOO, Trace, Patchy	CT	Fresh oil	Narrow and Wide	~97%	broom and hand tool crews, trash pumps, vac trucks, scraping	A crew using mechanical equipment and a second crew with hand tools.
2	Patchy	CT	Fresh oil	Very Narrow	~98%	broom and hand tool crews, trash pumps, scraping, vac trucks, hot water flushing	One team of mechanical operations performing scraping. Recommend continued hand tool crew operations in remaining areas.
3	Sporadic, Patchy	CV/CT	Fresh oil	Very Narrow and Narrow	~90%	drip trap, siphon, broom and hand tool crews, broom crews, hot water flushing	Broom crews, hot water flushing, and vac truck operations occurred. Recommend continued hand tool crew and vac truck operations in remaining areas.
4	NOO	NA	NA	NA	NA	NA	No oil observed

\*SCAT terminology is based on the standards and guidelines provided by NOAA in the document:  
[http://response.restoration.noaa.gov/sites/default/files/manual\\_shore\\_assess\\_aug2013.pdf](http://response.restoration.noaa.gov/sites/default/files/manual_shore_assess_aug2013.pdf)

Prepared By: Daniel Nein

Date Approved: 3/17/17



# Rangely C-4 Incident Picture Reporting - Overview Map

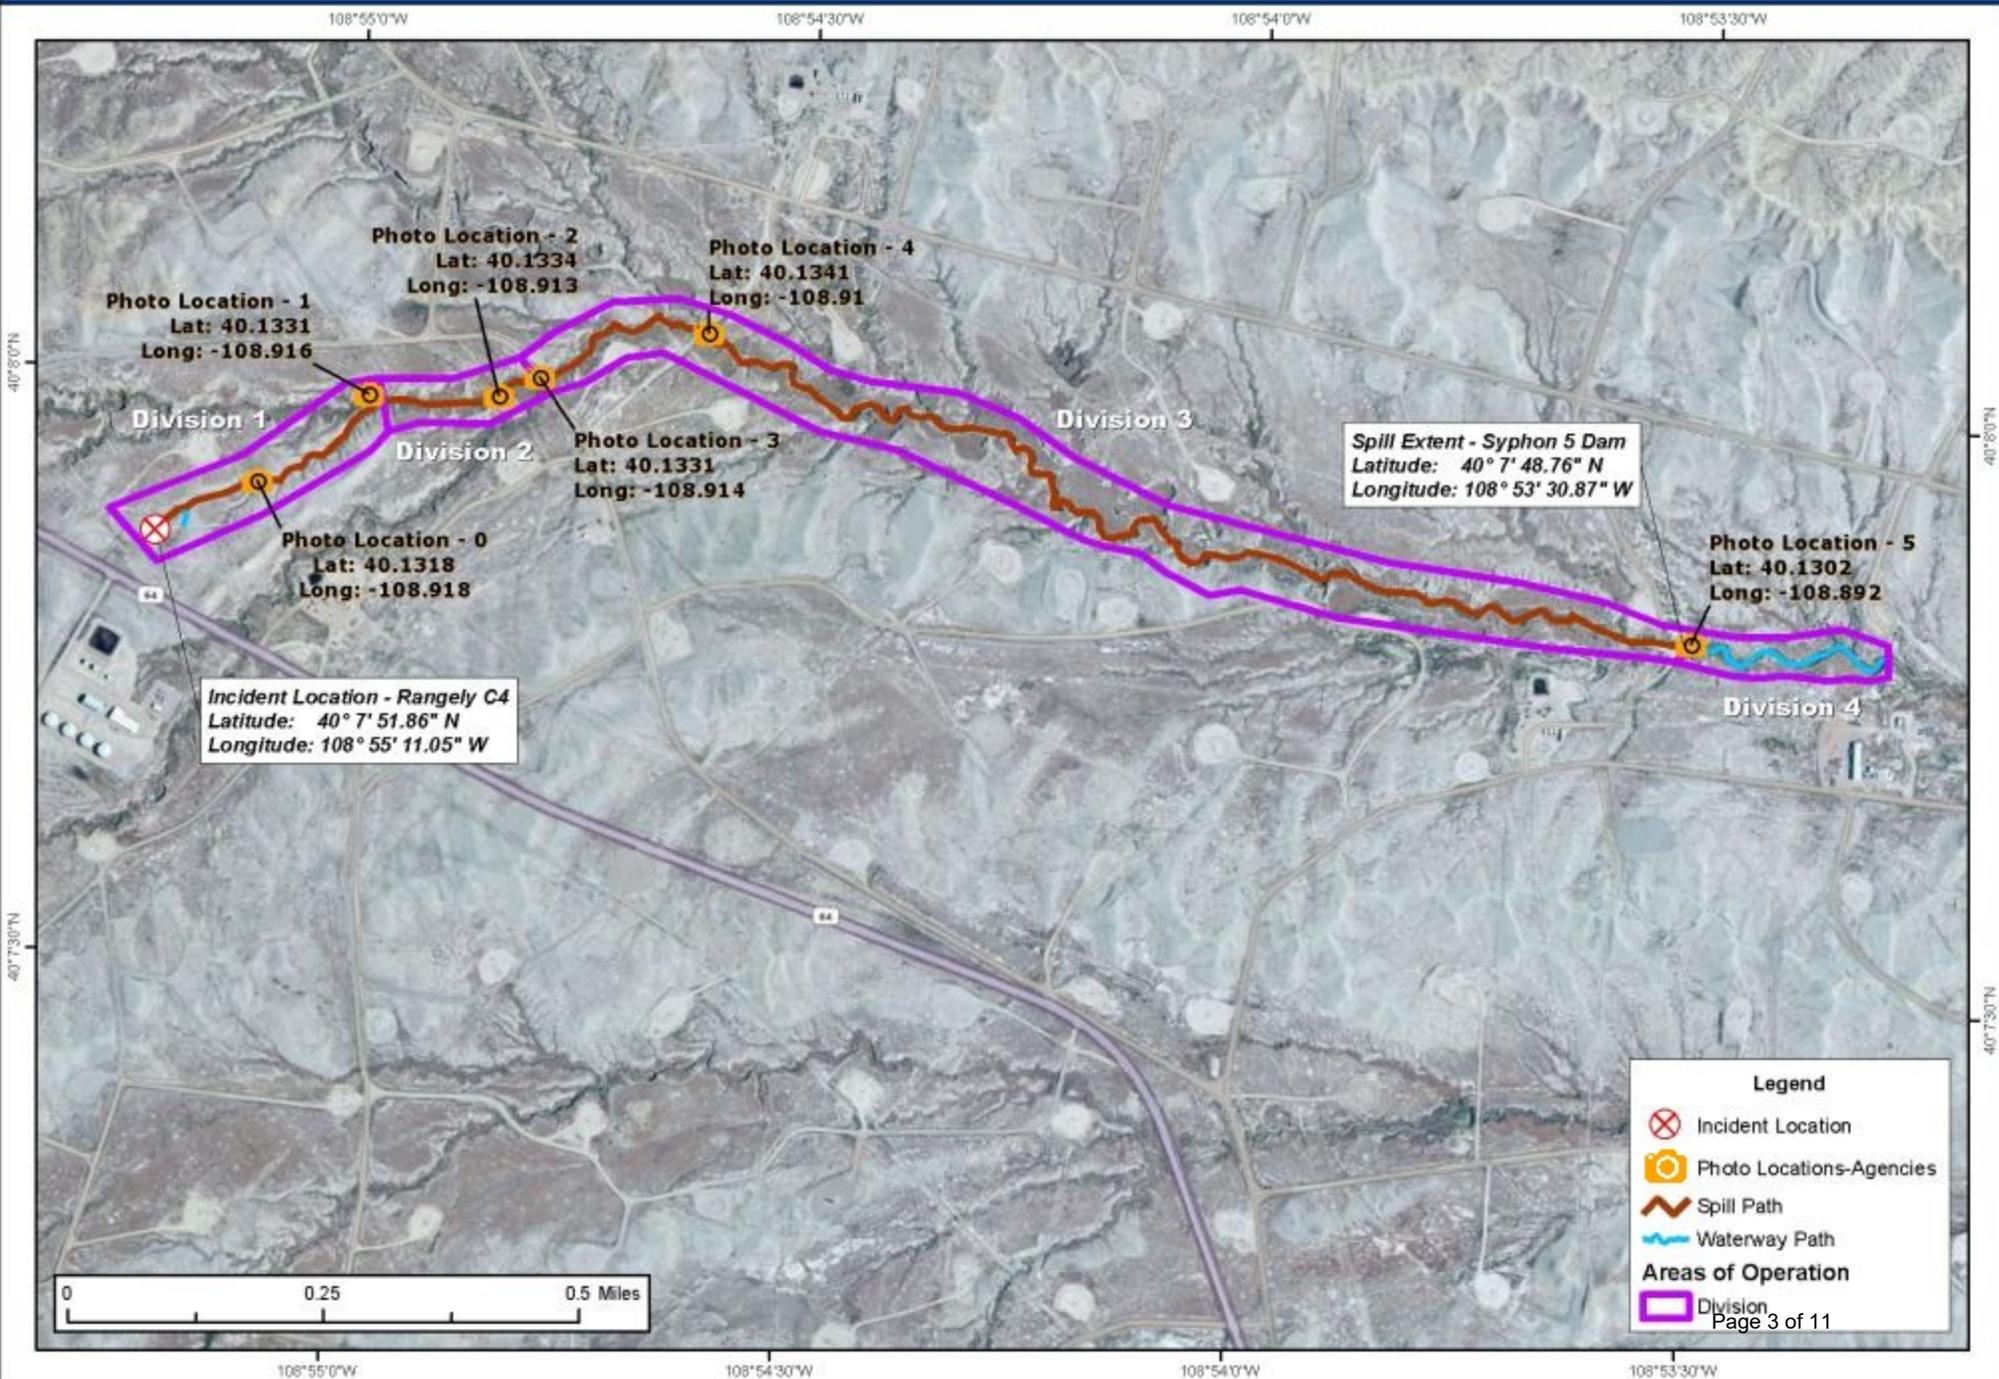


Photo Location 0  
Upstream



Photo Location 0  
Middle



Photo Location 0  
Downstream



03.17.2017 14:33

Photo Location 1  
Upstream



03.17.2017 14:41

Photo Location 1  
Middle



Photo Location 1  
Downstream



Photo Location 2  
Upstream



Photo Location 2  
Middle



Photo Location 2  
Downstream



Photo Location 3  
Downstream



Photo Location 4  
Upstream



Photo Location 4  
Middle



Photo Location 4  
Downstream



Photo Location 5  
Upstream



Photo Location 5  
Downstream

