


Location Map:



MW14R2

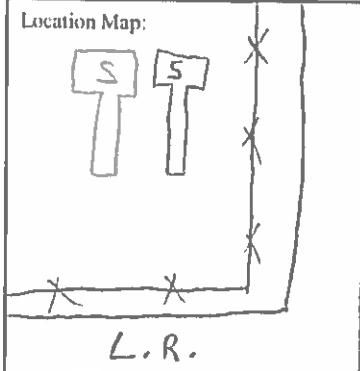

Compliance • Engineering • Remediation
 LT Environmental, Inc.
 4600 W. 60th Avenue
 Arvada, Colorado 80003

BORING LOG/MONITORING WELL COMPLETION DIAGRAM

Boring/Well Number: MW14R2	Project: Edwards William J GU #1		
Date: 6/14/2013	Project Number: KMG6224		
Logged By: Jeremy Espinoza	Drilled By: ACI		
Drilling Method: Direct Push	Sampling Method: Direct Push		
Seal: Bentonite Crumbles	Grout: None		
Diameter: 1"	Length:	Hole Diameter: 3"	Depth to Liquid: —
Diameter: 1"	Length:	Total Depth:	Depth to Water: 26'

Penetration Resistance	Moisture Content	Vapor (ppm)	Staining	Sample #	Depth (ft. bgs.)	Sample Run	Soil/Rock Type	Lithology/Remarks	Well Completion
	Dry	0.0	None	NA	0			0-8' Sandy clay, light brown, dry, no stain, no odor, mod plasticity, mod cohesion	
		0.0			2				
		0.0			4				
		0.0			6				
	moist	0.0			8			8'-13' Clayey silt, light brown to orange, moist, no stain, no odor, low cohesion, low plasticity	
		0.0			10				
		0.0			12				
		0.0			14				
		0.0			16			13'-22' Clay, orange, moist, no stain, no odor, low cohesion, mod plasticity	
		0.0			18				
		0.0			20				
		0.0			22			22'-30' Silt, orange, moist, no stain, no odor	
		0.0			24				
	wet	0.0			26			- wet at 26'	
		0.0			28				
		0.0			30				