



4.5" Ann Fill

## Cement Post Job Report

Prepared For: Mr. Luke Hinrichs  
Prepared Date: 4/18/2018  
Job Date: 4/15/2018

**Extraction Oil and Gas**

**Graeber 33-33DX**

**Weld County, CO**

Prepared By: Adam DeSaules  
Phone: (432) 215-6693  
Email: adam.desaules@cjes.com



# Job Summary

Ticket Number	Ticket Date
TN# FL3576	4/15/2018

COUNTY	COMPANY	API Number
Weld	Extraction Oil and Gas	05-123-23837
WELL NAME	RIG	JOB TYPE
Graeber 33-33DX		Ann Fill
SURFACE WELL LOCATION	O-TEX Field Supervisor	CUSTOMER REP
SENE 33-1N-68W	Scott, Derek	Jay Pape

EMPLOYEES		
Peterson, Ryan		
Peterson, Roger		
	Hagemeyer, Tony	

<b>WELL PROFILE</b>			
Max Treating Pressure (psi):	2000	Bottom Hole Static Temperature (°F):	0
Bottom Hole Circulating Temperature (°F):		Well Type:	Oil

### Open Hole

1	Size (in)	TMD From (ft)	TMD to (ft)	TVD From (Ft)	TVD to (Ft)
	7.87	1119	1323		
2	Size (in)	TMD From (ft)	TMD to (ft)	TVD From (Ft)	TVD to (Ft)

### Casing/Tubing/Drill Pipe

Type	Size (in)	Weight (lb/ft)	Grade	TMD From (ft)	TMD to (ft)	TVD From (Ft)	TVD to (Ft)
Surface	8.625	24		0	1119		
Type	Size (in)	Weight (lb/ft)	Grade	TMD From (ft)	TMD to (ft)	TVD From (Ft)	TVD to (Ft)
Production	4.5	11.6		0	1323		
Type	Size (in)	Weight (lb/ft)	Grade	TMD From (ft)	TMD to (ft)	TVD From (Ft)	TVD to (Ft)
Tubing	1.25	3.02		0	1320		

### CEMENT DATA

<b>Stage 1:</b>	From Depth (ft):	710	To Depth (ft):	1323
Type: <b>Ann Fill</b>	Volume (sacks):	105	Volume (bbls):	26

Cement & Additives:	Density (ppg)	Yield (ft <sup>3</sup> /sk)	Water Req.
100% Migraseal	14.6	1.38	6.62

### SUMMARY

Preflushes:	10 bbls of SAPP	Calculated Displacement (bbl):	0.75	Stage 1	Stage 2
	6 bbls of Fresh Water	Actual Displacement (bbl):	0.8		
	_____ bbls of _____	Plug Bump (Y/N):	N/A	Bump Pressure (psi):	N/A
Total Preflush/Spacer Volume (bbl):	16	Lost Returns (Y/N):	N	(if Y, when)	
Total Slurry Volume (bbl):	26				
Total Fluid Pumped	42.8				
Returns to Surface:	0 bbls				

Job Notes (fluids pumped / procedures / tools / etc.):

Customer Representative Signature: \_\_\_\_\_

**Thank You For Using  
O-TEX Cementing**






Client Crestone Peak  
Ticket No. 3586  
Location  
Comments See job log


Client Rep Dale Soderstrom  
Well Name Jolly Roger 1  
Job Type Abandonment Plugs

Supervisor Izzy Davila  
Unit No. 445024  
Service District Brighton  
Job Date 04/16/2018

Unit 445024 Rate Total

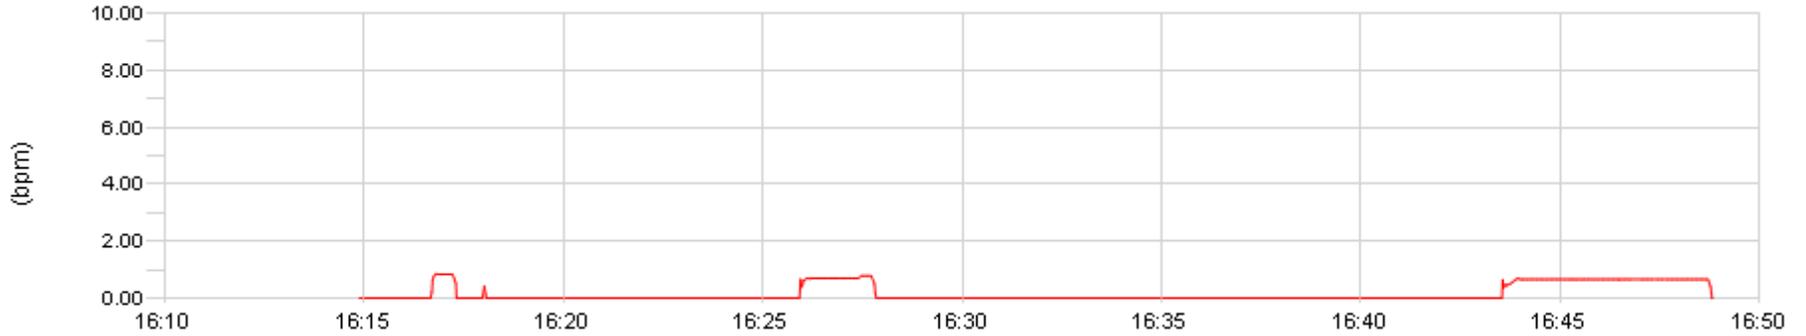

Unit 445024 Pump Pressure

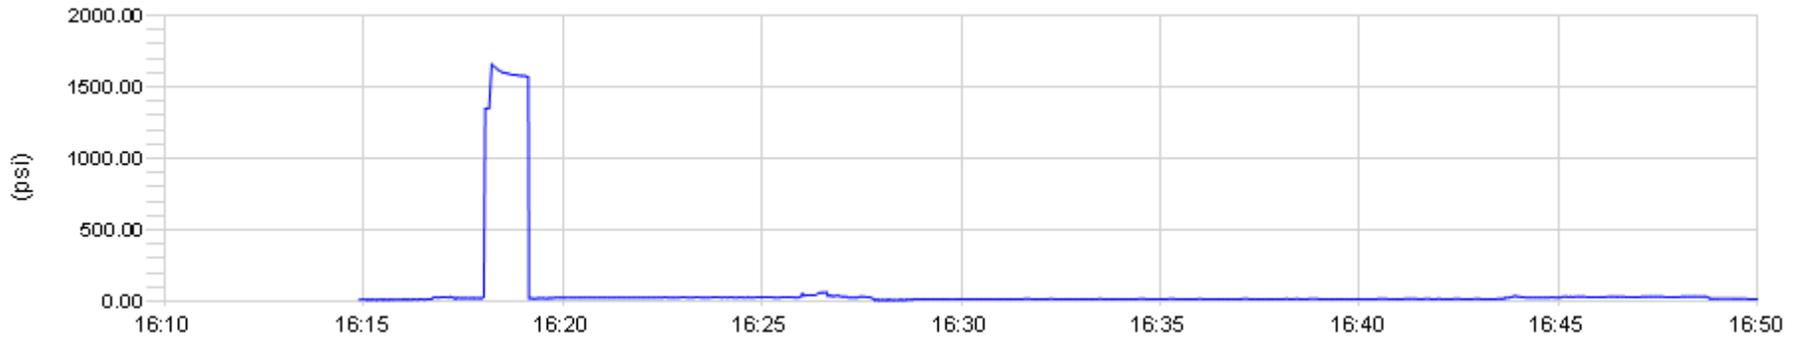

Unit 445024 Density

