


**Well** Quarter Circle 24-7hz  
**Field** Wattenburg  
**Engineer** Caleb Baldwin  
**Country** United States


**Client** Anadarko  
**SIR No.** DYN2-00282  
**Job Type** 5.5"  
**Job Date** 06-03-2018

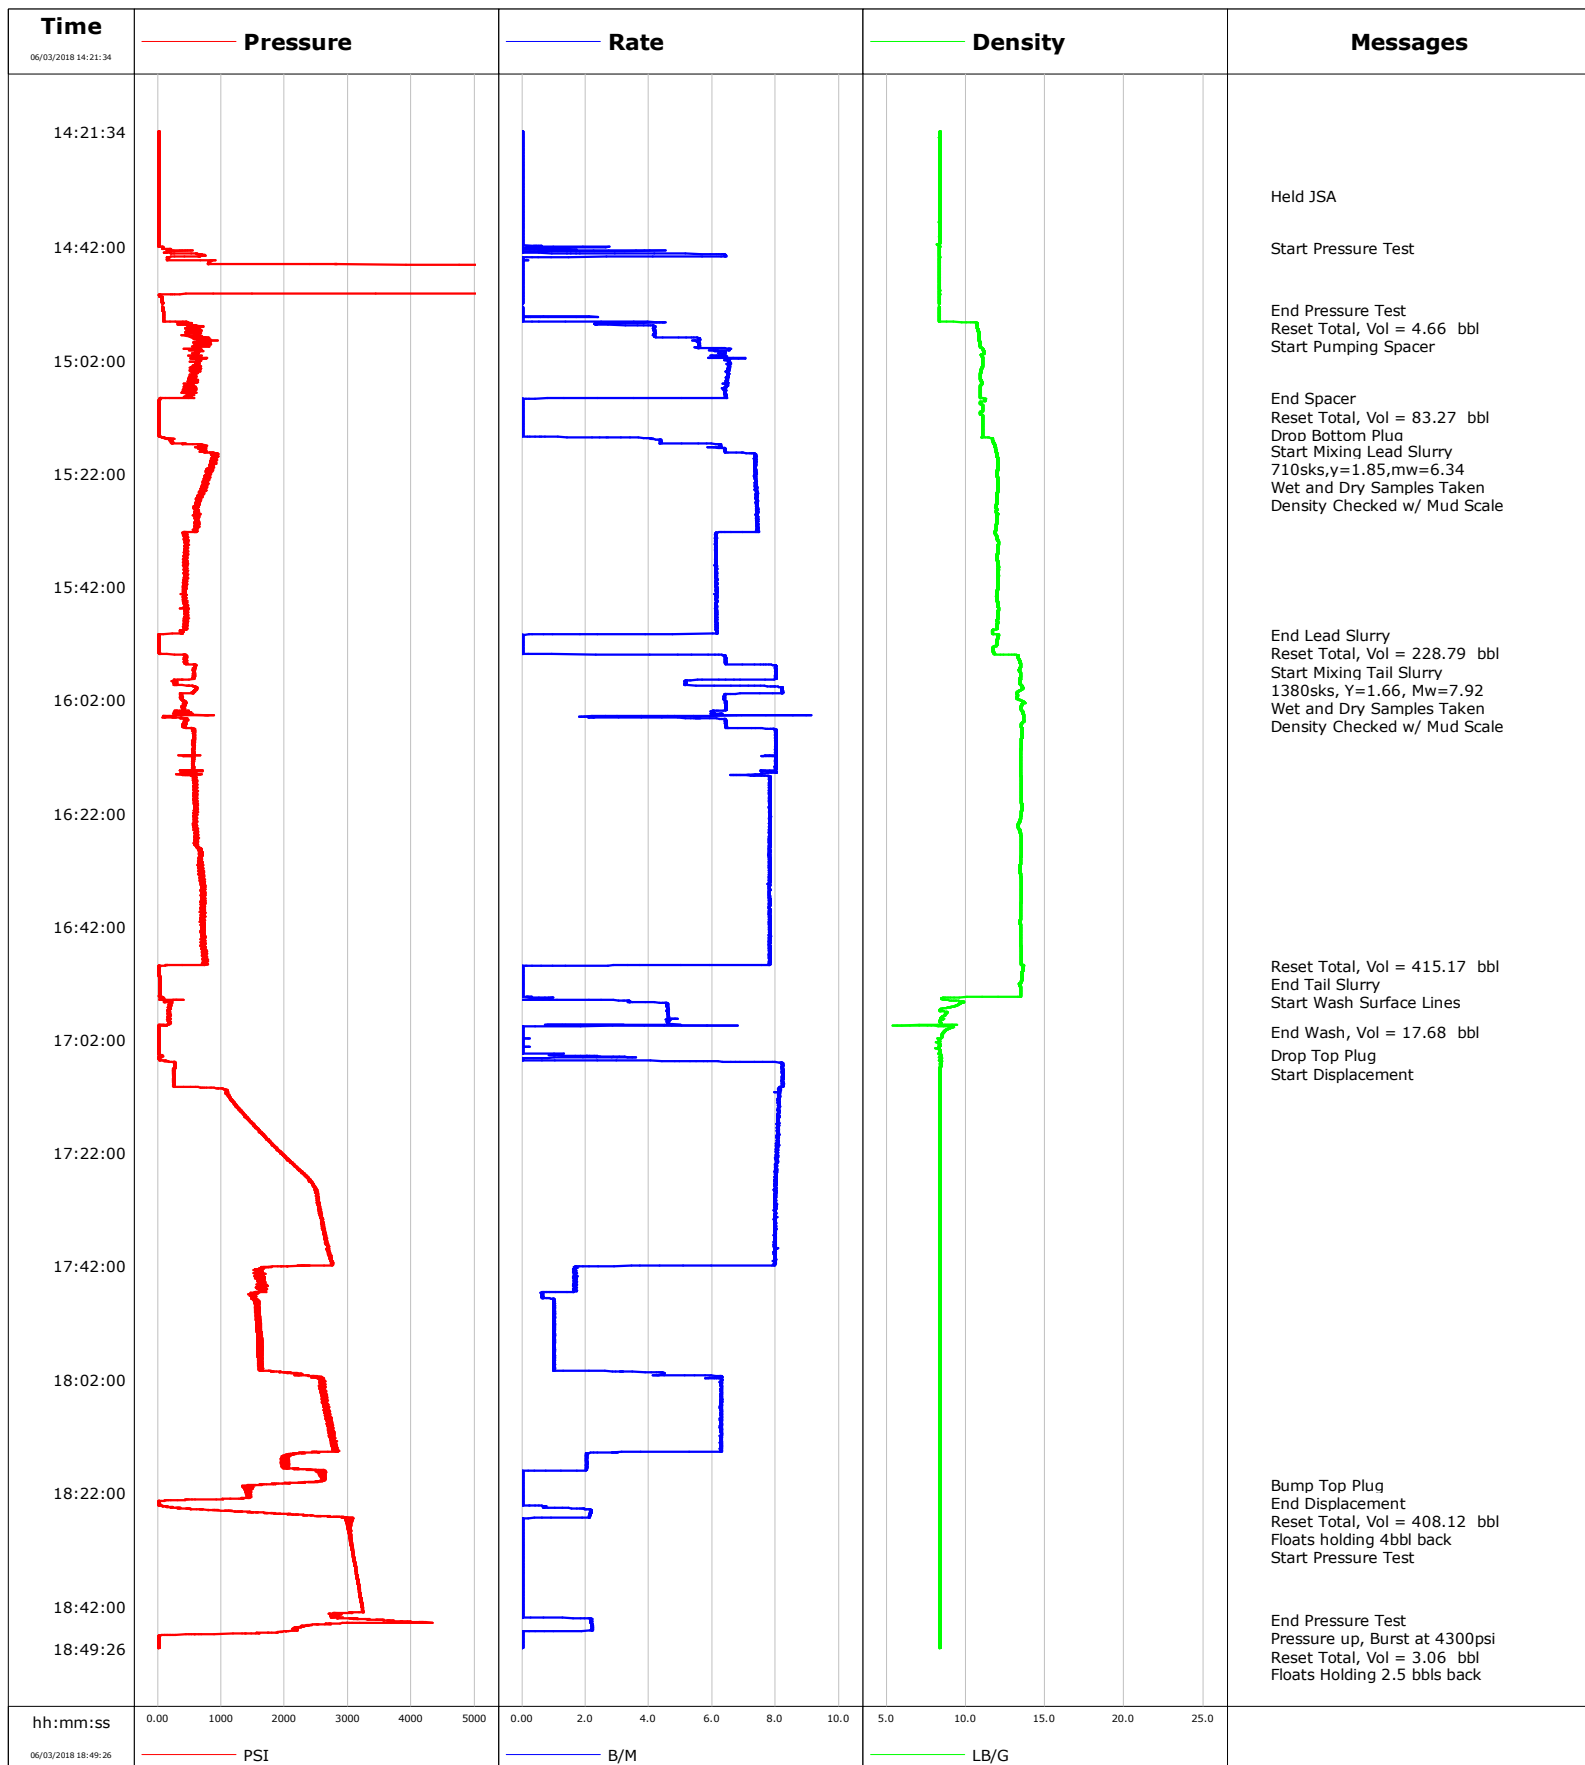


**Well** Quarter Circle 24-7hz  
**Field** Wattenburg  
**Engineer** Caleb Baldwin  
**Country** United States

**Client** Anadarko  
**SIR No.** DYN2-00282  
**Job Type** 5.5"  
**Job Date** 06-03-2018

**Lead Slurry - 06/03/2018 15:17:52 to 06/03/2018 15:50:28**

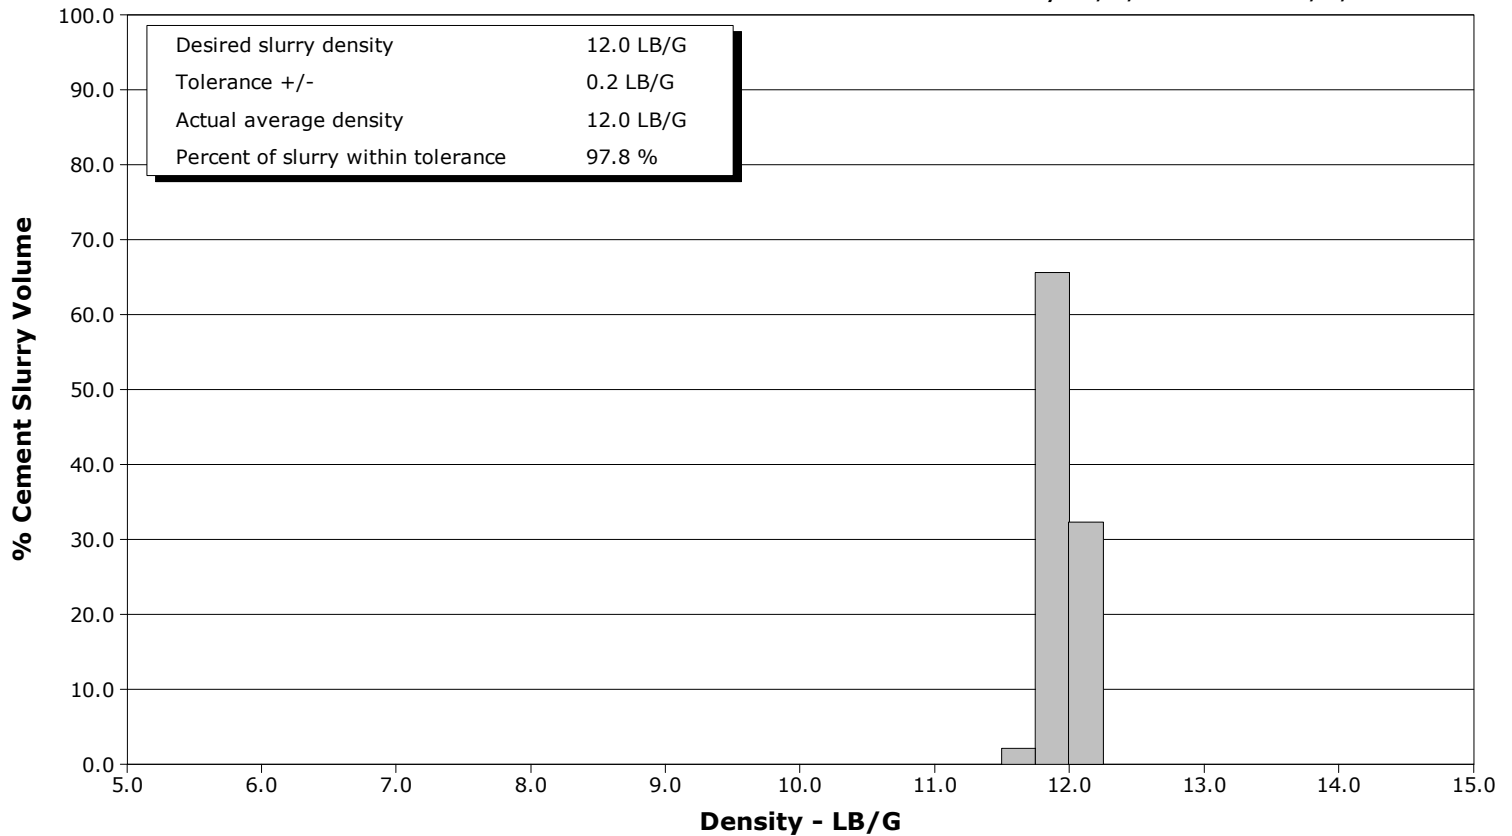

**Tail Slurry - 06/03/2018 15:55:52 to 06/03/2018 16:48:58**

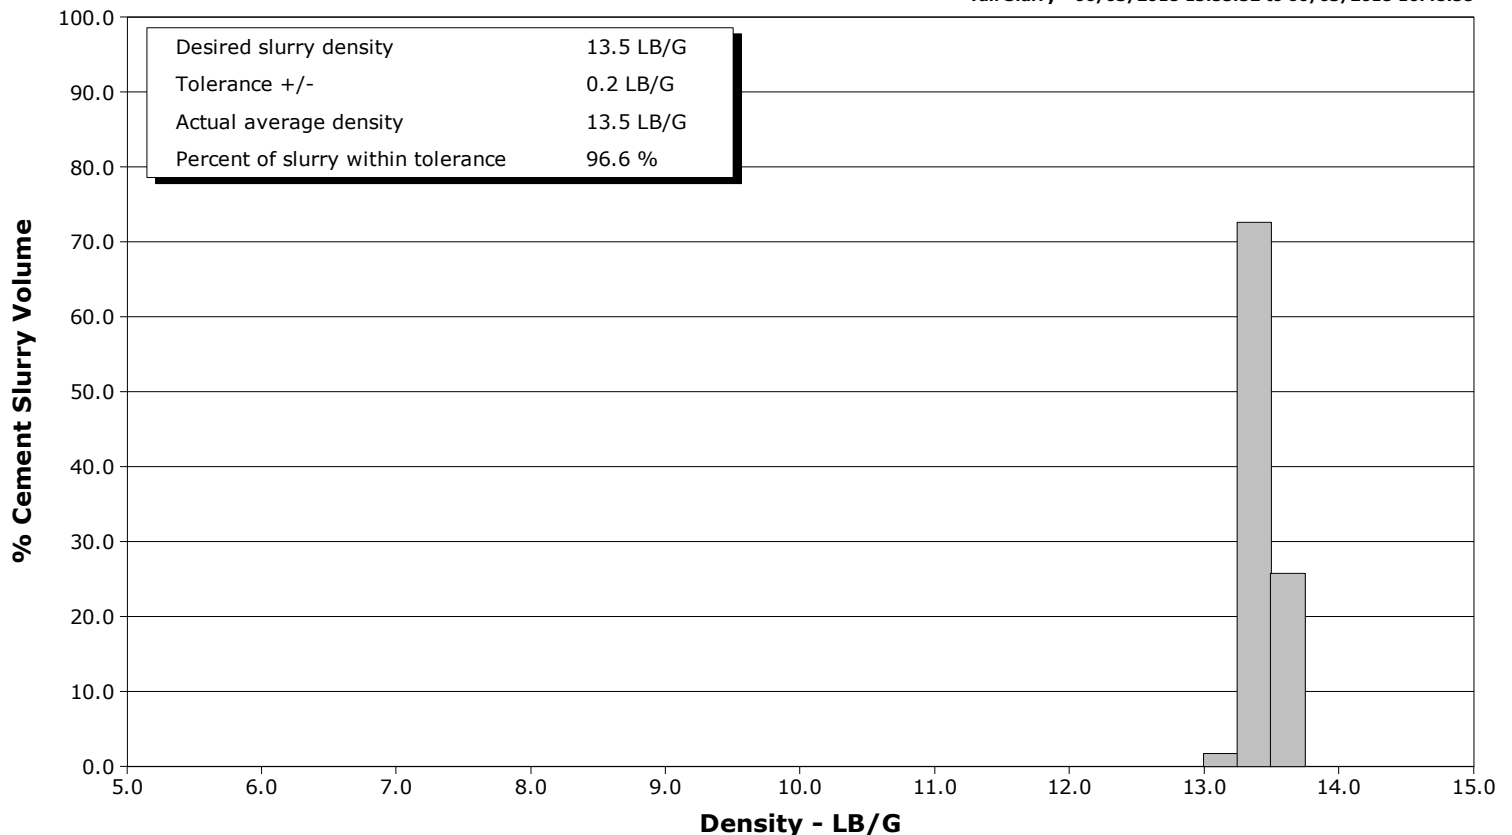

Page 1 of 2

Well Quarter Circle 24-7hz			Field Wattenburg		Job Start Jun/03/2018	Customer Anadarko	Job Number DYN2-00282
Date	Time 24-hr clock	Treating Pressure PSI	Flow Rate B/M	Density LB/G	Volume BBL	Message	
06/03/2018	17:00:33	15	0.0	8.61	20.7	End Wash, Vol = 17.68 bbl	
06/03/2018	17:04:40	31	0.9	8.44	0.2	Drop Top Plug	
06/03/2018	17:04:41	50	1.0	8.44	0.2	Start Displacement	
06/03/2018	18:20:27	1829	0.0	8.37	408.1	Bump Top Plug	
06/03/2018	18:20:31	1607	0.0	8.37	408.1	End Displacement	
06/03/2018	18:20:35	1518	0.0	8.36	408.1	Reset Total, Vol = 408.12 bbl	
06/03/2018	18:24:27	158	0.7	8.37	0.1	Floats holding 4bbl back	
06/03/2018	18:26:57	3052	0.0	8.36	3.9	Start Pressure Test	
06/03/2018	18:44:22	3311	2.2	8.36	4.6	End Pressure Test	
06/03/2018	18:44:50	4182	2.2	8.36	5.6	Pressure up, Burst at 4300psi	
06/03/2018	18:46:37	1901	0.0	8.36	3.1	Reset Total, Vol = 3.06 bbl	
06/03/2018	18:47:26	22	0.0	8.36	0.0	Floats Holding 2.5 bbls back	

### Post Job Summary

Average Pump Rates, bbl/min					Volume of Fluid Injected, bbl							
Slurry 6.2	N2	Mud	Maximum Rate 9.1	Total Slurry 0.0	Mud 0.0	Spacer 0.0	N2					
Treating Pressure Summary, psi					Breakdown Fluid							
Maximum 6002	Final 23	Average 1163	Bump Plug to	Breakdown	Type	Volume bbl	Density lb/gal					
Avg. N2 Percent %	Designed Slurry Volume 0.0 bbl	Displacement 0.0 bbl	Mix Water Temp degF	Cement Circulated to Surface?		Volume bbl						
				Washed Thru Perfs		To ft						
Customer or Authorized Representative			Schlumberger Supervisor Caleb Baldwin			Circulation Lost	Job Completed					
						-	-					