




99999999

RADO OIL AND GAS CONSERVATION COMMISSION SUNDRY NOTICES AND REPORTS OF WELLS

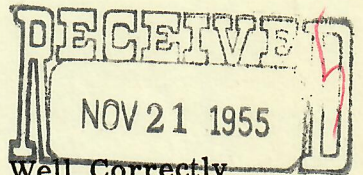

(Indicate nature of data by checking below)

Notice of intention to drill (attach plat) _____
 Notice of intention to change plans _____
 Notice of date for test of water shut-off _____
 Report on result of test of water shut-off _____
 Notice of intention to re-drill or repair well _____
 Notice of intention to clean out well _____
 Statement of shooting _____
 Statement of perforating _____
 Notice to pull or otherwise alter casing _____
 Notice of intention to abandon well _____
 Report of work done on well since previous report _____

Locate Well Correctly

| | | | |
|--------------------------------------|--|--|--|
| OIL & GAS CONSERVATION COMMISSION | | | |
| | | | |
| | | | |
| | | | |
| | | | |

Notice to do work ☐
 Report of work done ☒

Land: Fee and Patented ☐
 State ☐

Lease No. 122060

Colorado Sedgwick Chappel
 State County Field
1 Helina Gas Unit SWSE 34 12N 4W 6N
 (Well No.) (Lease) (1/4 Sec.) (Sec.) (Twp.) (Range) (Meridian)

The Well is located 662 Ft. (N) of Section Line and 1980 Ft. (E) of
 Section Line. (S) South (W)

The elevation above sea level is 2032.1 Ft. (Ground) 2032

Details of Plan of Work: (State names of and expected depths to objective sands.
 Show sizes, weights, and length of proposed casings; indicate mudding jobs, cementing
 points, and all other important proposed work.)

Stenciled drilled subject well to a total depth of 3380 feet with no commercial shows
 of oil and/or gas encountered. Well cased 11-5-55. Well abandoned 11-17-55.

4 3/8 ft. 8-5/8" 20.35 surface pipe set at 467 ft. HSB and cemented with 250 sacks cement.

Electric log tops as follows: Richman 2422, Gullite 2506, Gaddel 2529, Greenhorn
 2964, Graneros 3144, Upper Huddy Sand 3177, Upper Huddy Shale 3255, Huddy Sand 3287,
 Skull Creek 3356.

Well plugged and abandoned as follows:

60 sack cement plug 3320 to 3340 ft.
 30 sack cement plug 510 to 420 ft.
 10 sack cement surface plug.

Confirming verbal approval Jersin to Schroeder 11-17-55.

Approved: _____

21
NOV 18 1955

A. J. Jersin, USA
 Dir Director

Date _____

November 18, 1955

Company _____

Stenciled Oil and Gas Company

Address _____

Box 150, Brush, Colorado

By _____

A. G. Wilson
 G. A. Wilson,
 Field Superintendent

Title _____

Submit reports of proposed work, for approval, on this form in Duplicate for patented lands and in Triplicate for school and state lands.



00790004