




00544959

OIL AND GAS CONSERVATION COMMISSION
OF THE STATE OF COLORADO

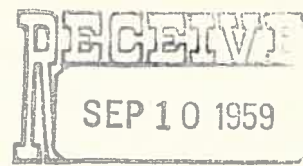

OIL & GAS
CONSERVATION COMMISSION

PLUGGING RECORD

INSTRUCTIONS

Within thirty (30) days after the plugging of any well, the owner or operator thereof shall file this form in duplicate for wells on Patented or Federal lands, and in triplicate for wells on State lands, give a detailed account of the manner in which the abandonment or plugging work was carried out, including the nature and quantities of materials used in plugging and the location and extent (by depths) of the plugs of different materials; records of the amount, size and location (by depths) of casings and junk left in the well; and a detailed statement of the volume and weight of mud fluid used.

Operator THE SUPERIOR OIL COMPANY Field Buck Peak Wildcat

Lease Name STATE Well No. 11-30 County ROUTT

Location C NW NW Section 30 Township 6N Range 89W Meridian 6th
(Quarter Quarter)

680 feet from N Section line and 738 feet from W Section Line
N or S E or W

TOTAL DEPTH 8187' KB DATE OF PLUGGING 8-23-59

| | |
|------|--|
| AJJ | |
| DVR | |
| WRS | |
| HMM | |
| JAM | |
| FJP | |
| JJD | |
| FILE | |

DETAILS OF WORK

The well was plugged using a Halliburton Pump Truck to equalize the cement plugs through 4" open end drill pipe. The plugs, depths and volumes are recorded below.

| Plug | From | To | *Amount | Mud Weight |
|--------|-------|---------|---|------------|
| Mud | 8187' | 7600' | 35 bbls. | 9.7#/gal. |
| Cement | 7600' | 7000' | 240 sax | |
| Mud | 7000' | 5600' | 84 bbls. | 9.7#/gal. |
| Cement | 5600' | 5500' | 50 sax | |
| Mud | 5500' | 4600' | 54 bbls. | 9.7#/gal. |
| Cement | 4600' | 4400' | 200 sax | |
| Mud | 4400' | 446' | 238 bbls. | 9.7#/gal. |
| Cement | 446' | 306' | 50 sax across 10-3/4" casing shoe at 346' | |
| Mud | 306' | 20' | 29 bbls. | 9.7#/gal. |
| Cement | 20' | Surface | 10 sax | |

*Mud volumes approximate

The top of the cement plug opposite the casing shoe was checked at 306'. The casing head was cut off and a 10 sax cement plug was placed in the top of the 10-3/4" casing. Approximately 334' of 10-3/4" casing was left in the hole. A standard dry hole marker was erected. The location has been cleaned and mud pits fenced.

Two copies of the Induction ES, Microlog and Sonic Log are included with this report.

I/we hereby swear (or affirm) that the statements herein made are a full and correct report:

Approved:

Company THE SUPERIOR OIL COMPANY Date Sept. 8, 1959

Date SEP 10 1959

Address P. O. Box 200, Casper, Wyo. Phone No. 2-7391

A. J. Jersin
Director

By Boyd M. Harnden Title Petroleum Engineer
(Signature)

Boyd M. Harnden