

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
Background 01	9/12/2012	15.36	95.02	236	NA	NA	514	1,600
Background 02	9/12/2012	17.40	94.91	217	NA	NA	433	1,400
SB01	3/8/2012	3.30	NM	1,260	NA	NA	1,070	4,600
SB01R	9/11/2012	4.24	90.72	181	NA	NA	372	1,300
	1/8/2013	2.75	92.21	2,820	NA	NA	1,010	4,700
	4/1/2013	NM	NM	No Sample - Under water				
	7/12/2013	2.57	92.39	1,360	NA	NA	448	2,800
	10/31/2013	NM	NM	No Sample - Under water				
	11/5/2013	9.56	85.40	208	NA	NA	553	2,180
	3/31/2014	9.25	85.71	193	0.725	266	440	1,780
	9/22/2014	NM	NM	No Sample - Under water				
SB01R2	9/3/2015	5.62	90.28	325	2.09	156	801	2,740
	3/10/2016	4.41	91.49	259	2.26	115	1,960	3,540
	9/29/2016	5.27	90.63	308	1.15	268	459	1,660
	4/13/2017	5.46	90.44	275	1.05	262	476	1,760
	10/19/2017	6.15	89.75	248	NA	NA	NA	NA
	4/11/2018	5.40	90.50	267	NA	NA	NA	NA
	10/25/2018	6.40	89.01	260	NA	NA	NA	NA
	4/5/2019	5.71	89.70	265	NA	NA	NA	NA
SB02	3/8/2012	6.46	NM	220	NA	NA	584	1,700
SB02R	9/11/2012	8.03	91.30	214	NA	NA	300	1,100
	1/8/2013	6.72	92.61	241	NA	NA	366	830
	4/1/2013	7.18	92.15	241	NA	NA	378	880
	7/12/2013	6.49	92.84	196	NA	NA	365	900
	10/31/2013	5.60	93.73	203	NA	NA	392	980
	4/1/2014	6.25	93.08	192	0.741	259	425	1,380
	9/22/2014	NM	NM	No Sample - Under water				
Removed from monitoring program per COGCC document #2314191								
SB03	3/8/2012	6.22	NM	348	NA	NA	1,070	3,100
SB03R	9/11/2012	7.50	90.33	278	NA	NA	646	2,300
	1/8/2013	5.90	91.93	252	NA	NA	741	1,500
	4/1/2013	6.15	91.68	223	NA	NA	611	1,400
	7/12/2013	6.45	91.38	202	NA	NA	463	1,300

**TABLE 1
GROUNDWATER ANALYTICAL RESULTS**

**MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.**

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB03R	10/31/2013	6.14	91.69	348	NA	NA	1,310	2,500
	4/1/2014	6.30	91.53	275	1.37	201	1,030	2,930
	9/22/2014	NM	NM	No Sample - Under water				
	Removed from monitoring program per COGCC document #2314191							
SB04	3/8/2012	7.08	NM	296	NA	NA	1,220	3,100
SB04R	9/11/2012	7.94	89.73	488	NA	NA	1,600	4,800
	1/8/2013	6.83	90.84	388	NA	NA	1,330	2,400
	4/1/2013	6.30	91.37	356	NA	NA	1,330	2,400
	7/12/2013	6.11	91.56	328	NA	NA	1,170	2,500
	10/31/2013	NM	NM	No Sample - Monitoring well damaged				
	11/5/2013	4.28	93.39	1,420	NA	NA	1,010	6,030
	3/31/2014	4.15	93.52	2,000	2.77	722	948	5,790
	9/22/2014	NM	NM	No Sample - Under water				
	3/27/2015	6.23	91.44	170	0.823	207	1,270	2,760
	9/3/2015	NM	NM	Monitoring well destroyed by landowner grading activity				
SB04R2	4/13/2017	5.97	90.54	649	3.45	188	1,640	4,780
	10/19/2017	6.65	89.86	890	NA	NA	NA	NA
	4/11/2018	6.45	90.06	1,290	NA	NA	NA	NA
	10/25/2018	6.80	89.71	548	NA	NA	NA	NA
	4/5/2019	6.27	90.24	1,870	NA	NA	NA	NA
SB05	3/8/2012	7.94	NM	208	NA	NA	896	2,400
SB05R	9/11/2012	6.51	88.62	291	NA	NA	1,060	3,000
SB05R2	1/8/2013	4.65	NM	6,170	NA	NA	1,570	10,000
	4/1/2013	6.55	90.37	1,630	NA	NA	2,790	4,800
	7/12/2013	7.95	88.97	489	NA	NA	862	2,100
	10/31/2013	6.70	90.22	436	NA	NA	1,650	2,800
	3/31/2014	6.68	90.24	853	3.60	237	1,830	4,500
	9/22/2014	NM	NM	No Sample - Under water				
	3/27/2015	6.35	90.57	380	2.64	144	1,110	4,410
	9/3/2015	7.06	89.86	256	2.59	99	1,090	2,840
	3/10/2016	6.10	90.82	1,300	8.05	161	2,250	6,110
	9/29/2016	6.53	90.39	432	3.66	118	1,320	3,740
	4/13/2017	6.56	90.36	255	2.22	115	1,000	2,940
	10/19/2017	6.80	90.12	281	NA	NA	NA	NA
	4/11/2018	6.73	90.19	298	NA	NA	NA	NA
	10/25/2018	7.23	89.69	305	NA	NA	NA	NA
	4/5/2019	6.84	90.08	759	NA	NA	NA	NA

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB06	3/8/2012	7.82	NM	147	NA	NA	280	890
SB06R	9/11/2012	7.45	89.68	186	NA	NA	325	1,200
	1/8/2013	6.32	90.81	218	NA	NA	401	770
	4/1/2013	6.99	90.14	199	NA	NA	366	780
	7/12/2013	4.78	92.35	171	NA	NA	307	750
	10/31/2013	5.89	91.24	223	NA	NA	242	730
	4/1/2014	7.70	89.43	221	1.03	215	308	1,090
	9/22/2014	6.53	90.60	184	0.452	407	318	1,010
SB06R2	3/27/2015	6.94	90.19	946	1.06	892	585	3,560
	9/3/2015	4.12	92.40	274	0.705	389	388	1,650
	3/10/2016	3.82	92.70	199	0.939	212	318	1,150
	9/29/2016	4.21	92.31	252	1.16	217	340	1,330
	4/13/2017	5.17	91.35	307	1.55	198	431	1,570
	10/19/2017	5.48	91.04	221	NA	NA	NA	NA
	4/11/2018	5.47	91.05	243	NA	NA	NA	NA
	10/25/2018	6.20	90.32	282	NA	NA	NA	NA
	4/5/2019	5.82	90.70	354	NA	NA	NA	NA
SB07	3/8/2012	6.93	NM	1,020	NA	NA	1,620	4,700
SB07R	9/11/2012	9.68	84.95	773	NA	NA	896	3,400
	1/8/2013	7.89	86.74	1,150	NA	NA	2,930	4,900
	4/1/2013	8.49	86.14	1,050	NA	NA	3,170	5,000
	7/12/2013	6.98	87.65	551	NA	NA	3,020	3,900
	10/31/2013	7.48	87.15	839	NA	NA	2,530	4,000
	4/1/2014	7.78	86.85	189	3.86	49	502	5,650
	9/22/2014	7.44	87.19	677	3.31	205	2,040	5,590
SB07R2	9/3/2015	6.03	90.38	816	3.40	240	950	3,670
	3/10/2016	5.50	90.91	556	3.60	154	2,020	4,440
	9/29/2016	5.85	90.56	158	0.859	184	203	724
	4/13/2017	6.18	90.23	456	2.30	198	586	2,300
	10/19/2017	6.92	89.49	167	NA	NA	NA	NA
	4/11/2018	6.60	89.81	544	NA	NA	NA	NA
	10/25/2018	7.49	88.92	No sample - Insufficient water				
	4/5/2019	7.01	89.40	485	NA	NA	NA	NA
SB08	3/8/2012	9.73	NM	182	NA	NA	395	1,100
SB08R	9/11/2012	11.77	89.27	2,140	NA	NA	500	1,600
	1/8/2013	9.39	91.65	247	NA	NA	736	1,100
	4/1/2013	9.79	91.25	202	NA	NA	391	860
	7/12/2013	8.80	92.24	370	NA	NA	816	1,600

**TABLE 1
GROUNDWATER ANALYTICAL RESULTS**

**MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.**

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB08R	10/31/2013	8.22	92.82	277	NA	NA	475	1,100
	4/1/2014	9.07	91.97	272	0.764	356	348	1,270
	9/22/2014	NM	NM	No Sample - Monitoring well damaged				
	Removed from monitoring program per COGCC document #2314191							
SB09 (background)	3/8/2012	8.09	NM	270	NA	NA	573	2,000
SB10	3/9/2012	9.64	NM	157	NA	NA	414	1,100
	9/12/2012	10.39	89.90	146	NA	NA	203	1,000
	1/8/2013	8.42	91.87	195	NA	NA	356	970
	4/1/2013	8.97	91.32	202	NA	NA	642	1,100
	7/12/2013	8.67	91.62	168	NA	NA	308	780
	10/31/2013	8.20	92.09	196	NA	NA	212	760
	4/1/2014	9.13	91.16	219	0.496	442	267	960
	9/22/2014	7.85	92.44	144	0.365	395	236	834
	Removed from monitoring program per COGCC document #2314191							
SB11	3/9/2012	8.58	NM	267	NA	NA	717	1,900
	9/12/2012	9.78	89.05	263	NA	NA	639	1,900
	1/8/2013	7.72	91.11	309	NA	NA	808	1,300
	4/1/2013	7.89	90.94	306	NA	NA	695	1,300
	7/12/2013	8.68	90.15	382	NA	NA	775	1,600
	10/31/2013	7.69	91.14	300	NA	NA	686	1,300
	3/31/2014	7.90	90.93	272	0.796	342	593	1,780
	9/22/2014	6.55	92.28	458	1.33	344	791	2,370
	3/27/2015	6.21	92.62	566	1.31	432	756	2,710
	9/3/2015	NM	NM	No sample - Unable to locate				
	3/10/2016	NM	NM	No sample - Unable to locate				
	9/29/2016	9.25	89.58	337	1.38	244	659	1,970
	4/13/2017	9.08	89.75	337	1.82	185	577	1,990
	10/19/2017	10.08	88.75	384	NA	NA	NA	NA
	4/11/2018	9.52	89.31	390	NA	NA	NA	NA
	10/25/2018	10.52	88.31	335	NA	NA	NA	NA
	4/5/2019	9.87	88.96	318	NA	NA	NA	NA
SB12	3/9/2012	6.16	NM	300	NA	NA	1,230	2,500
	9/12/2012	8.70	88.03	270	NA	NA	643	1,900
	1/8/2013	6.45	90.28	424	NA	NA	921	1,600

**TABLE 1
GROUNDWATER ANALYTICAL RESULTS**

**MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.**

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB12	4/1/2013	6.25	90.48	366	NA	NA	1,650	2,200
	4/4/2013	6.24	90.49	371	NA	NA	1,650	2,200
	7/12/2013	7.94	88.79	393	NA	NA	1,100	2,000
	10/31/2013	6.53	90.20	311	NA	NA	1,210	2,100
	3/31/2014	6.20	90.53	1,150	5.29	217	3,000	6,510
	9/22/2014	4.61	92.12	392	1.48	265	1,330	3,370
	3/27/2015	6.10	90.63	675	1.74	388	1,490	4,130
	9/3/2015	NM	NM	No sample - Unable to locate				
	3/10/2016	6.10	90.63	357	1.27	281	646	2,090
	9/29/2016	7.21	89.52	598	1.22	490	673	2,220
	4/13/2017	6.98	89.75	372	0.908	410	647	2,090
	10/19/2017	7.90	88.83	206	NA	NA	NA	NA
	4/11/2018	7.37	89.36	225	NA	NA	NA	NA
	10/25/2018	8.29	88.44	233	NA	NA	NA	NA
	4/5/2019	7.42	89.31	248	NA	NA	NA	NA
SB13	3/9/2012	5.61	NM	439	NA	NA	1,210	2,900
	9/12/2012	7.43	87.40	314	NA	NA	902	2,400
	1/8/2013	5.02	89.81	352	NA	NA	1,010	1,700
	4/1/2013	4.83	90.00	1,800	NA	NA	3,500	5,400
	7/12/2013	7.03	87.80	373	NA	NA	937	1,800
	10/31/2013	5.17	89.66	596	NA	NA	1,380	2,500
	3/31/2014	4.60	90.23	656	2.15	305	1,460	3,970
	9/22/2014	1.96	92.87	175	0.447	391	279	836
Removed from monitoring program per COGCC document #2314191								
SB14	3/9/2012	6.15	NM	125	NA	NA	991	1,900
	9/12/2012	8.32	88.83	246	NA	NA	1,010	2,500
	1/8/2013	6.28	90.87	246	NA	NA	999	1,500
	4/1/2013	6.18	90.97	1,060	NA	NA	862	2,600
	7/12/2013	7.60	89.55	666	NA	NA	752	2,100
	10/31/2013	6.20	90.95	1,430	NA	NA	843	3,200
	3/31/2014	6.20	90.95	599	1.52	394	714	2,750
	9/22/2014	3.83	93.32	86.2	0.433	199	247	843
	3/27/2015	6.13	91.02	170	0.496	343	273	939
	9/3/2015	NM	NM	No sample - Unable to locate				
	3/10/2016	6.10	91.05	474	1.45	327	354	1,740
	9/29/2016	7.12	90.03	264	0.674	392	420	1,400
	4/13/2017	7.03	90.12	221	0.744	297	581	1,660

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB14	10/19/2017	7.78	89.37	196	NA	NA	NA	NA
	4/11/2018	7.30	89.85	215	NA	NA	NA	NA
	10/25/2018	8.25	88.90	250	NA	NA	NA	NA
	4/5/2019	7.48	89.67	319	NA	NA	NA	NA
SB15	3/9/2012	10.97	NM	No Sample - Dry				
	9/12/2012	7.89	87.88	292	NA	NA	900	2,500
SB15	1/8/2013	5.65	90.12	654	NA	NA	3,520	4,800
	4/1/2013	5.49	90.28	588	NA	NA	2,720	4,400
	7/12/2013	7.52	88.25	465	NA	NA	1,020	2,300
	10/31/2013	5.72	90.05	528	NA	NA	1,790	4,000
	4/1/2014	5.50	90.27	No sample - Insufficient water				
	9/22/2014	3.15	92.62	485	4.04	120	2,340	5,320
	Removed from monitoring program per COGCC document #2314191							
SB16	3/9/2012	7.36	NM	297	NA	NA	730	2,200
	9/12/2012	9.15	88.52	194	NA	NA	597	2,000
	1/8/2013	7.60	90.07	264	NA	NA	734	1,500
	4/4/2013	7.58	90.09	305	NA	NA	720	1,600
	7/12/2013	9.12	88.55	251	NA	NA	654	1,600
	10/31/2013	7.66	90.01	253	NA	NA	582	1,400
	3/31/2014	7.62	90.05	238	1.03	231	644	2,070
	9/22/2014	6.85	90.82	280	1.25	224	680	2,140
Removed from monitoring program per COGCC document #2314191								
SB17	9/11/2012	5.55	90.14	237	NA	NA	584	2,100
	1/8/2013	4.33	91.36	262	NA	NA	621	1,400
	4/1/2013	4.29	91.40	253	NA	NA	635	1,500
	7/12/2013	5.24	90.45	281	NA	NA	986	2,100
	11/5/2013	4.33	91.36	250	NA	NA	873	2,510
	3/31/2014	4.45	91.24	262	1.19	220	903	2,480
	9/22/2014	NM	NM	No Sample - Under water				
Removed from monitoring program per COGCC document #2314191								
SB18	9/11/2012	7.75	90.85	290	NA	NA	920	3,000
	1/8/2013	6.50	92.10	313	NA	NA	866	1,800
	4/1/2013	6.73	91.87	284	NA	NA	772	1,800
	7/12/2013	7.11	91.49	265	NA	NA	714	2,000
	10/31/2013	6.27	92.33	330	NA	NA	699	1,900

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)	
SB18	4/1/2014	6.95	91.65	282	0.979	288	623	2,260	
	9/22/2014	NM	NM	No Sample - Under water					
	3/27/2015	6.68	91.92	256	0.935	274	747	2,650	
	9/3/2015	NM	NM	Monitoring well destroyed by landowner grading activity					
	SB18R	4/13/2017	6.20	91.51	372	2.46	151	1,340	3,760
	10/19/2017	7.25	90.46	406	NA	NA	NA	NA	
	4/11/2018	7.15	90.56	397	NA	NA	NA	NA	
	10/25/2018	7.68	90.03	474	NA	NA	NA	NA	
	4/5/2019	7.15	90.56	400	NA	NA	NA	NA	
	SB19	9/11/2012	8.56	91.77	196	NA	NA	317	1,300
1/8/2013		6.85	93.48	390	NA	NA	831	1,600	
SB19R		4/1/2013	12.65	85.10	190	NA	NA	324	680
7/12/2013		6.78	90.97	211	NA	NA	368	810	
10/31/2013		10.23	87.52	239	NA	NA	317	860	
	4/1/2014	12.00	85.75	No sample - Insufficient water					
	9/22/2014	NM	NM	No sample - Monitoring well destroyed					
	Removed from monitoring program per COGCC document #2314191								
	SB20	9/11/2012	10.33	89.50	183	NA	NA	180	1,000
		1/8/2013	9.40	90.43	209	NA	NA	329	710
SB20R		4/1/2013	11.23	84.71	234	NA	NA	301	750
7/12/2013		7.56	88.38	234	NA	NA	342	880	
10/31/2013		8.69	87.25	244	NA	NA	283	700	
SB20R2	4/1/2014	11.42	84.52	No sample - Insufficient water					
	9/22/2014	9.39	86.55	155	0.404	384	149	650	
	3/27/2015	NM	NM	Monitoring well destroyed by landowner grading activity					
	9/3/2015	7.19	88.91	89.5	0.359	249	466	927	
	3/10/2016	7.23	88.87	169	0.677	250	176	804	
	9/29/2016	8.00	88.10	207	0.602	344	315	1,090	
	4/13/2017	8.26	87.84	203	0.506	401	226	1,080	
	10/19/2017	8.55	87.55	No sample - Insufficient water					
	4/11/2018	8.88	87.22	No sample - Insufficient water					
	10/25/2018	NM	NM	No sample - Insufficient water					
SB21	4/5/2019	NM	NM	No sample - Insufficient water					
	9/11/2012	10.17	90.62	162	NA	NA	490	1,200	
	1/8/2013	8.36	92.43	196	NA	NA	350	660	
	SB21R	4/1/2013	9.95	86.89	190	NA	NA	163	650
	7/12/2013	5.81	91.03	223	NA	NA	369	880	

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/ Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB21R	10/31/2013	7.93	88.91	238	NA	NA	239	710
	4/1/2014	11.13	85.71	No sample - Insufficient water				
	9/22/2014	NM	NM	No sample - Monitoring well destroyed				
	Removed from monitoring program per COGCC document #2314191							
SB22	9/12/2012	11.14	87.53	355	NA	NA	815	2,200
	1/8/2013	9.14	89.53	378	NA	NA	884	1,400
	4/1/2013	9.06	89.61	337	NA	NA	815	1,500
	7/12/2013	10.08	88.59	359	NA	NA	808	1,700
	10/31/2013	9.42	89.25	416	NA	NA	897	1,700
	3/31/2014	8.90	89.77	380	1.22	311	874	2,330
	9/22/2014	NM	NM	No sample - Could not locate				
	Removed from monitoring program per COGCC document #2314191							
SB23	9/12/2012	11.25	86.21	212	NA	NA	515	1,500
	1/8/2013	8.26	89.20	268	NA	NA	712	1,100
	4/1/2013	7.95	89.51	354	NA	NA	1,100	1,600
	7/12/2013	9.65	87.81	368	NA	NA	1,120	1,900
	10/31/2013	8.61	88.85	237	NA	NA	607	1,400
	3/31/2014	7.72	89.74	604	2.38	254	1,830	3,950
	9/22/2014	6.84	90.62	1,290	4.18	309	2,940	6,850
	3/27/2015	6.38	91.08	1,150	2.64	436	2,060	5,300
	9/3/2015	NM	NM	No sample - Unable to locate				
	3/10/2016	7.60	89.86	1,280	5.43	236	2,430	5,980
	9/29/2016	8.83	88.63	997	2.15	464	1,760	4,680
	4/13/2017	5.32	92.14	704	1.74	405	1,380	3,890

TABLE 1
GROUNDWATER ANALYTICAL RESULTS

MILLER SOUTH #1 SPREAD FIELD
COGCC REMEDIATION #7412
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.

Sample Location	Date Sampled	Depth to Water (feet btoc)	Relative Groundwater Elevation (feet)	Chloride (mg/L)	Bromide (mg/L)	Chloride/Bromide*	Sulfate (mg/L)	Total Dissolved Solids (mg/L)
SB23	10/19/2017	9.21	88.25	664	NA	NA	NA	NA
	4/11/2018	8.60	88.86	375	NA	NA	NA	NA
	10/25/2018	9.82	87.64	297	NA	NA	NA	NA
	4/5/2019	8.79	88.67	244	NA	NA	NA	NA
COGCC Table 910-1 Standard				295	--	250*	642.5	2,000

NOTES:

btoc - below top of casing

COGCC - Colorado Oil and Gas Conservation Commission

mg/L - milligrams per liter

NA - not analyzed

NM - not measured

< - indicates result is less than the stated laboratory reporting limit

-- - indicates there is no standard

Chloride, sulfate, and total dissolved solids standards are calculated based on 1.25 times background concentrations

Chloride, bromide, and sulfate analyzed by EPA Method 300.0

Total dissolved solids analyzed by Standard Method 2540C and EPA Method 160.1

BOLD indicates result exceeds the applicable standard

* - This value is not a regulatory limit and is included for reference purposes only. Unimpacted groundwater would not be expected to exhibit a ratio of chloride to bromide that exceeds this naturally occurring value.

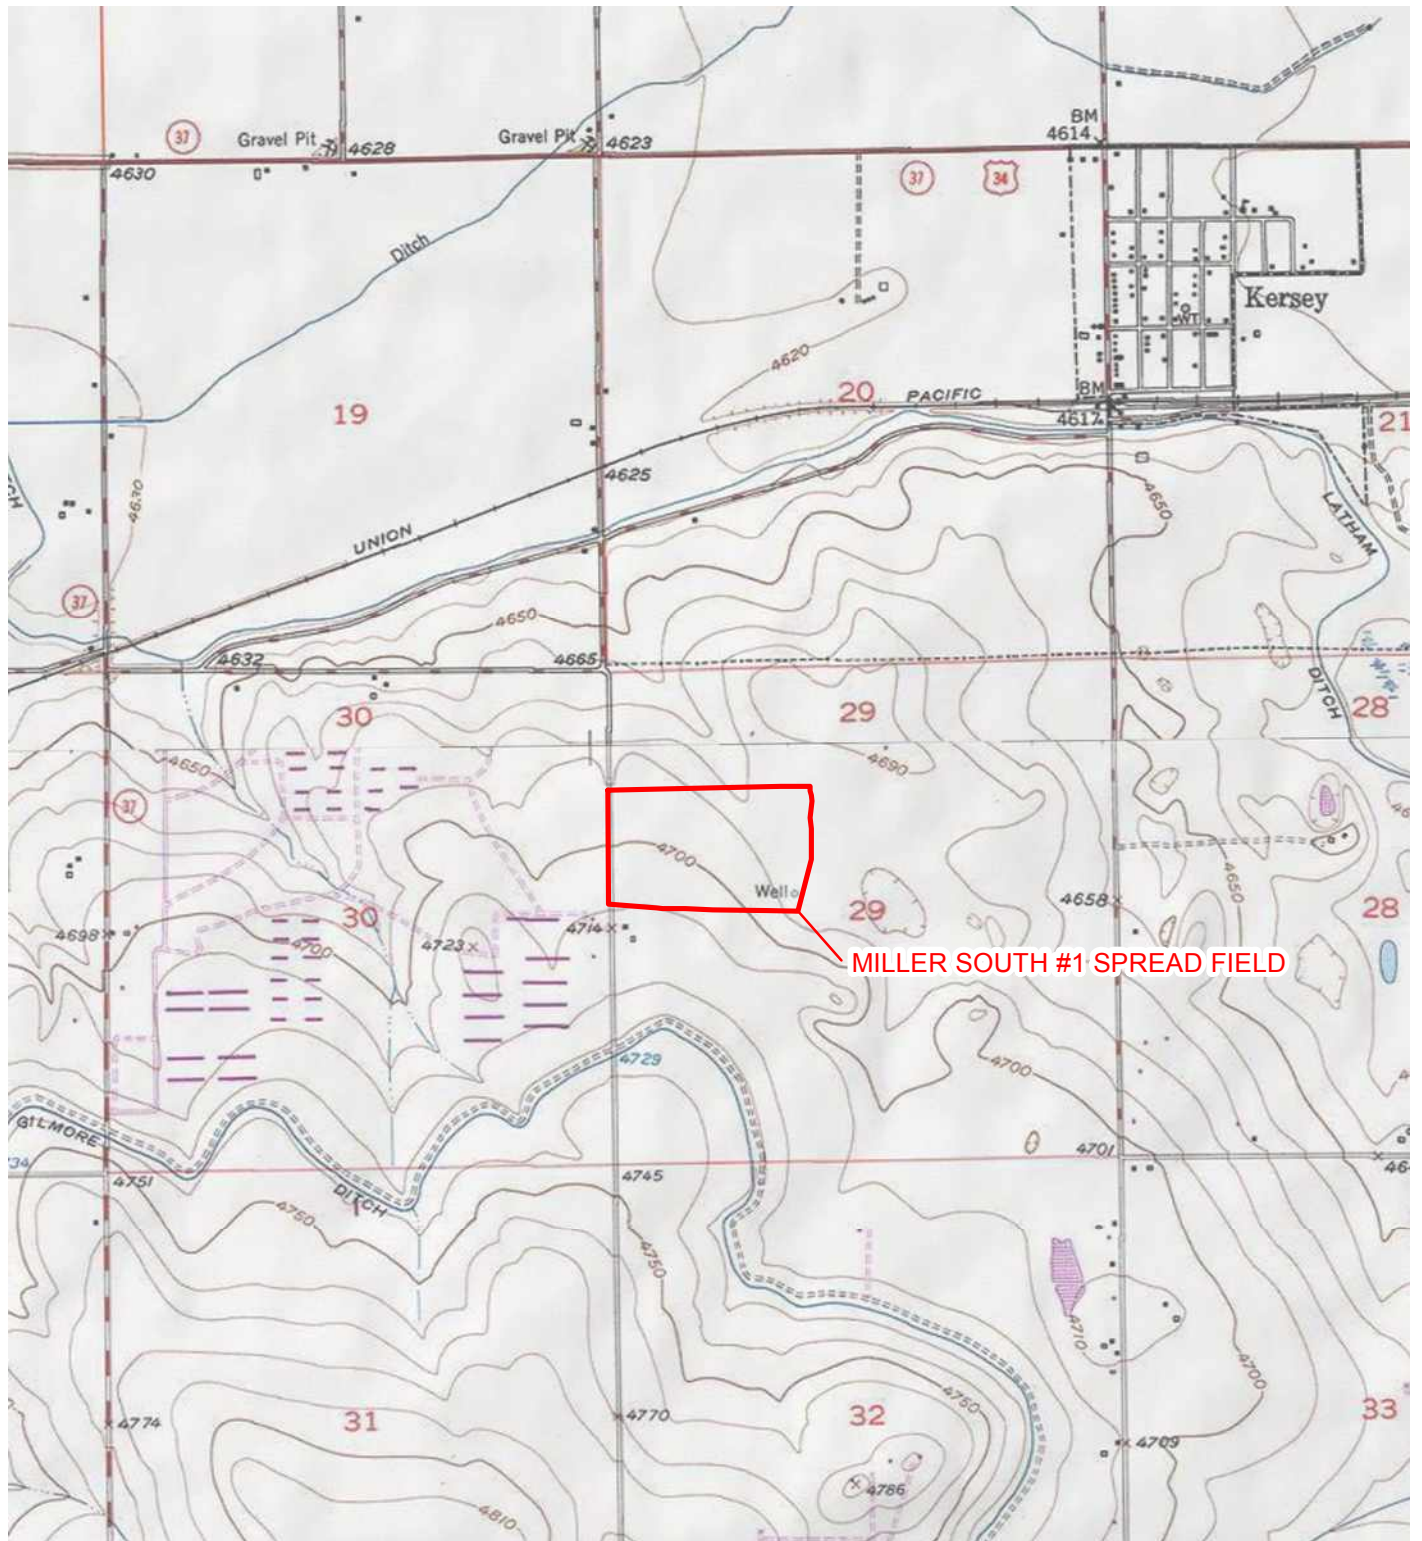


IMAGE COURTESY OF ESRI/USGS

LEGEND

SITE LOCATION

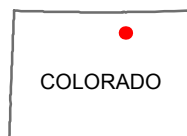



FIGURE 1
SITE LOCATION MAP
MILLER SOUTH #1 SPREAD FIELD
S/2NW Sec29 T5N R64W
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.



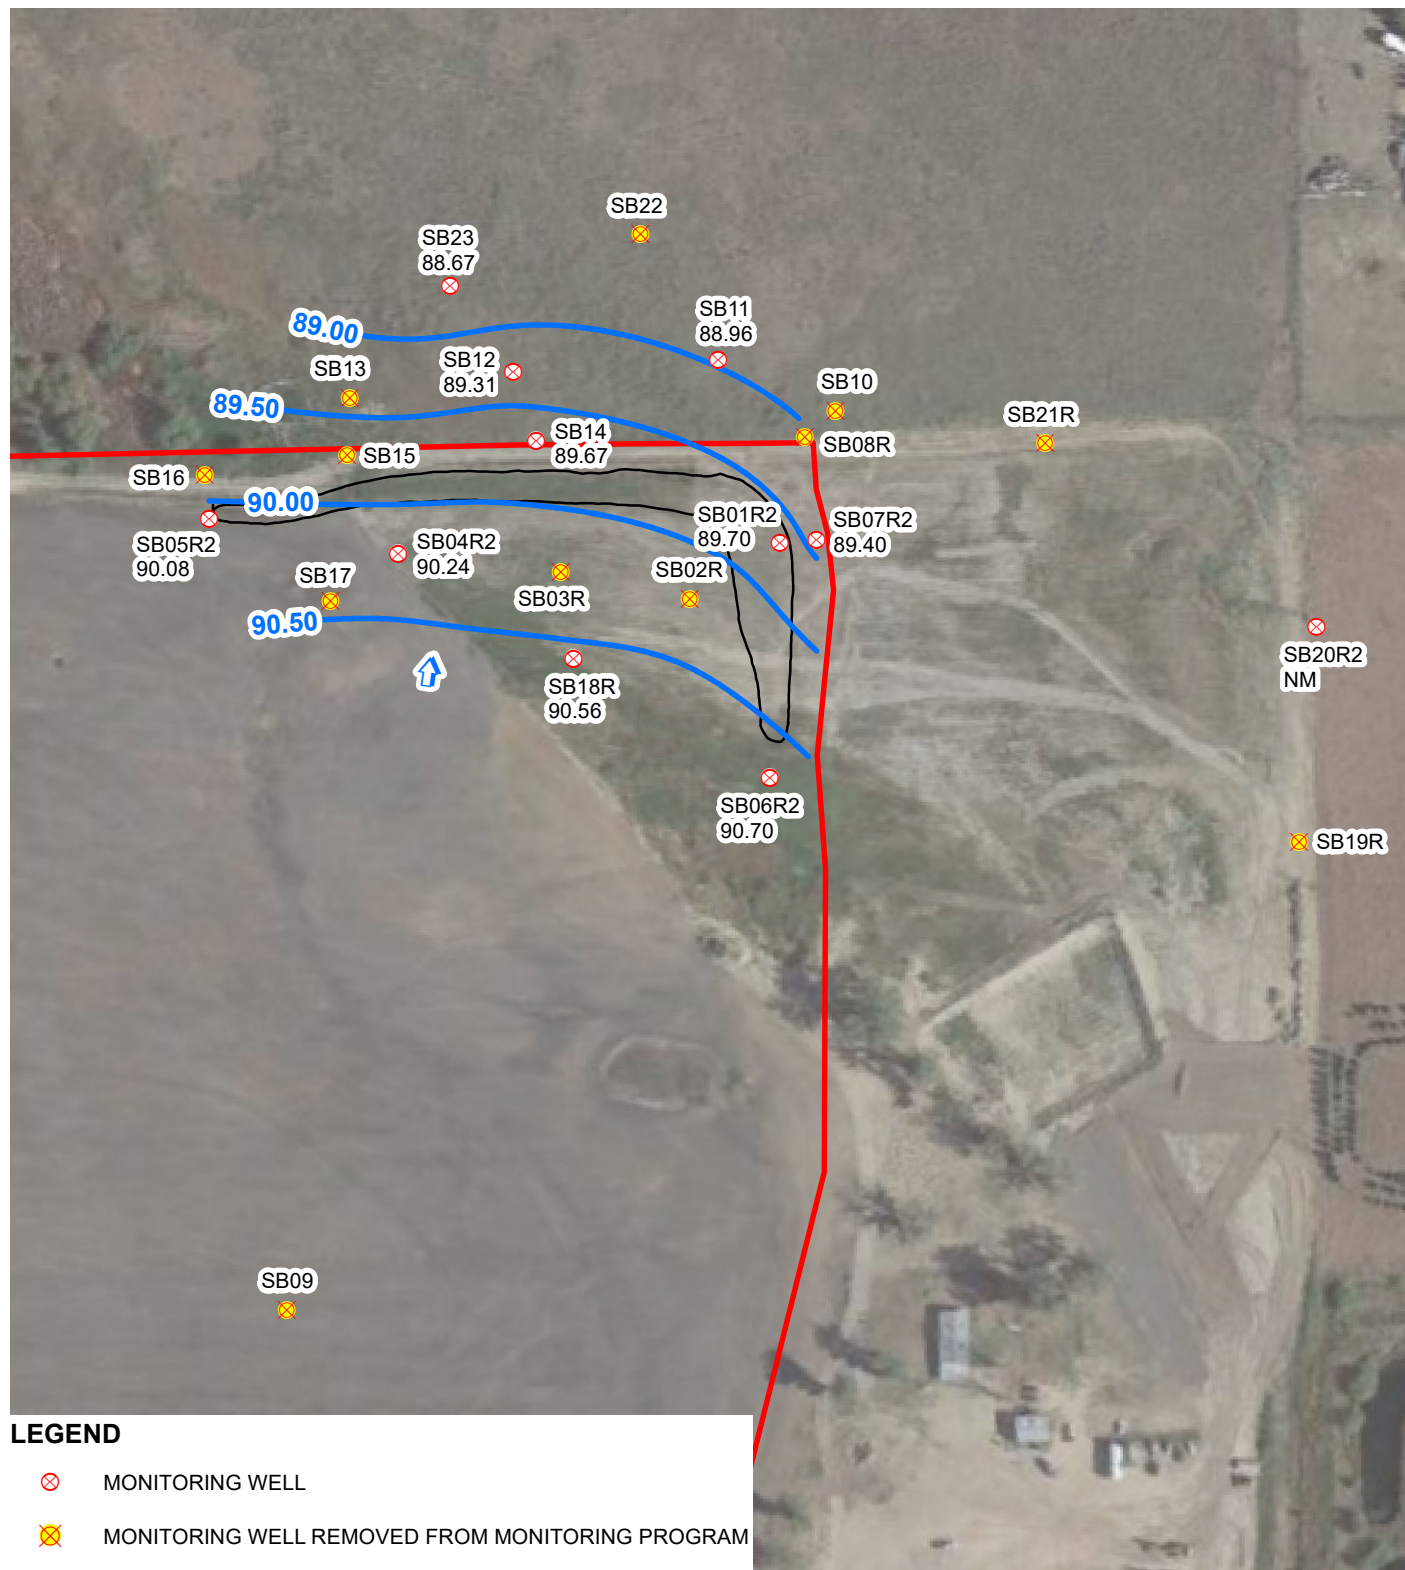


IMAGE COURTESY OF GOOGLE EARTH 2016

LEGEND

- ⊗ MONITORING WELL
- ⊗ MONITORING WELL REMOVED FROM MONITORING PROGRAM
- ↑ CALCULATED GROUNDWATER FLOW DIRECTION
- HISTORICAL SPREAD FIELD BOUNDARY
- SURFICIAL RELEASE EXTENT
- RELATIVE GROUNDWATER ELEVATION CONTOUR
CONTOUR INTERVAL = 0.50 FEET
GRADIENT = 0.005 FEET/FOOT




FIGURE 2
RELATIVE GROUNDWATER ELEVATION MAP
 APRIL 5, 2019
 MILLER SOUTH #1 SPREAD FIELD
 WELD COUNTY, COLORADO
 NOBLE ENERGY, INC.





LEGEND

- MONITORING WELL
- MONITORING WELL REMOVED FROM MONITORING PROGRAM
- CALCULATED GROUNDWATER FLOW DIRECTION
- HISTORICAL SPREAD FIELD BOUNDARY
- SURFICIAL RELEASE EXTENT




FIGURE 3
GROUNDWATER ANALYTICAL RESULTS
APRIL 5, 2019
MILLER SOUTH #1 SPREAD FIELD
WELD COUNTY, COLORADO
NOBLE ENERGY, INC.





April 12, 2019

LT Environmental, Inc.

Jeremy Pike

4600 West 60th Avenue

Arvada

CO 80003

Project Name - Noble - Miller #1 South

Project Number - 008312061

Attached are your analytical results for Noble - Miller #1 South received by Origins Laboratory, Inc. April 05, 2019. This project is associated with Origins project number Y904136-01.

The analytical results in the following report were analyzed under the guidelines of EPA Methods. These methods are identified as follows; "SW" are defined in SW-846, "EPA" are defined in 40CFR part 136 and "SM" are defined in the most current revision of Standard Methods For the Examination of Water and Wastewater.

The analytical results apply specifically to the samples and analyses specified per the attached Chain of Custody. As such, this report shall not be reproduced except in full, without the written approval of Origin's laboratory.

Unless otherwise noted, the analytical results for all soil samples are reported on a wet weight basis. All analytical analyses were performed under NELAP guidelines unless noted by a data qualifier.

Any holding time exceedances, deviations from the method specifications or deviations from Origins Laboratory's Standard Operating Procedures are outlined in the case narrative.

Thank you for selecting Origins for your analytical needs. Please contact us with any questions concerning this report, or if we can help with anything at all.

Origins Laboratory, Inc.
303.433.1322
o-squad@oelabinc.com



1725 Elk Place, Denver, CO 80211 | Phone: 303.433.1322 | Fax: 303.265.9645

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

CROSS REFERENCE REPORT

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
SB01R2	Y904136-01	Water	April 5, 2019 13:00	04/05/2019 15:50
SB04R2	Y904136-02	Water	April 5, 2019 14:20	04/05/2019 15:50
SB05R2	Y904136-03	Water	April 5, 2019 13:59	04/05/2019 15:50
SB06R2	Y904136-04	Water	April 5, 2019 12:47	04/05/2019 15:50
SB07R2	Y904136-05	Water	April 5, 2019 13:22	04/05/2019 15:50
SB11	Y904136-06	Water	April 5, 2019 11:40	04/05/2019 15:50
SB12	Y904136-07	Water	April 5, 2019 12:07	04/05/2019 15:50
SB14	Y904136-08	Water	April 5, 2019 14:30	04/05/2019 15:50
SB18R	Y904136-09	Water	April 5, 2019 14:10	04/05/2019 15:50
SB23	Y904136-10	Water	April 5, 2019 12:25	04/05/2019 15:50

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

www.originslaboratory.com

page 1 of 1

ORIGINS
LABORATORY, INC

1904136

Client: LT Environmental, Inc.
Address: 4600 West 60th Ave, Arvada, CO
Telephone Number: 303-433-9788
Email Address: Noble Remediation Team

Project Manager: Jeremy Pike
Project Name: Miller South #1 CaCl
Project Number: 008312061
Samples Collected By: Drew Sullivan

Invoice Jacob Evans

Sample ID Description	Date Sampled	Time Sampled	# of Containers	Preservative	Matrix	Analysis	Sample Instructions
SB01 R2	4/5/19	13:06	2	X	Soil	Chloride, Bromide, Sulfate, TDS	Lab filter all
SB04 R2		14:26	2	X	Other	CHLORIDE	
SB05 R2		13:59	2	X	Other	CHLORIDE	
SB06 R2		12:47	2	X	Other	CHLORIDE	
SB07 R2		13:22	2	X	Other	CHLORIDE	
SB11		11:40	2	X	Other	CHLORIDE	
SB12		12:07	2	X	Other	CHLORIDE	
SB14		14:30	2	X	Other	CHLORIDE	
SB08 R		14:10	2	X	Other	CHLORIDE	
SB23		12:25	2	X	Other	CHLORIDE	
Relinquished By: <i>Jew Sullivan</i>	Date: 4/5/19	Time: 1550	Received By: <i>[Signature]</i>	Date: 4/5/19	Time: 1550	Turnaround Time: Same Day <input type="checkbox"/> 24 Hr <input type="checkbox"/> 48 Hr <input type="checkbox"/> 72 Hr <input type="checkbox"/> Standard <input checked="" type="checkbox"/>	
Relinquished By:	Date:	Time:	Received By:	Date:	Time:		

Date Results Needed

5.6

1725 Elk Place | Denver, CO 80211 | Phone: 303.433.1322 | Fax: 303.265.9645

Origins Laboratory, Inc.

Jefe Pellegrini

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

Origins Laboratory

F-012207-01-R1
Effective Date: 01/09/12

Sample Receipt Checklist

Origins Work Order: Y904136

Client: LTE

Client Project ID: Noble - Miller South

Checklist Completed by: JG

Shipped Via: HD

(UPS, FedEx, Hand Delivered, Pick-up, etc.)

Date/time completed: 4/8/2019

Airbill #: N/A

Matrix(s) Received: (Check all that apply): Soil/Solid ☒ Water ☐ Other: ☐

Cooler Number/Temperature: 1 / 5.6 °C 1 / 1 °C 1 / 1 °C (Describe)

Thermometer ID: T003

Requirement Description	Yes	No	N/A	Comments (if any)
If samples require cooling, was the temperature between 0°C to ≤ 6°C ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is there ice present (document if blue ice is used)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Are custody seals present on cooler? (if so, document in comments if they are signed and dated, broken or intact)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Are custody seals present on each sample container? (if so, document in comments if they are signed and dated, broken or intact)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Were all samples received intact ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Was adequate sample volume provided ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Are short holding time analytes or samples with HTs due within 48 hours present ⁽¹⁾ ?	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Is a chain-of-custody (COC) present and filled out completely ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Does the COC agree with the number and type of sample bottles received ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Do the sample IDs on the bottle labels match the COC ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
Is the COC properly relinquished by the client with date and time recorded ⁽¹⁾ ?	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	
For volatiles in water – is there headspace (> ¼ inch bubble) present? If yes, contact client and note in narrative.	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Are samples preserved that require preservation and was it checked ⁽¹⁾ ? (note ID of confirmation instrument used in comments) / (preservation is not confirmed for subcontracted analyses in order to insure sample integrity) / (pH < 2 for samples preserved with HNO ₃ , HCL, H ₂ SO ₄) / (pH > 10 for samples preserved with NaAsO ₂ +NaOH, ZnAc+NaOH)	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
Additional Comments (if any):				

⁽¹⁾If NO, then contact the client before proceeding with analysis and note date/time and person contacted as well as the corrective action to in the additional comments (above) and the case narrative.

Reviewed by (Project Manager) JG

Date/Time Reviewed 4/9/19

Origins Laboratory, Inc.

Jen Pellegrini

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB01R2

4/5/2019 1:00:00PM

Analyte	Result	Reporting	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit							

GEL Laboratories, LLC
Y904136-01 (Water)

Anions by EPA 300.0

Chloride	265	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/10/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB04R2

4/5/2019 2:20:00PM

Analyte	Result	Reporting		Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit								

GEL Laboratories, LLC
Y904136-02 (Water)

Anions by EPA 300.0

Chloride	1870	80.0	mg/L	400	1866061	LXA2	04/05/2019	04/12/2019
Sulfate	2240	160	"	"	"	LXA2	"	"

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB05R2

4/5/2019 1:59:00PM

Analyte	Result	Reporting	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit							

GEL Laboratories, LLC
Y904136-03 (Water)

Anions by EPA 300.0

Chloride	759	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/10/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB06R2

4/5/2019 12:47:00PM

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
---------	--------	--------------------	-------	----------	-------	---------	----------	----------	-------

GEL Laboratories, LLC
Y904136-04 (Water)

Anions by EPA 300.0

Chloride	354	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/10/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB07R2

4/5/2019 1:22:00PM

Analyte	Result	Reporting	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit							

GEL Laboratories, LLC
Y904136-05 (Water)

Anions by EPA 300.0

Chloride	485	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/10/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB11

4/5/2019 11:40:00AM

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
---------	--------	--------------------	-------	----------	-------	---------	----------	----------	-------

GEL Laboratories, LLC
Y904136-06 (Water)

Anions by EPA 300.0

Chloride	318	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/10/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB12

4/5/2019 12:07:00PM

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
---------	--------	--------------------	-------	----------	-------	---------	----------	----------	-------

GEL Laboratories, LLC
Y904136-07 (Water)

Anions by EPA 300.0

Chloride	248	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/11/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB14

4/5/2019 2:30:00PM

Analyte	Result	Reporting	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit							

GEL Laboratories, LLC
Y904136-08 (Water)

Anions by EPA 300.0

Chloride	319	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/11/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB18R

4/5/2019 2:10:00PM

Analyte	Result	Reporting	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
		Limit							

GEL Laboratories, LLC
Y904136-09 (Water)

Anions by EPA 300.0

Chloride	400	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/11/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

SB23

4/5/2019 12:25:00PM

Analyte	Result	Reporting Limit	Units	Dilution	Batch	Analyst	Prepared	Analyzed	Notes
---------	--------	--------------------	-------	----------	-------	---------	----------	----------	-------

GEL Laboratories, LLC
Y904136-10 (Water)

Anions by EPA 300.0

Chloride	244	20.0	mg/L	100	1866061	LXA2	04/05/2019	04/11/2019	
----------	-----	------	------	-----	---------	------	------------	------------	--

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

Anions by EPA 300.0 - Quality Control GEL Laboratories, LLC

Analyte	Result	Reporting Limit	Units	Spike Level	Source Result	%REC	%REC Limits	RPD	RPD Limit	Notes
Batch 1866061 -										
BLANK (1204257471-BLK)					Prepared: Analyzed: 04/10/2019					
Chloride	ND	0.200	mg/L				-			U
LCS (1204257472-BKS)					Prepared: Analyzed: 04/10/2019					
Chloride	5.16	0.200	mg/L	5.00		103	90-110			
DUP (1204257473 D)					Source: 475788001 Prepared: Analyzed: 04/10/2019					
Chloride	101	20.0	mg/L		103		0-20	2.54	20	
DUP (1204257474 D)					Source: Y904136-01 Prepared: Analyzed: 04/10/2019					
Chloride	252	20.0	mg/L		265		0-20	4.93	20	
PS (1204257671 S)					Source: 475788001 Prepared: Analyzed: 04/10/2019					
Chloride	610	20.0	mg/L	5.00	101		90-110			
PS (1204257672 S)					Source: Y904136-01 Prepared: Analyzed: 04/10/2019					
Chloride	776	20.0	mg/L	5.00	102		90-110			

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

LT Environmental, Inc.
4600 West 60th Avenue
Arvada CO 80003

Jeremy Pike
Project Number: 008312061
Project: Noble - Miller #1 South

Notes and Definitions

U Result not detected above the detection limit

ND Analyte NOT DETECTED at or above the reporting limit

RPD Relative Percent Difference

All soil results are reported at a wet weight basis.

Origins Laboratory, Inc.



The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.