

# Final Reclamation and Stormwater Inspection

Date: 10/11/2022

Operator: MALLARD EXPLORATION LLC 10670

Location ID: 447902

Inspection Document #: 696105541

Weld County, CO

NENW Section 31 T9N R59W

Dylan Edwardson  
Reclamation Specialist, COGCC



**COLORADO**

**Oil & Gas Conservation  
Commission**

Department of Natural Resources

Inspection Photos  
Location Name: Shull Pad 9-59-31  
Location ID: 447902



**Photo 1.** Taken near the entrance of location, facing southeast. Photo illustrates interim reclamation areas have been revegetated and are progressing towards standards.



Inspection Photos  
Location Name: Shull Pad 9-59-31  
Location ID: 447902



**Photo 2.** Taken from eastern portion, facing southeast. Photo illustrates an approximate 100' x 30' area that has not revegetated; some germination was observed in bare soil areas.




Inspection Photos  
Location Name: Shull Pad 9-59-31  
Location ID: 447902



**Photo 3.** Taken from southeastern portion of production area, facing north. Photo illustrates sediment laden stormwater appears to have discharged off of the production area and into the interim area.



Inspection Photos  
Location Name: Shull Pad 9-59-31  
Location ID: 447902

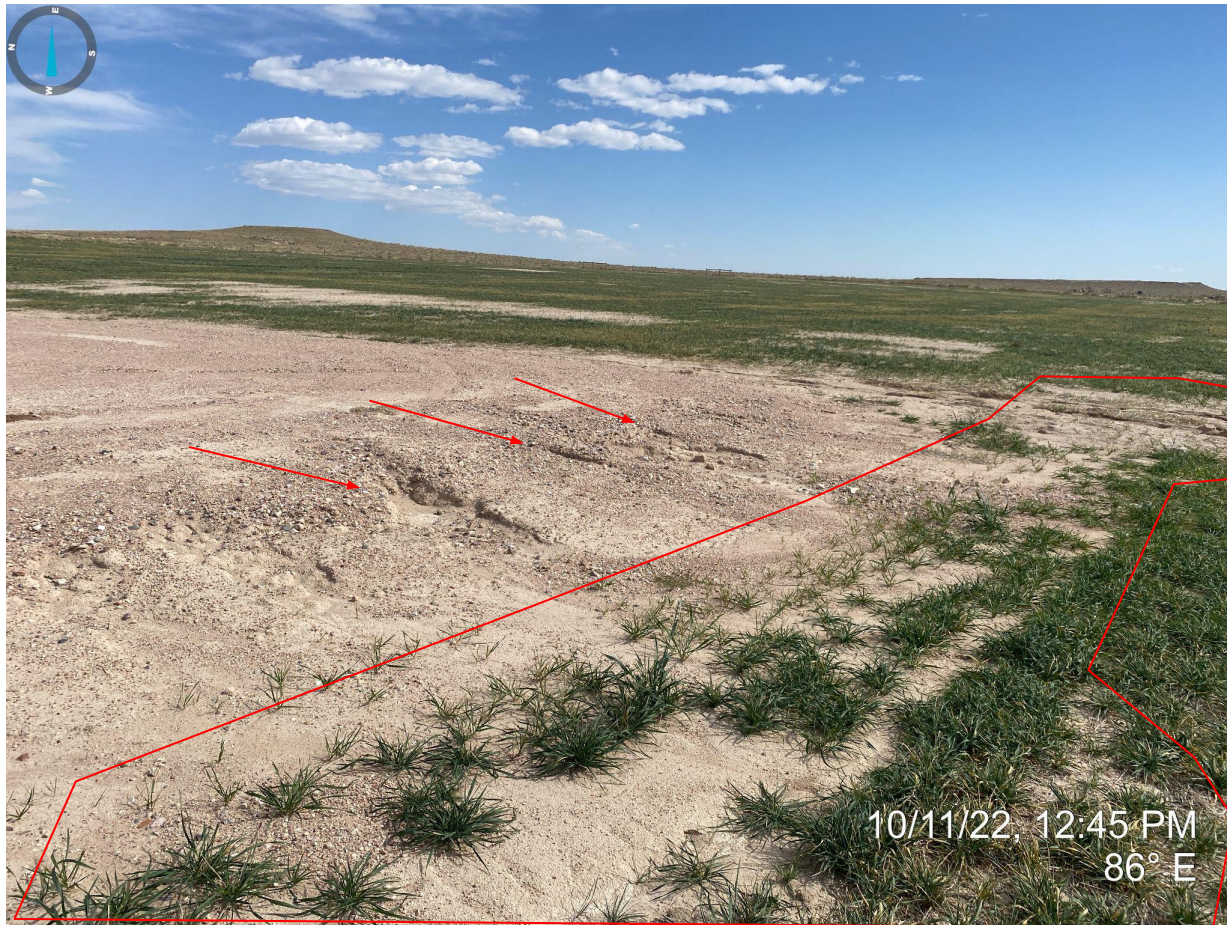

**Photo 4.** Taken from the southeastern portion, facing east. Photo illustrates rill erosion (red arrows) and sediment laden stormwater discharged into interim reclamation areas, red outline.