

Inspection Photos

4/28/2023

Operator: GENESIS GAS & OIL COLORADO LLC
- 10384

Location Number: 413497
Rio Blanco County, CO

Aaron Trujillo
NW Reclamation Specialist
COGCC

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



April 27, 2023



April 27, 2023

Photo 1: Photos 1-2 taken from the northwest end of the Location. Photos provide an overview of the Location from northeast, southeast, south to southwest. Photos show final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the Location.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 3: Photos taken from the southwest end of the Location. Photos show fill slopes remaining. Reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the Location.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 4: Equipment remaining on Location

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



April 27, 2023

Photo 5: Surface equipment remaining along access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 6: Well marker. Well has not been drilled. All Form 2 and Federal “permits to drill” on file for the Location have expired.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 7: Photo taken from the north end of the Location. Photo shows what appears to be the stormwater run-on ditch along the northern perimeter of the Location. BMP has not been installed per good engineering practices, or maintained in proper functioning condition, and has facilitated gully erosion on the Location. Culvert within ditch appears to have filled with sediment; unable to find outlet.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 8: Photos taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the access road. Photos also examples of culverts observed remaining along the access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



April 27, 2023



April 27, 2023

Photo 9: Photos 9-15 taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the entire access road. Photos also show erosion degradation at access road due to inadequate stormwater management and slope stabilization. Access road intersects with Co Rd 122 at 40.076157°/-108.637129°.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



April 27, 2023



April 27, 2023

Photo 10: See comments under photo 9. Photo shows erosion degradation observed along cutslopes of the access road; slopes lack stabilization.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 11: See comments under photo 9. 6 foot measuring stick for reference.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 12: See comments under photo 9

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 13: See comments under photo 9. Photo shows sediment deposition onto the access road due to inadequate stormwater run-on BMPs. 6 foot measuring stick for reference.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 14: See comments under photo 9. Photo shows rock-falls from the unstabilized slopes has rendered the Location inaccessible by vehicle.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497



Photo 15: See comments under photo 9. Photo shows rock-falls from the unstabilized slopes has rendered the Location inaccessible by vehicle.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497

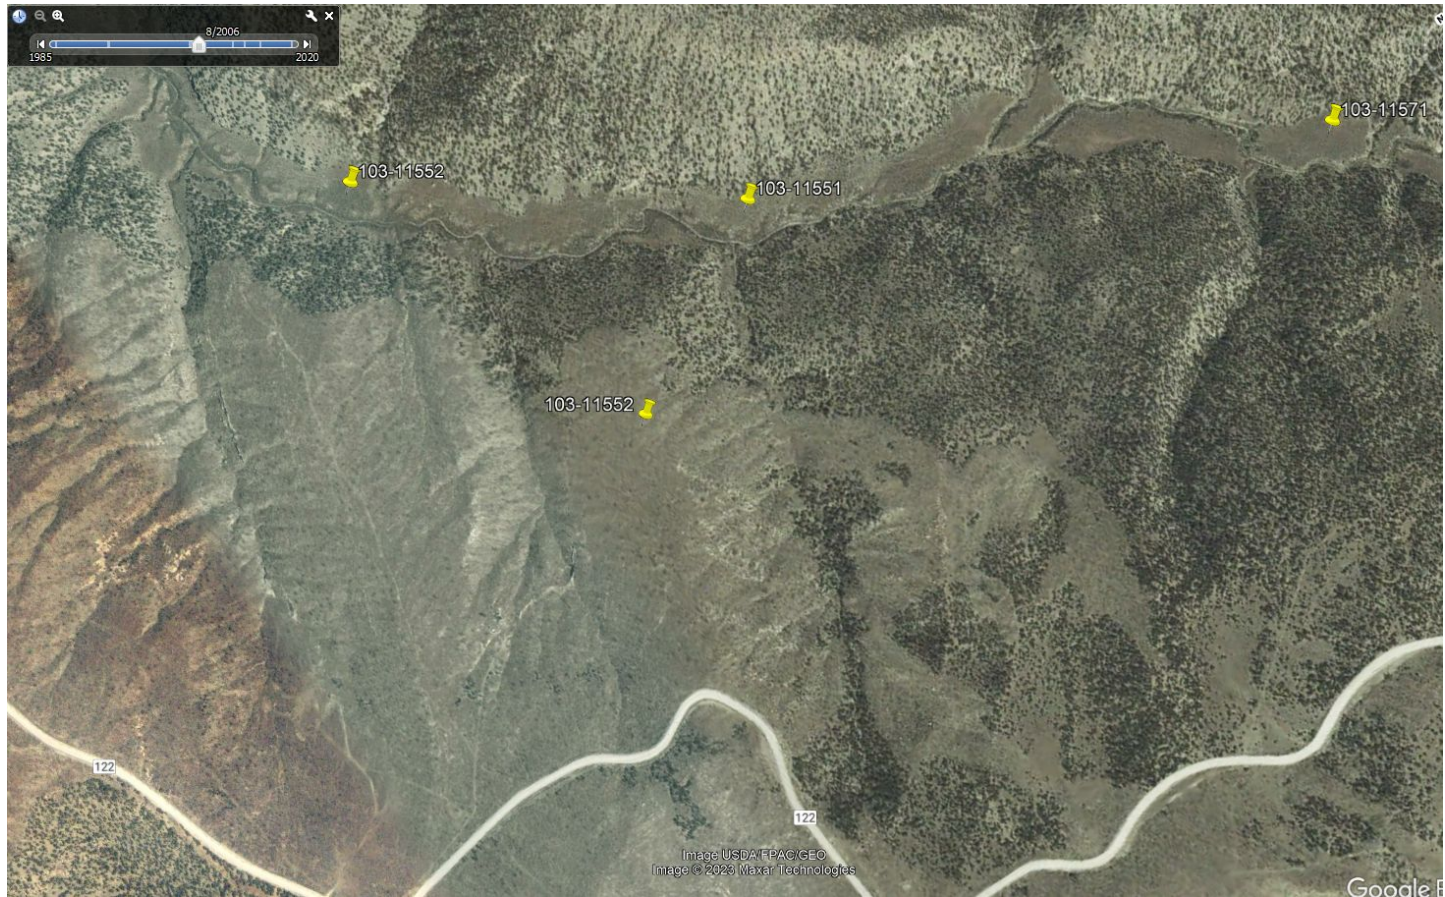


Photo 16: 2006 Google Earth aerial imagery showing the 4 expired Genesis Locations within the Fletcher Gulch Drainage, prior to construction of the Locations and access road—access roads did not exist prior to O&G disturbance.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413497

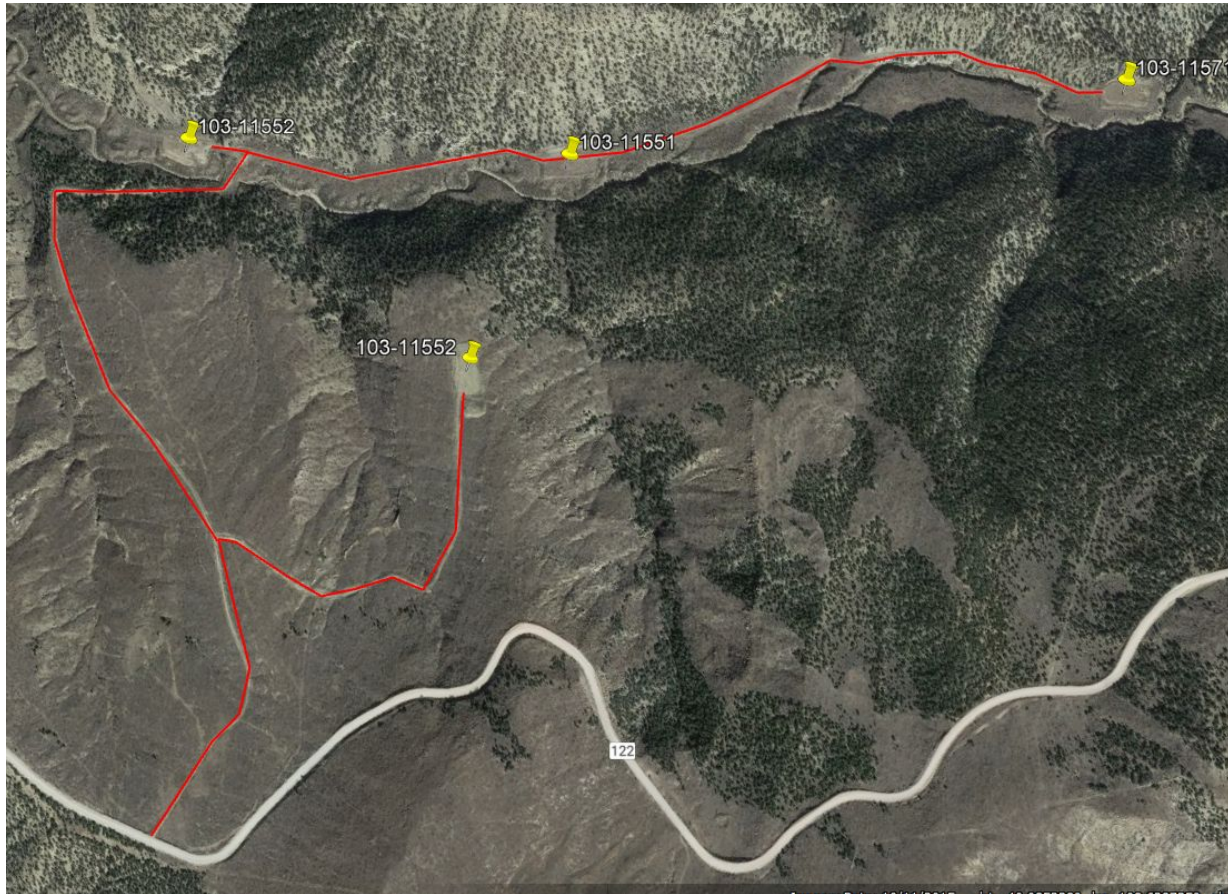


Photo 17: Google Earth aerial imagery showing the 4 expired Genesis Locations constructed within the Fletcher Gulch Drainage, and the access road(s) leading to the Locations (accessed via Co. Rd 122). Locations/Access roads subject to 1004 Reclamation.