

Inspection Photos

4/27/2023

Operator: GENESIS GAS & OIL COLORADO LLC
- 10384

Location Number: 413496
Rio Blanco County, CO

Aaron Trujillo
NW Reclamation Specialist
COGCC

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 1: Photos 1-2 taken from the northwest end of the Location. Photos provide an overview of the Location from northeast, southeast, south to southwest. Photos show final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the Location.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 2: See comments under photo 1.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



April 27, 2023



April 27, 2023

Photo 3: Photo of equipment remaining on the Location.



COLORADO
Oil & Gas Conservation
Commission
Department of Natural Resources

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 4: Photo shows well marker. Well has not been drilled. All Form 2 and Federal permits to drill have expired.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 5: Photos taken from the north end of the Location. Photo shows stormwater runoff from the location has resulted in gully erosion at the slopes of the Location; BMPs to allow for proper stormwater discharge in such a manner as to minimize erosion, degradation and off-site sediment transport inadequate.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 6: Soil stockpiles on the north end of the Location.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 7: Photos taken from the cut slopes on the northeast end on the Location. Photos examples showing cut slopes lack stabilization. BMPs to minimize erosion, degradation and sediment transport missing or insufficient. Lighter soils observed at base of slopes is sediment deposition due to unstabilized cut slopes.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 8: Photo taken from the access road. Fallen tree partially blocking access road. Photo also example showing cut slopes of the access road lack stabilization, resulting in erosion degradation and sediment deposition onto the road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 9: Example of surface equipment remaining along access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 10: Photos taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the access road. Photos also examples of culverts observed remaining along the access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 11: Photos 11-13 taken from the access road. Photos examples showing final reclamation including, but not limited to, compaction alleviation, recontouring/regrading and reclaiming has not been conducted on the entire access road. Photos also show erosion degradation at access road due to inadequate stormwater management and slope stabilization.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



April 27, 2023



April 27, 2023

Photo 12: See comments under photo 11.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496



Photo 13: See comments under photo 11. Photo right shows sediment discharge/deposition from the access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496

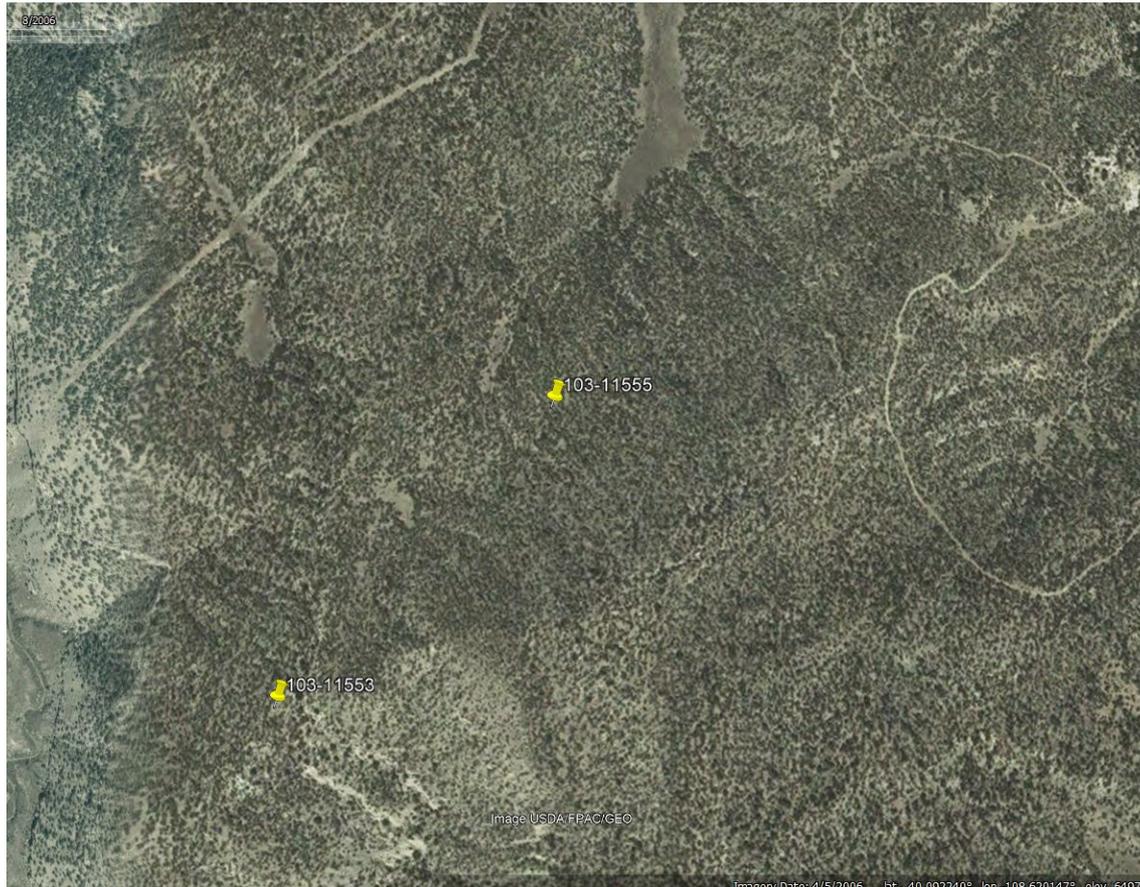


Photo 14: 2006 Google Earth aerial imagery showing the expired Genesis FGSU #4-12 and FGSU #33-42 Locations, prior to construction of the Locations and access road.

Inspection Photos

Operator Name: GENESIS GAS & OIL COLORADO LLC - 10384

Location Number: 413496

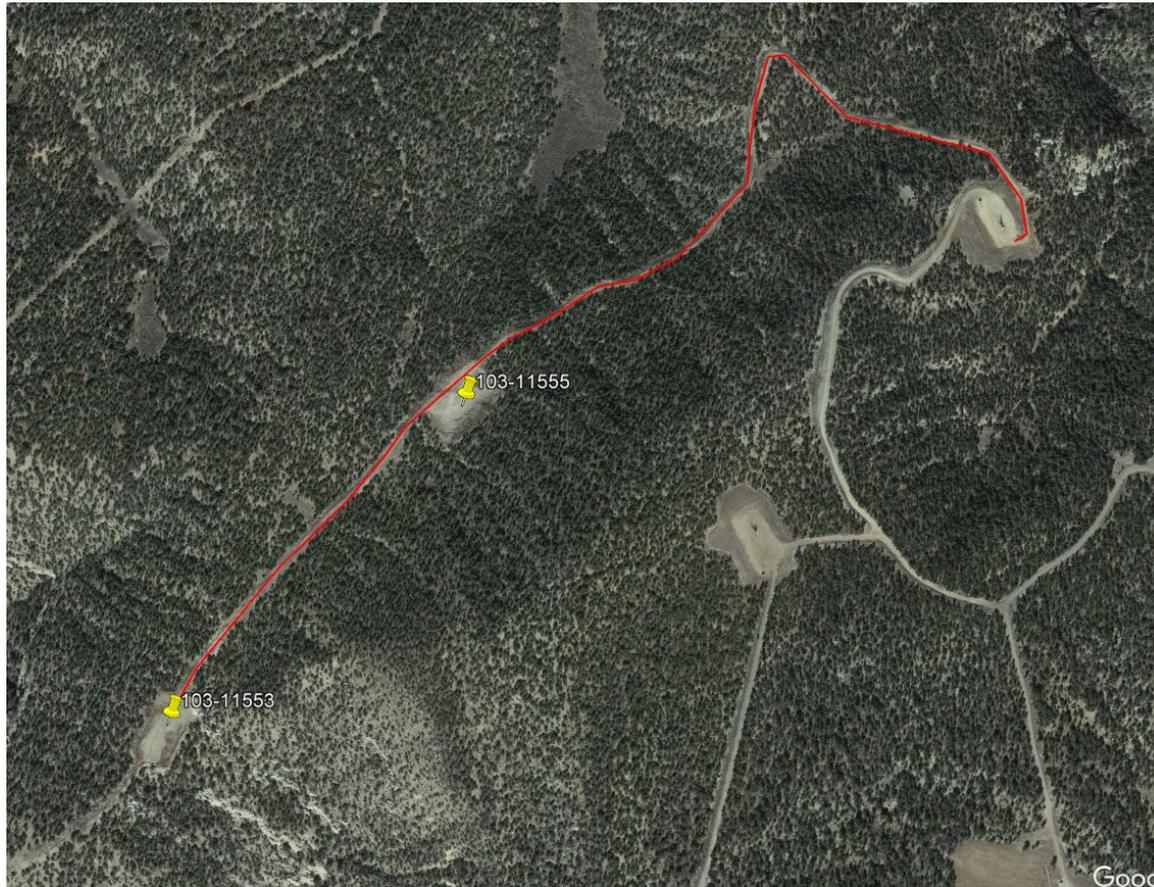


Photo 15: Google Earth aerial imagery showing the expired Genesis FGSU #4-12 and FGSU #33-42 Locations and the access road leading to the Locations. Locations/Access roads subject to 1004 Reclamation.