

DUCO INCORPORATED

CMT Package

Well Servicing Company
 2403 1/2 E. Main - PO Box 416 (mailing)
 Rangely, CO 81648
 Phone (970-629-1906 or (970)-675-8685

10-24 (2024)
 INVOICE #: E91.2024

COMMENTS

All CMT pumped by Duco in
 will be 15.8lbs 1.15 yield class
 g neat.

Hiring Company: Ensign

CMT truck operator: Gilberto Verduzco
 CMT Operator #2:
 Pod trailer operator: Jorge Gomez
 Labor Hand:
 Labor Hand:
 Supervisor: Lane Griffin
 Pump Unit #: RCM-2

Fuel Used: 37 Gallons
 Lease: Pettinger 42-3

PO:
 Company Foreman: Matt McGraw Rig 356
 Chevron WSR: Cady Jones

Hour Work Started: D1: 7:00AM D2: D3: D4:
 Hour Work Completed: D1: 12:00PM D2: D3: D4:

BREAKDOWN OF CHARGES	HOURS/QTY.	RATE	AMOUNT	
Initial 4 HRS: CMT truck and Pod trailer	1.00	\$0.00	\$ -	
Additional Hours	1.00	\$0.00		
SKS of CMT	313.00	\$0.00		
Calcium (LBS)	0.00	\$0.00		
Standby Rate	0.00	\$0.00		
Mudflush Detergent (Gal)	0.00	\$0.00		
Clay Control (Gal)	0.00	\$0.00		
Defoamer (Gal)	0.00	\$0.00		
RCR-201 Retarder (LBS)	0.00	\$0.00		
RFL-70X Fluid Loss (LBS)	0.00	\$0.00		
Sodium Metasilicate (LBS)	0.00	\$0.00		
Radilock 3mm Fiber LCM (LBS)	0.00	\$0.00		
Pol-E-Flake (LBS)	0.00	\$0.00		
Cancellation	0.00	\$0.00		
Trucking Hours	0.00	\$0.00		
SKS of 2K THIXO CMT	0.00	\$0.00		
SKS of 1K THIXO CMT	0.00	\$0.00		
SKS of ECOMAG CMT	0.00	\$0.00		
DESCRIPTION OF WORK PERFORMED:				
Rig up and meet with company man and crew for procedure review and safety meeting. Pump Lines pressure tested to 3000PSI Daily. Day One (10-24-24): First Pump: EOT 2030'. Break circulation and lead with 5 BBLS FW. Mix and pump 10sks/2.04 BBLS slurry 15.8# class G cement neat. 1.19 BBLS mix water used for slurry. 132' plug EST TOC 1898'. Displace 7.3 BBLS FW to balance. Second Pump: EOT 1054' and holes at 750'. Break circulation and lead with 5 BBLS FW. Mix and pump 283sks/58 BBLS slurry 15.8# class G cement neat. 33.7 BBLS mix water used for slurry. Circulate cement to surface inside casing and annulus. TOH. Top Off: Mix and pump 5sks/1 BBLS slurry 15.8# class G cement neat. Additional 15sks/3 BBLS slurry pumped to waste tank. Good cement at surface. Clean up and rig down cement equipment.			SUBTOTAL	\$ -
			TAX RATE	0.00%
			SALES TAX	-
			OTHER	
			TOTAL	\$ -

#

All accounts net 30 days. 24% per annum interest plus cost of attorney's fees and collection fees

THANK YOU FOR YOUR BUSINESS!



JOB REPORT

DUCO INC.

COMPANY DETAILS

Company: *Chevron*
Contact: *Cody Jones*
Phone: *0*

Email: *0*



JOB DETAILS

Date: *10-24-24*
Start Time: *08:16:59*
End Time: *08:18:58*

Operator: *Gilberto Verduzco*
Ticket #: *0*
LSD #: *1st pump 10sks class G 15.8#*

Comments: *Pettinger 42-3*

SUMMARY GRAPHS

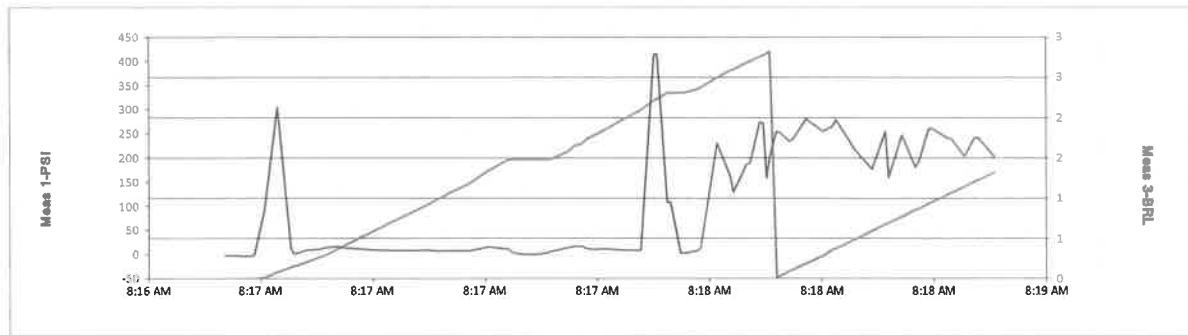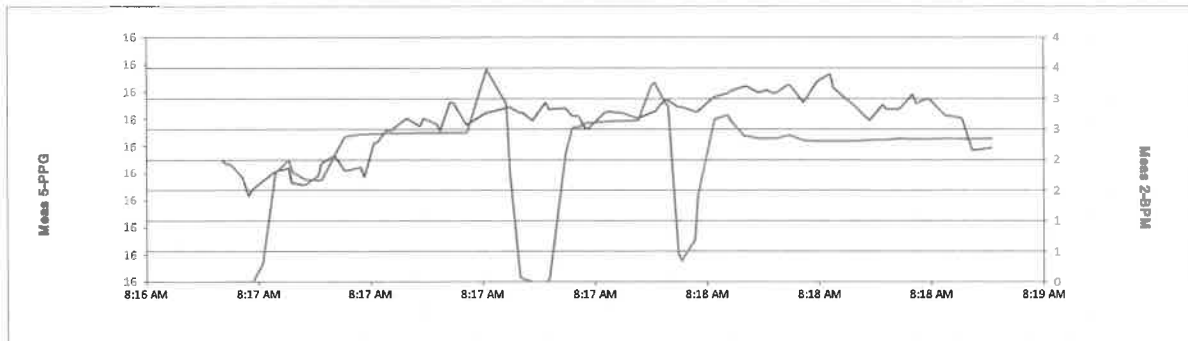

Report Created: *0*



JOB REPORT

DUCO INC.

COMPANY DETAILS

Company: *Chevron*
Contact: *Cody Jones*
Phone: *0*

Email: *0*



JOB DETAILS

Date: *10-24-24*
Start Time: *09:04:20*
End Time: *09:26:59*

Operator: *Gilberto Verduzco*
Ticket #: *0*
LSD #: *2nd pump IC surface 190sks class G 15.8#*

Comments: *Pettinger 42-3*

SUMMARY GRAPHS

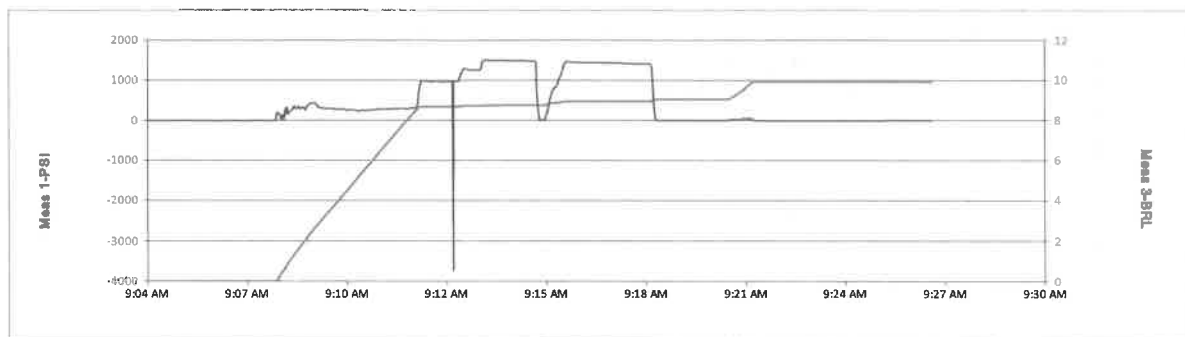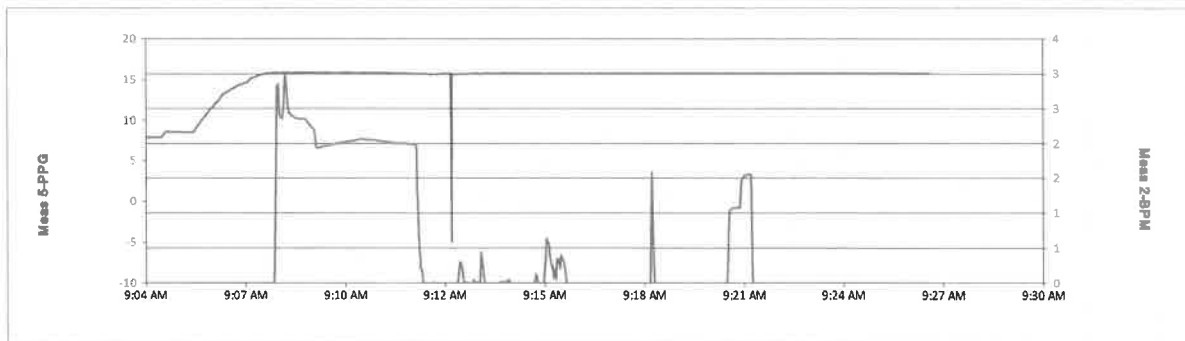

Report Created: *0*



JOB REPORT

DUCO INC.

COMPANY DETAILS

Company: *Chevron*
Contact: *Cody Jones*
Phone: *0*

Email: *0*



JOB DETAILS

Date: *10-24-24*
Start Time: *10:10:50*
End Time: *10:13:59*

Operator: *Gilberto Verduzco*
Ticket #: *0*
LSD #: *2nd pump IA surface 93sks class G 15.8#*

Comments: *Pettinger 42-3*

SUMMARY GRAPHS

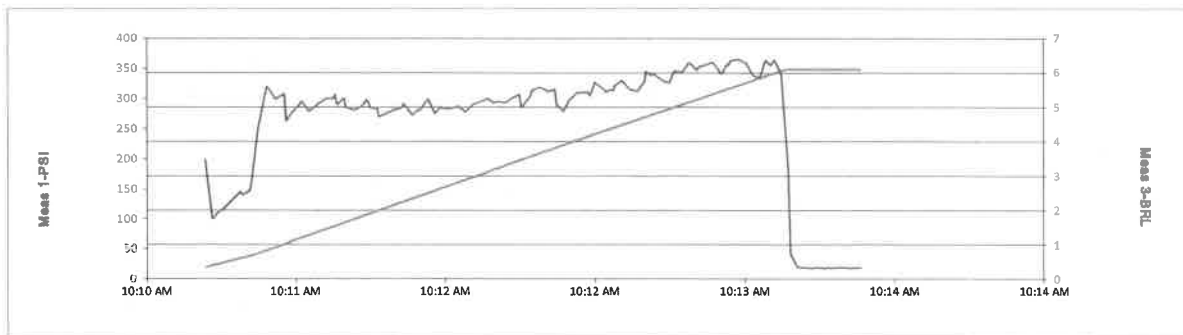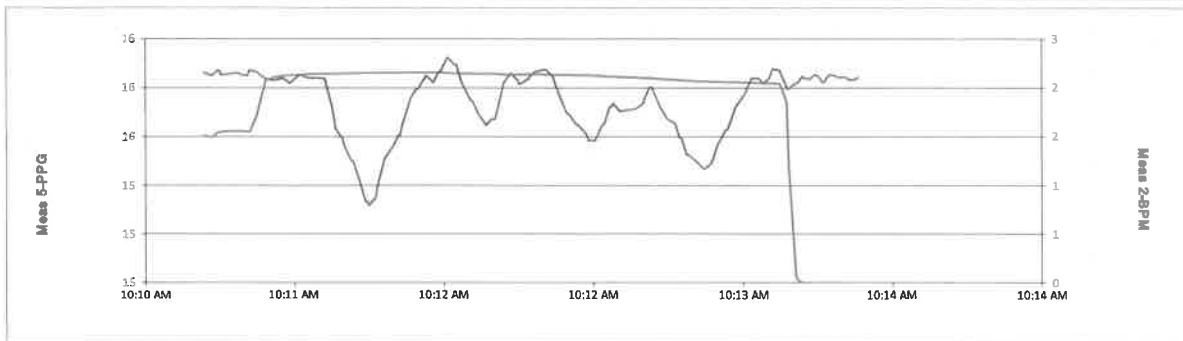

Report Created: *0*