



Closure Checklist

Closure Type: Wellhead Closure

Site Name: Kennedy 14-2

Remediation #.: 39979

Latitude, Longitude.: 40.248870,-104.747180

General Condition of Site: Good

USCS Soil Type: SM - Sands with fines - sand/silt mixture

Estimated Depth of Groundwater **more than 20' bgs**

Hydrocarbon Impacted Soils/Spills **None Observed**

Salt Crusted Soils or Impacted Vegetation **None Observed**

Soil Samples

#	Date	Time	Sample ID	PID	Visual	Olfactory	Equipment	Lab
1	5/13/2025	12:20	WH-B01@7'	2.3	No Staining	No odor	Wellhead	
2	5/13/2025	12:22	WH-B01-01@7'	2.3	No Staining	No odor	Wellhead	
3	5/13/2025	12:38	WH-N01@6'	2.4	No Staining	No odor	Wellhead	
4	5/13/2025	12:40	WH-E01@6'	2.6	No Staining	No odor	Wellhead	
5	5/13/2025	12:42	WH-W01@6'	2.2	No Staining	No odor	Wellhead	
6	5/13/2025	12:26	WH-RIS@4'	3.0	No Staining	No odor	Flowline at Wellhead	
7	5/13/2025	12:28	WH-RIS-01@4'	3.0	No Staining	No odor	Flowline at Wellhead	
8	5/13/2025	12:54	WHS-N01@3"	1.3	No Staining	No odor	Wellhead Surface	
9	5/13/2025	12:56	WHS-E01@3"	1.2	No Staining	No odor	Wellhead Surface	
10	5/13/2025	12:58	WHS-S01@3"	0.9	No Staining	No odor	Wellhead Surface	
11	5/13/2025	1:00	WHS-W01@3"	1.1	No Staining	No odor	Wellhead Surface	
12	5/13/2025	10:15	WH-BG01@3'	3.5	No Staining	No odor	Wellhead Background	
13	5/13/2025	10:20	WH-BG01@6'	3.0	No Staining	No odor	Wellhead Background	
14	5/13/2025	10:25	WH-BG02@3'	2.1	No Staining	No odor	Wellhead Background	
15	5/13/2025	10:30	WH-BG02@6'	1.6	No Staining	No odor	Wellhead Background	
16	5/13/2025	10:35	WH-BG03@3'	1.9	No Staining	No odor	Wellhead Background	
17	5/13/2025	10:40	WH-BG03@6'	2.3	No Staining	No odor	Wellhead Background	
18	5/13/2025	10:45	WH-BG04@3'	2.7	No Staining	No odor	Wellhead Background	

19	5/13/2025	10:50	WH-BG04@6'	3.1	No Staining	No odor	Wellhead Background	
20	5/13/2025	12:42	WH-S01@6'	2.4	No Staining	No odor	Wellhead	

1 - P1



Looking north

8 - P1



Looking north

9 - P1



Looking north

10 - P1



Looking north

11 - P1



Looking north

12 - P1



Looking northwest

14 - P1



Looking north

16 - P1




Looking northwest

18 - P1



Looking northwest

20 - P1

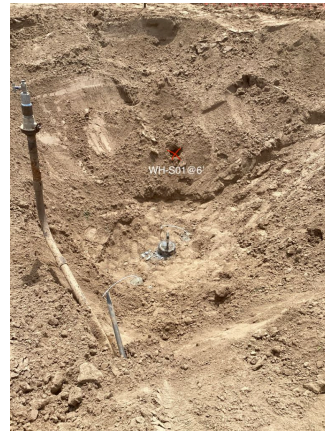

Looking south

Was impacted soil identified?: No

Total number of soil samples field screened: 20

Total number of soil samples collected: 20

Highest PID reading: 3.5

Total number of soil samples submitted for analysis: 12

Was groundwater encountered during the investigation **No**

Measured Depth to Groundwater:

Was remedial groundwater removal conducted?

**Date groundwater
was encountered:**

**Commencement date
of removal:**

Sheen on groundwater?

Free product observed?

**Volume of
groundwater
removed prior to
sampling:**

**Volume of
groundwater
removed post
sampling:**

**Total volume of
groundwater
removed:**

**Total volume of
groundwater
samples collected:**

**Total volume of
groundwater
samples submitted
to lab for analysis:**

Signature

A handwritten signature in cursive script, appearing to read "J. M. Miller", is written below the signature label.