

WELL NAME: HILL RANCH 36-13, API #: 071-08253, INSP. # 716301790

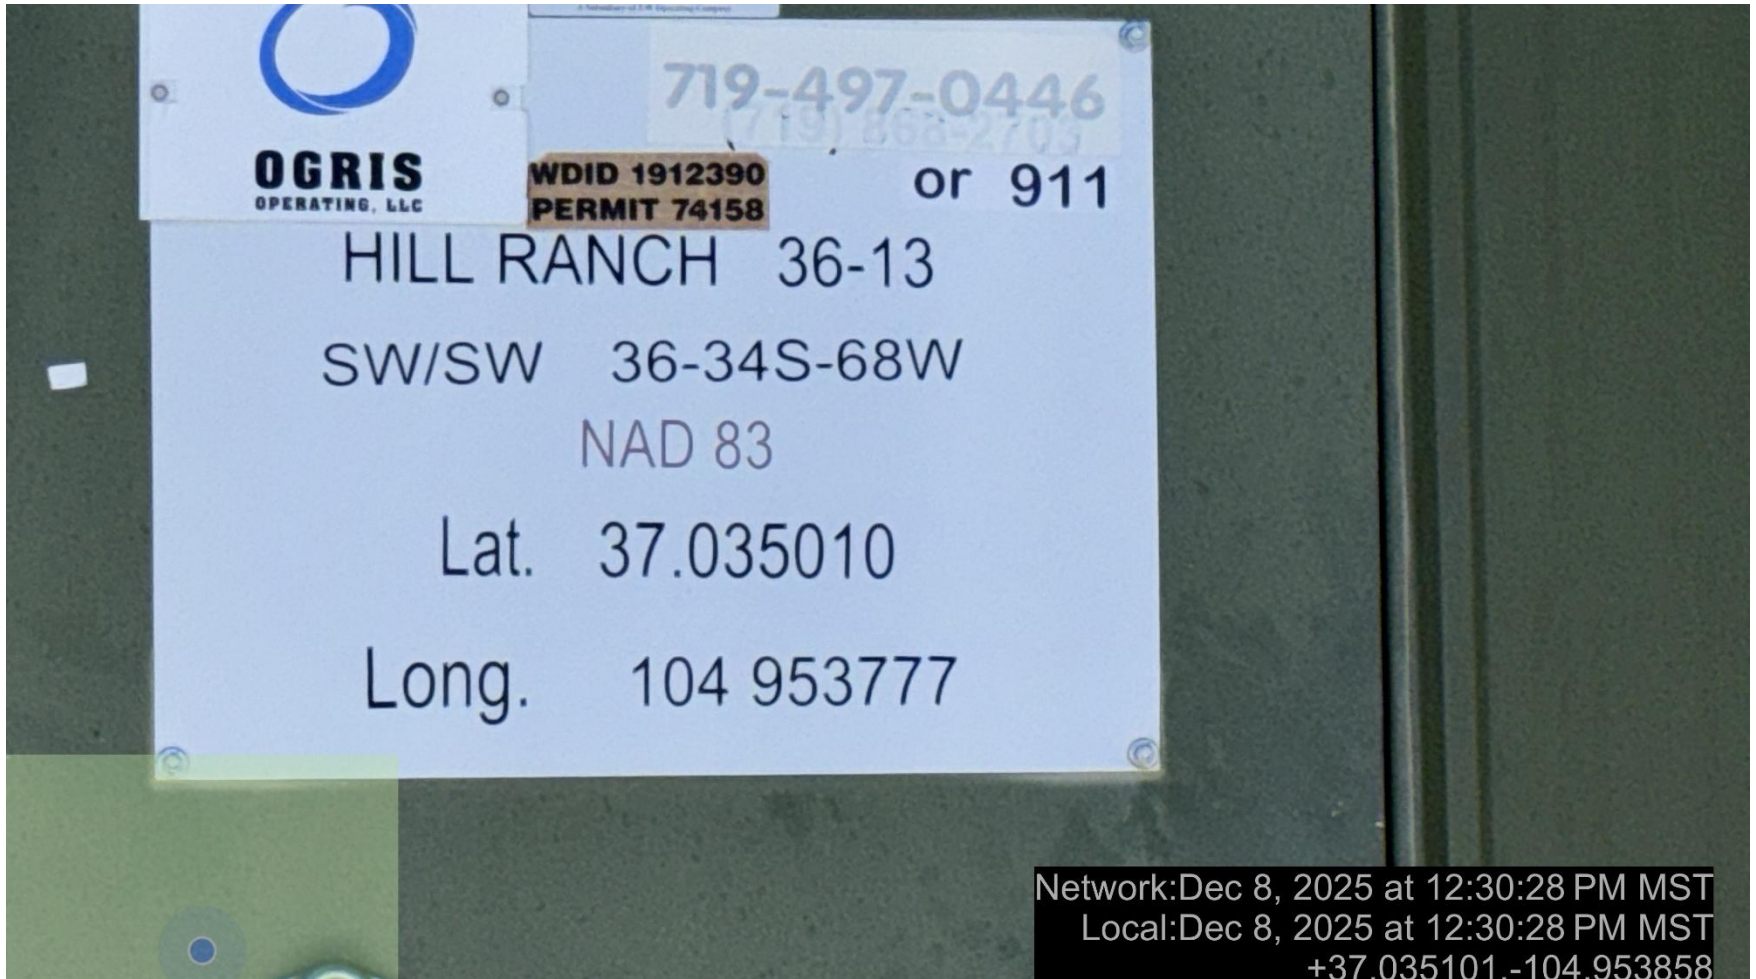


PHOTO 1: WELL SIGN



PHOTO 2: LOCATION.



Network: Dec 8, 2025 at 12:29:47 PM MST
Local: Dec 8, 2025 at 12:29:47 PM MST
+37.034793, -104.953676
Los Animas County

PHOTO 3: WELLHEAD AND EQUIPMENT.



Network: Dec 8, 2025 at 12:31:18 PM MST
Local: Dec 8, 2025 at 12:31:18 PM MST
+37.035026, -104.953830
Los Animas County

PHOTO 4: IMPACTED OIL NEAR PRIME MOVER SKID. Conduct maintenance on equipment, cleanup stained material and review self inspection processes. COMPLY WITH RULE 1002,(2).D. CA DATE 12-15-2025.



PHOTO 5: IMPACTED OIL NEAR PRIME MOVER SKID. Conduct maintenance on equipment, cleanup stained material and review self inspection processes. COMPLY WITH RULE 1002,(2).D. CA DATE 12-15-2025.



Network: Dec 8, 2025 at 12:32:35 PM MST
Local: Dec 8, 2025 at 12:32:35 PM MST
+37.035004, -104.953798
Los Animas County

PHOTO 6: PACKING IS LEAKING ON TBG. Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition. Engineer, operate, and maintain equipment within the manufacturer's recommended specifications per Rule 608.e. CA DATE 12-9-2025.



PHOTO 7: PRIME MOVER IS BLOWING OIL OUT OF EXHAUST PIPES. Securely fasten all valves, pipes, fittings, and Production Facilities to ensure good mechanical condition, inspect at regular intervals and maintain in good mechanical condition. Engineer, operate, and maintain equipment within the manufacturer's recommended specifications per Rule 608.e. CA DATE 12-9-2025.



Network: Dec 8, 2025 at 12:31:28 PM MST
Local: Dec 8, 2025 at 12:31:28 PM MST
+37.035026, -104.953830
Las Animas County

PHOTO 8: OILY WASTE IS PRIME MOVER SKID. DRAIN OILY WASTE REPAIR ALL LEAKS AND REMOVE IMPACTED SOIL PER RULE 1002.(2).D & 1002.f.(2)B, Comply with general provisions of the oil and gas act for wildlife protection AND SB-181. CA DATE 12-9-2025.