



## Closure Checklist

**Closure Type:** Facility Closure

**Site Name:** Overlook 7 28 2 8-30 Facility

**Remediation #.:** 36832

**Latitude, Longitude.:** 40.112923, -104.924179

**General Condition of Site:** Good

**USCS Soil Type:** SC - Sands with fines - sand/clay mixture

Estimated Depth of Groundwater **more than 20' bgs**

Potential Hydrocarbon Impacted Soils/Spills **None Observed**

Salt Crusted Soils or Impacted Vegetation **None Observed**

**Soil Samples**

#	Date	Time	Sample ID	PID	Visual	Olfactory	Equipment	Lab
1	01/20/2026	9:05	AST-B01 @3"	1.2	No Staining	No odor	Above-ground Storage Tank	Yes
2	01/20/2026	9:10	AST-B02 @3"	0.4	No Staining	No odor	Above-ground Storage Tank	No
3	01/20/2026	9:15	AST-B03 @3"	0.7	No Staining	No odor	Above-ground Storage Tank	Yes
4	01/20/2026	9:20	AST-B04 @3"	1.0	No Staining	No odor	Above-ground Storage Tank	No
5	01/20/2026	9:25	AST-B05 @3"	0.6	No Staining	No odor	Above-ground Storage Tank	Yes
6	01/20/2026	9:30	AST-B06 @3"	0.8	No Staining	No odor	Above-ground Storage Tank	No
7	01/20/2026	9:35	AST-B07 @3"	0.4	No Staining	No odor	Above-ground Storage Tank	Yes
8	01/20/2026	9:40	AST-B08 @3"	1.1	No Staining	No odor	Above-ground Storage Tank	
9	01/20/2026	10:00	PW-B01 @4'	2.7	No Staining	No odor	Produced Water Tank	Yes
10	01/20/2026	10:05	PW-N01 @2'	0.8	No Staining	No odor	Produced Water Tank	No
11	01/20/2026	10:10	PW-E01 @2'	0.4	No Staining	No odor	Produced Water Tank	No
12	01/20/2026	10:15	PW-S01 @2'	1.2	No Staining	No odor	Produced Water Tank	Yes
13	01/20/2026	10:20	PW-W01 @2'	0.7	No Staining	No odor	Produced Water Tank	No
14	01/20/2026	10:45	SEP-B01 @3"	1.7	No Staining	No odor	Separator	Yes
15	01/20/2026	10:50	SEP-B02 @4'	0.8	No Staining	No odor	Separator	Yes
16	01/20/2026	10:55	SEP-B03 @3"	0.4	No Staining	No odor	Separator	Yes
17	01/20/2026	11:00	SEP-B04 @2'	0.6	No Staining	No odor	Separator	Yes
18	01/20/2026	11:15	MH-B01 @3"	0.7	No Staining	No odor	Meter House	No


19	01/20/2026	11:20	ECD-B01@3"	1.1	No Staining	No odor	Emissions Control Device	No
20	01/20/2026	11:25	ECD-B02@3"	1.3	No Staining	No odor	Emissions Control Device	No
21	01/20/2026	11:30	BG-01@3"	2.5	No Staining	No odor	Background	Yes
22	01/20/2026	11:35	BG-02@3"	1.5	No Staining	No odor	Background	Yes
23	01/20/2026	11:40	BG-03@3"	1.3	No Staining	No odor	Background	Yes
24	01/20/2026	11:45	BG-04@3"	1.7	No Staining	No odor	Background	Yes
25	01/20/2026	14:00	BG-05@3'	1.8	No Staining	No odor	Background	Yes
26	01/20/2026	14:05	BG-05@6'	2.2	No Staining	No odor	Background	Yes
27	01/20/2026	14:20	BG-06@3'	1.1	No Staining	No odor	Background	Yes
28	01/20/2026	14:25	BG-06@6'	1.3	No Staining	No odor	Background	Yes
29	01/20/2026	14:40	BG-07@3'	1.5	No Staining	No odor	Background	Yes
30	01/20/2026	14:45	BG-07@6'	1.4	No Staining	No odor	Background	Yes
31	01/20/2026	15:00	BG-08@3'	1.0	No Staining	No odor	Background	Yes
32	01/20/2026	15:05	BG-08@6'	1.2	No Staining	No odor	Background	Yes
33	03/30/2026	11:10	AST-B01@6'	1.1	No Staining	No odor	Above-ground Storage Tank	Yes
34	03/30/2026	11:20	AST-B03@6'	2.4	No Staining	No odor	Above-ground Storage Tank	Yes
35	03/30/2026	11:30	AST-B05@6'	2.7	No Staining	No odor	Above-ground Storage Tank	Yes
36	03/30/2026	11:40	AST-B07@6'	2.3	No Staining	No odor	Above-ground Storage Tank	Yes

1 - P1



Facing north

3 - P1

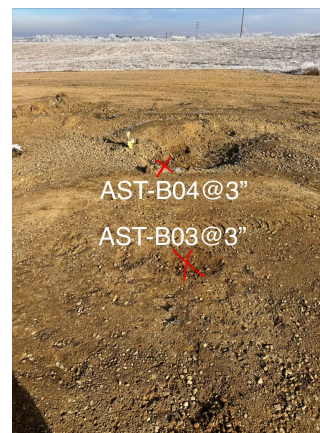


Facing north

5 - P1



Facing north

7 - P1

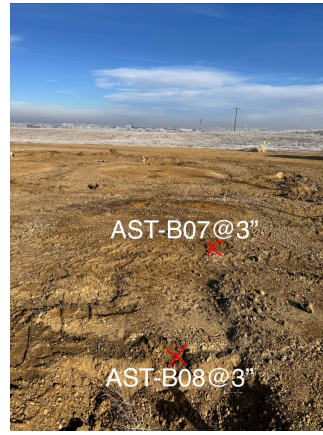

Facing north

9 - P1



Facing north

12 - P1



Facing south

14 - P1



Facing north

15 - P1



Facing north

16 - P1



Facing north

17 - P1



Facing north

18 - P1



Facing north

19 - P1



Facing east

21 - P1



Facing north

22 - P1



Facing north

23 - P1



Facing north

24 - P1



Facing north

25 - P1



Facing north

27 - P1



Facing north

29 - P1



Facing north

31 - P1



Facing north

33 - P1



Facing north

34 - P1



Facing north

35 - P1



Facing north

36 - P1



Facing north

Was potentially impacted soil identified?: No

Total number of soil samples field screened: 36

Total number of soil samples collected: 36

Highest PID reading: 2.7

Total number of soil samples submitted for analysis: 26

Was groundwater encountered during the investigation No

Measured Depth to Groundwater:

Was remedial groundwater removal conducted?

**Date groundwater  
was encountered:**

**Commencement date  
of removal:**

Sheen on groundwater?

Free product observed?

**Volume of  
groundwater  
removed prior to  
sampling:**

**Volume of  
groundwater  
removed post  
sampling:**

**Total volume of  
groundwater  
removed:**

**Total volume of  
groundwater  
samples collected:**

**Total volume of  
groundwater  
samples submitted  
to lab for analysis:**

**Signature**

A handwritten signature in black ink, appearing to be "A. B.", written in a cursive style.