

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



3. Access road from site looking NE towards highway 550.



4. Access road from highway 550 looking west towards location.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



5. Close-up of well sign. “Emergency Contact # 866-598-6220 or 911”.

6. Detail from map generated on FEMA website. The entire location and all associated equipment lies within the flood plain area. <https://www.fema.gov/flood-maps/national-flood-hazard-layer>. Pin = wellhead location. A copy of the map with a legend is included as a link in the attachments.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



7. Back view of wellhead looking north.



8. One of four marked rig anchors.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



9. Produced water tank and secondary containment. The tank appears to be new or freshly painted, and the secondary containment appears new. Water is approximately 4 inches deep. There is no indication of tank anchoring. Lacks any signs, labels or placards

10. Unmarked rig anchor near tank.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



11. Concrete pad at former separator location, but flow line on left remains in use. Cut-off line on right. Newer meter run shed in background.



12. 1" Unmarked riser, open at one end with no valve or cap, appears abandoned. Excess cable wrapped around meter riser.


Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



13. Meter run shed with solar telemetry, appears to be recently constructed. Separate solar telemetry with electric service panel.

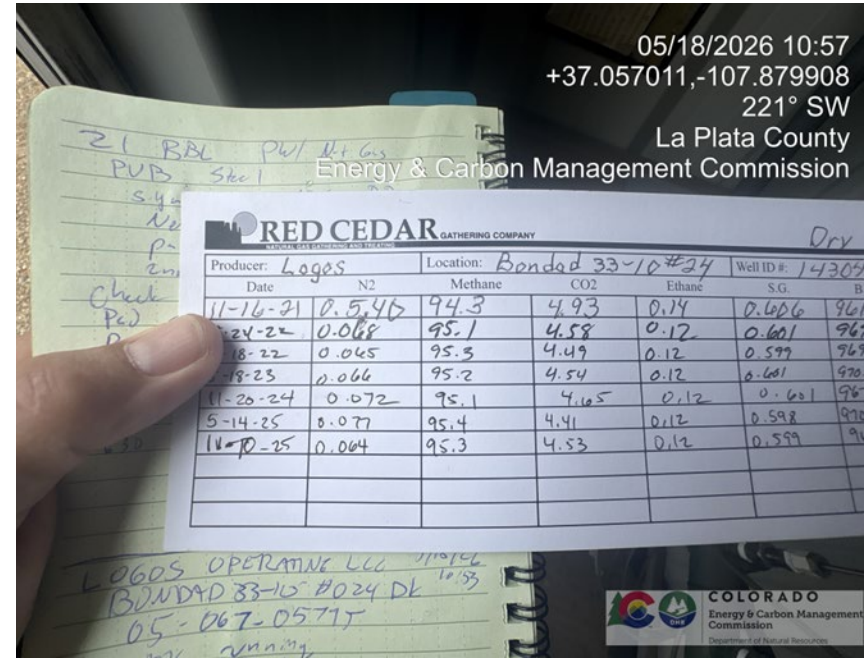

14. Meter calibration card. Dated 11/10/2025.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



15. Location overview looking west showing new produced water tank and meter run. Note undesirable vegetation growing around tank.



16. Location overview looking south, showing horizontal heated separator, produced water tank, electrical control panel, and wellhead. Weeds and dead vegetative debris near separator.

Inspection Photos

Location Name: Logos Operating Inc. Bondad 33-10 #24

Location ID: API 05-067-05775



17. Location overview looking southeast showing wellhead separator and produced water tank.



18. Skid mounted horizontal separator rests on concrete footers, but does not appear to be anchored to footing.